

HO-797, Tutbury Gardeners Cottage
6450 Elibank Drive, Elkridge
ca. 1850
Private

CAPSULE SUMMARY

The Tutbury Gardeners Cottage, located at 6450 Elibank Drive in Lawyers Hill is an eclectic example of architectural change over time. Originally constructed as a small one room cottage with a loft above, the house has been added onto several times over the years. Stylistically, the house is a mixture of Gothic Revival, Italianate, and Craftsman. The frame structure is two stories high and five bays wide and rests on a variety of foundations made of stone, brick and cinderblock. The house is now part of a working horse farm and is surrounded by 16.7 acres. Two additional historic outbuildings are on the property located immediately to the east of the Gardeners Cottage. Two large modern horse barns are located slightly further to the east. The topography of the property is a mixture of gradual and steep slopes. Several streams, large mature trees, and elaborate flower gardens characterize the surrounding landscape.

The Tutbury Gardeners Cottage is significant under criteria C in the area of architecture. The property derives its primary significance from its original association with the Tutbury estate but is also significant in its own right as an example of Gothic cottage architecture that has grown and evolved to meet the needs of each different owner. The property is also a contributing property in the Lawyers Hill National Register District which is significant not only for its architecture but also for its large lots and natural landscape.

Maryland Historical Trust

Maryland Inventory of Historic Properties Form

Inventory No. HO-797

1. Name of Property (indicate preferred name)

historic Tutbury Gardeners Cottage

other

2. Location

street and number 6450 Elibank Drive not for publication

city, town Elkridge vicinity

county Howard

3. Owner of Property (give names and mailing addresses of all owners)

name Joyce Glover and Dermid McDonald

street and number 6450 Elibank Drive telephone

city, town Elkridge state MD zip code 21075

4. Location of Legal Description

courthouse, registry of deeds, etc. Howard County Courthouse tax map and parcel: Map 32, P 8

city, town Ellicott City liber 1170 folio 112

5. Primary Location of Additional Data

- Contributing Resource in National Register District
- Contributing Resource in Local Historic District
- Determined Eligible for the National Register/Maryland Register
- Determined Ineligible for the National Register/Maryland Register
- Recorded by HABS/HAER
- Historic Structure Report or Research Report
- Other

6. Classification

Category	Ownership	Current Function	Resource Count	
			Contributing	Noncontributing
<input type="checkbox"/> district	<input type="checkbox"/> public	<input checked="" type="checkbox"/> agriculture		
<input checked="" type="checkbox"/> building(s)	<input checked="" type="checkbox"/> private	<input type="checkbox"/> commerce/trade	3	2
<input type="checkbox"/> structure	<input type="checkbox"/> both	<input type="checkbox"/> defense		
<input type="checkbox"/> site		<input checked="" type="checkbox"/> domestic		
<input type="checkbox"/> object		<input type="checkbox"/> education		
		<input type="checkbox"/> funerary	3	2
		<input type="checkbox"/> government		
		<input type="checkbox"/> health care		
		<input type="checkbox"/> industry		
		<input type="checkbox"/> landscape		
		<input type="checkbox"/> recreation/culture		
		<input type="checkbox"/> religion		
		<input type="checkbox"/> social		
		<input type="checkbox"/> transportation		
		<input type="checkbox"/> work in progress		
		<input type="checkbox"/> unknown		
		<input type="checkbox"/> vacant/not in use		
		<input type="checkbox"/> other:		
			Number of Contributing Resources previously listed in the Inventory	
			0	

7. Description

Inventory No. HO-797

Condition

<input type="checkbox"/> excellent	<input type="checkbox"/> deteriorated
<input checked="" type="checkbox"/> good	<input type="checkbox"/> ruins
<input type="checkbox"/> fair	<input type="checkbox"/> altered

Prepare both a one paragraph summary and a comprehensive description of the resource and its various elements as it exists today.

The Tutbury Gardeners Cottage, located at 6450 Elibank Drive in Lawyers Hill is an eclectic example of architectural change over time. Originally constructed as a small one room cottage with a loft above, the house has been added onto several times over the years. Stylistically, the house is a mixture of Gothic Revival, Italianate, and Craftsman. The frame structure is two stories high and five bays wide and rests on a variety of foundations made of stone, brick and cinderblock. The house is now part of a working horse farm and is surrounded by 16.7 acres. Two additional historic outbuildings are on the property located immediately to the east of the Gardeners Cottage. Two large modern horse barns are located slightly further to the east. The topography of the property is a mixture of gradual and steep slopes. Several streams, large mature trees, and elaborate flower gardens characterize the surrounding landscape.

In its earliest incarnation, the Tutbury Gardeners Cottage was a one-story frame structure on a stone or brick foundation with a steeply pitched cross gabled roof over a useable loft space. A full width porch spanned the west façade. A small, decorative cupola perches atop the center of the cross gables. Two diamond-paned casement windows occupy the first story of the east façade and originally framed a chimney that served a fireplace centered on that wall. The fireplace has been closed for many years and the chimney dismantled (1). The north and south facades are identical with a 6/6 window centered on the first story and another 6/6 window in the gable above. The west façade would have held the porch and the front door. Presently, the entire house, including the original section, is covered with cedar shingles. According to the owner, there is wooden German siding underneath the shingles on the original portion of the structure. The roof on the original portion of the house is wood shingle. The foundation is brick.

Sometime relatively early on, the front porch was enclosed and a two-story frame addition was added to the western end of the original structure. The addition consisted of one large room on the first floor along with a new entry and stair and a stair foyer and room on the second story. With this addition the front of the house became the south instead of the west façade. The front door was added to the area that had been the porch so that it was in between the two rooms of the first floor. To the left of the door, in the new addition, are two 6/6 windows on the first story. The second story of the addition has one central cross gable with a replacement vinyl window. The front door is flanked by two-light sidelights over molded panels. Matching molded panels also decorate the front door. The cornice features decorative exposed rafter tails and the open rake of the gable is supported by large triangular knee braces. A brick chimney is located on what was the western wall of the first addition and is now the interior dividing wall between the first and second additions. The rear (north) façade of this first addition is partially covered by the most recent addition (a one-story laundry room) but the visible bay contains two vertically aligned 6/6 windows, one on each story. The second story window has a small cross gable over it. A large dormer window was added on the rear slope of the roof connecting the original section with the addition. This window is in the stairwell and was probably a twentieth century alteration since the large 12/12 window is completely out of scale with the windows found in the rest of the house. The roof over the addition is side gabled. The connection between the original house and the addition was made by extending the western gable of the original house to meet the wall of the new addition. This extension has wood shingles like the roof on the original house but the side gabled roof of the first addition is covered with asphalt shingles. Like the rest of the house, the walls of this section are covered with cedar shingles. Unlike the original section of the house, this portion rests on a stone foundation.

The second major addition, made on the west façade of the first addition, is also a frame structure two stories high with one room on each floor. The foundation of this addition is cinder block. This section of the house has one 6/6 window on each story, vertically aligned, on the front (south) façade and the entire rear façade is covered by the later kitchen addition. The west façade of this addition, which is also the west façade of the entire house, has one 6/6 window on the second story and a pair of French doors on the first story. The French doors lead onto a single story wrap around porch that spans the front of the house from the front door all the way across both of the additions and wraps around the west side of the house. The porch columns are plain square wood posts with scroll bracket detail at the tops. The balustrade has square balusters. The portion that wraps around the west side of the house has been enclosed with jalousie windows.

Maryland Inventory of Historic Properties Form

Name Tutbury Gardeners Cottage

Continuation Sheet

Number 7 Page 1

Another addition, this one only one story and with a shed roof, was added to the north façade of the second addition. This room accommodates a kitchen on the first floor and a small extension of the bedroom on the second floor. The north façade of this addition has a 6/6 gabled dormer providing light to the second story and a 6/6 window on the first story. The west façade of this addition features one 6/6 window on the first story. The east façade of this addition is covered by the final addition to the house – a small, one story shed roofed laundry room. The laundry room has vinyl windows and a modern steel faux-paneled door. Both the laundry room and kitchen additions have cinder block foundations and asphalt shingle roofs. The exterior walls are clad in cedar shingles like the rest of the house.

The interior of the house is in good condition but has been modified pretty extensively over the years. The original portion of the house features very plain door and window trim with no decoration. The floor on the first story is carpeted. The existing door between the original section and the first addition is a four panel wood door. The existing lock is a replacement and the hinges have pins rather than being cast so there is no evidence that this is an original door. A very small bathroom was added in the northwest corner of this room. According to the current owner, when she was removing wallpaper and repairing the eastern wall of the room, it was obvious that there had been a fireplace there at one time. This evidence is no longer visible and there is no chimney on the exterior. The room on the second story has sloping walls and exposed beams from the steep cross gabled roof. It has a wood floor but the boards are substantially narrower than those in the first addition and may have been replaced at one time.

The first addition, consisting of the enclosed porch and one room on each floor, has also been heavily redone on the inside. The space that occupies the enclosed porch contains a stacked stairwell leading to the second floor and the basement and an entry foyer but no wall separates the enclosed porch space from the additional room. The walls on the first floor have been paneled and the fireplace has been reworked. The fireplace surround is currently all brick with a scalloped wood mantle shelf. When the second major addition was made, the back of the fireplace was opened up so that it became a double-sided fireplace and the front may have been reworked at that time. On the second floor, what was originally a bedroom has been converted into a hall with several closets and a bathroom that leads to the bedroom in the second addition.

The first addition is the only portion of the house to have a basement. Stairs to the basement are stacked below the stair to the second floor and are concealed by a sliding bookcase. The basement has a cement floor and is filled with mechanical equipment. The joists visible overhead in the basement are sash sawn indicating that this addition occurred fairly early. By the 1850's, the transition to the circular saw for lumber production was fairly widespread and the use of sash sawn lumber dropped off considerably. It was still used occasionally, however, up until around 1870. It is also possible to see some of the framing of the original structure from this basement. It is apparent from the framing of the joists that the original structure had a porch that was enclosed and converted to living space at the same time that the first addition was made. The joists of this former porch are also sash sawn. Under the second addition, to the west of the first addition, there is only a crawl space and visible joists are circular sawn.

The second major addition consisted of two more rooms, one on each floor, added to the west side of the first addition. The interiors of both of these rooms have been heavily redone. The first floor room has a doorway that leads into the rear kitchen addition and a doorway leading onto the side porch which is enclosed with jalousie windows. The interiors of what is now the kitchen and the laundry room on the back of the house have also been extensively redone in recent years.

Two more historic outbuildings are located immediately to the east of the cottage. The one closest to the cottage is now an apartment and office but was a large garage in the early 20th century. The one story frame building has a front gabled roof covered with asphalt shingles. It rests on a stone foundation and has ample loft space in the attic. The entire east façade used to be taken up by four garage doors and has since been redone with siding and aluminum windows. The south façade of the building is now

Maryland Historical Trust

Maryland Inventory of Historic Properties Form

Inventory No. HO-797

Name Tutbury Gardeners Cottage
Continuation Sheet

Number 7 Page 2

the primary façade and it contains two windows and a door on the first story and a window in the gable. The door is Craftsman era and all of the windows are 6/6 wood. The entire building is covered with wooden German siding; the siding on the north, south, and west facades is original while the siding on the east dates to the renovation of the building into living space. Two 6/6 windows are found on the west façade. On the north façade, there is a door on the first story and an exterior stair leading to a door in the gable accessing what is now an office. The building has open eaves with exposed rafter tails. The interior of the building was not examined. The building was probably originally constructed as a garage in the early 20th century.

A large gabled roof barn is located just to the east of the garage. The large frame barn rests on a stone foundation and has board and batten siding. Large double doors are located on the east and west facades. Two 6 by 6 sliding windows are located on the south façade along with a door. Vents are located in the north and south gables. A one story shed roofed addition was made to the north end of the building. The interior has been heavily altered many times and it is unclear what the original partitioning may have been. Most of the visible framing members are circular sawn. Some pegged mortise and tenon joints are visible but the craftsmanship looks pretty late. The common rafter roof has the rafters mitered and nailed at the ridge. The only nails visible at eye level are wire nails.

Other notable landscape features include a brick path that runs around the north, east and south sides of the original portion of the cottage through mature and elaborate flower beds and a capped well located behind the original cottage in one of the flower beds. It isn't known when the path dates to but the current owner believes it has been there for at least the last 50 years. It is also worth noting that according to the current owner, north of the cottage, down the hill by the creek there used to be an ice pond and small ice house where residents would go to cut ice for cooling their perishable foods. The small ice house is no longer standing and the area is now in horse pasture.

(1) Personal communication with the current owner, Joyce McDonald, who claims that when she was redoing that wall on the inside of the house she saw evidence of the fireplace and hearth.

8. Significance

Inventory No. HO-797

Period	Areas of Significance	Check and justify below		
<input type="checkbox"/> 1600-1699	<input type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> health/medicine	<input type="checkbox"/> performing arts
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> archeology	<input type="checkbox"/> education	<input type="checkbox"/> industry	<input type="checkbox"/> philosophy
<input checked="" type="checkbox"/> 1800-1899	<input checked="" type="checkbox"/> architecture	<input type="checkbox"/> engineering	<input type="checkbox"/> invention	<input type="checkbox"/> politics/government
<input type="checkbox"/> 1900-1999	<input type="checkbox"/> art	<input type="checkbox"/> entertainment/ recreation	<input type="checkbox"/> landscape architecture	<input type="checkbox"/> religion
<input type="checkbox"/> 2000-	<input type="checkbox"/> commerce	<input type="checkbox"/> ethnic heritage	<input type="checkbox"/> law	<input type="checkbox"/> science
	<input type="checkbox"/> communications	<input type="checkbox"/> exploration/ settlement	<input type="checkbox"/> literature	<input type="checkbox"/> social history
	<input type="checkbox"/> community planning		<input type="checkbox"/> maritime industry	<input type="checkbox"/> transportation
	<input type="checkbox"/> conservation		<input type="checkbox"/> military	<input type="checkbox"/> other:

Specific dates ca. 1850 **Architect/Builder** unknown

Construction dates ca. 1850

Evaluation for:

National Register Maryland Register not evaluated

Prepare a one-paragraph summary statement of significance addressing applicable criteria, followed by a narrative discussion of the history of the resource and its context. (For compliance reports, complete evaluation on a DOE Form - see manual.)

The Tutbury Gardeners Cottage is significant under criteria C in the area of architecture. The property derives its primary significance from its original association with the Tutbury estate but is also significant in its own right as an example of Gothic cottage architecture that has grown and evolved to meet the needs of each different owner. The property is also a contributing property in the Lawyers Hill National Register District which is significant not only for its architecture but also for its large lots and natural landscape.

The Gardeners Cottage was probably built at the same time as or shortly after the construction of the Tutbury mansion and was clearly built as a service building in the farm complex. Tutbury mansion has not been resurveyed but the 1970's inventory form dates the house to the late 1840's based primarily on deed evidence (1). The Gothic style of both the main house and the Gardeners Cottage were the height of popularity among the elite at that time. The Tutbury estate was probably constructed by either James Rowles who owned the 141 acres on which it sat from 1846 to 1850, or Charles White who purchased 123 acres from Rowles in 1850 and owned the property until 1855 when he sold three parcels to William Jackson for \$12000 (2). The Gardeners Cottage seems to have been a dependency for the mansion house until well into the mid-20th century. It was split off briefly in the early 1940's when George Forbes, the owner of the entire Tutbury estate at that point, died and left most of the estate to his wife but left 4.3 acres including several buildings to his brother for his residence (3). It seems very likely that the buildings included were the Gardeners Cottage, garage, and barn now standing. Harris Lightfoot Forbes soon sold the property to the Culbertsons who had purchased the rest of the Tutbury estate from Garetta Forbes (4). In 1966, the Culbertsons sold 16.7 acres, including the Gardeners Cottage and outbuildings to the Rettgers and from then on the two properties were distinct parcels (5). The additions to the Gardeners Cottage were made over time as the cottage gradually became a more substantial, permanent residence. The first addition and porch enclosure probably occurred around 1870, the second addition around 1930, the kitchen addition around 1950 and the laundry room addition within the last 30 years.

The Tutbury estate shows up on both the 1860 Martenet map of Howard County and the 1878 map of Howard County as the property of William Jackson. A lane used to run east from the Gardeners Cottage and barn to the main house. Unfortunately, Tutbury mansion now sits on only 3.7 acres and the land in between the mansion and the cottage has been subdivided and developed with modern houses. Even as late as 1957, however, when the most recent USGS Topographic Map was made, the lane connecting the Gardeners Cottage and outbuilding complex to the mansion house was visible.

Very few outbuildings associated with the Lawyers Hill properties remain, due in large part to the construction of I-95 through the middle of the neighborhood, and even in its altered state, the Tutbury Gardeners Cottage is significant as one of the last remaining original outbuildings still in its original location. Unfortunately, a planned housing development will soon replace the cottage and its surrounding landscape and damage the integrity of the Lawyers Hill National Register District.

Maryland Historical Trust
Maryland Inventory of
Historic Properties Form

Inventory No HO-797

Name Tutbury Gardeners Cottage

Continuation Sheet

Number 8 Page 1

-
- (1) Howard County Land Records Liber 8, Folio 143 and Liber 10, Folio 161.
 - (2) Ibid., and Liber 16, Folio 322.
 - (3) Will of George Forbes, Wills Liber 9, Folio 10.
 - (4) Howard County Land Records Liber 182, Folio 443 and Liber 185, Folio 280.
 - (5) Howard County Land Records Liber 461, Folio 282.

9. Major Bibliographical References

Inventory No. HO-797

See continuation sheet.

10. Geographical Data

Acreage of surveyed property 16.7

Acreage of historical setting approx. 50

Quadrangle name Relay

Quadrangle scale 1:24000

Verbal boundary description and justification

Cottage is now a separate parcel from the mansion house and the land in between the two has been subdivided. Cottage is on Tax Map 32, Parcel 8.

11. Form Prepared By

name/title Kristin H. Hill, Historic Sites Surveyor

organization Howard County Department of Planning and Zoning

date 9/16/03

street and number 3430 Courthouse Drive

telephone 410-313-4335

city or town Ellicott City

state MD zip code 21043

The Maryland Inventory of Historic Properties was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to: Maryland Historical Trust
DHCD/DHCP
100 Community Place
Crownsville MD 21032
410-514-7600

Maryland Historical Trust
Maryland Inventory of
Historic Properties Form

Inventory No. HO-797

Name Tutbury Gardeners Cottage

Continuation Sheet





Number 9 Page 1

Hopkins, G.M. ATLAS OF FIFTEEN MILES AROUND BALTIMORE INCLUDING HOWARD COUNTY MARYLAND. Philadelphia, 1878.

Martenet, Simon. MARTENET'S MAP OF HOWARD COUNTY, MARYLAND. Baltimore, 1860.


Howard County Land Records, Howard County Courthouse, Ellicott City.

Maryland Inventory of Historic Properties Form, HO-452, Tutbury. On file at the Howard County Department of Planning and Zoning.

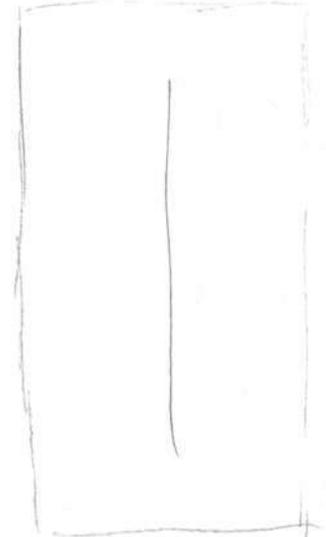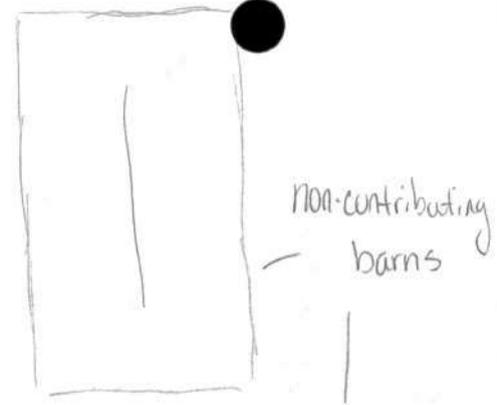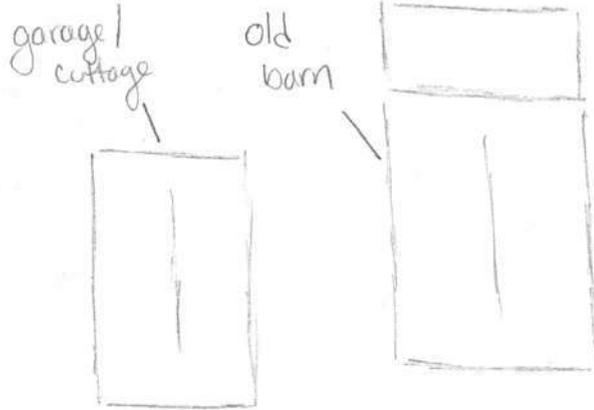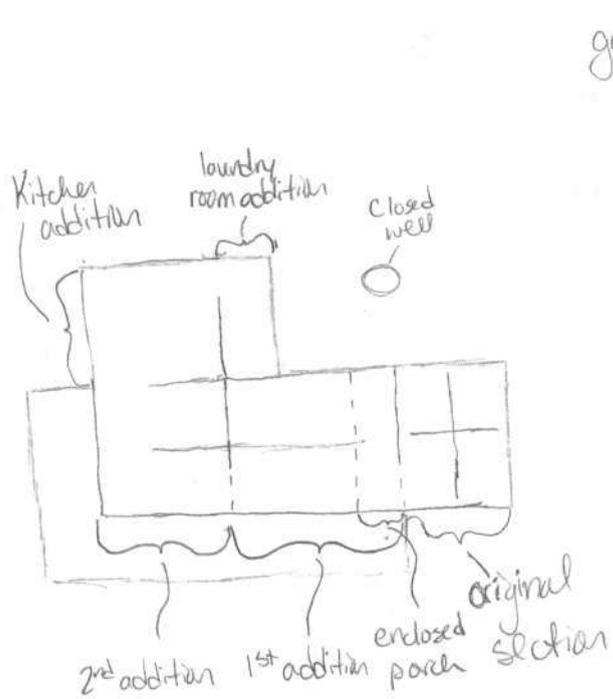

Resource Sketch Map
HO-797, Tutbury Gardeners Cottage
6450 Elibank Drive
Elkridge, Howard County
NOT DRAWN TO SCALE

1878 Hopkins Map of Howard County
 First District
 Showing HO-797, Tutbury Gardeners Cottage
 Elkridge, Howard County

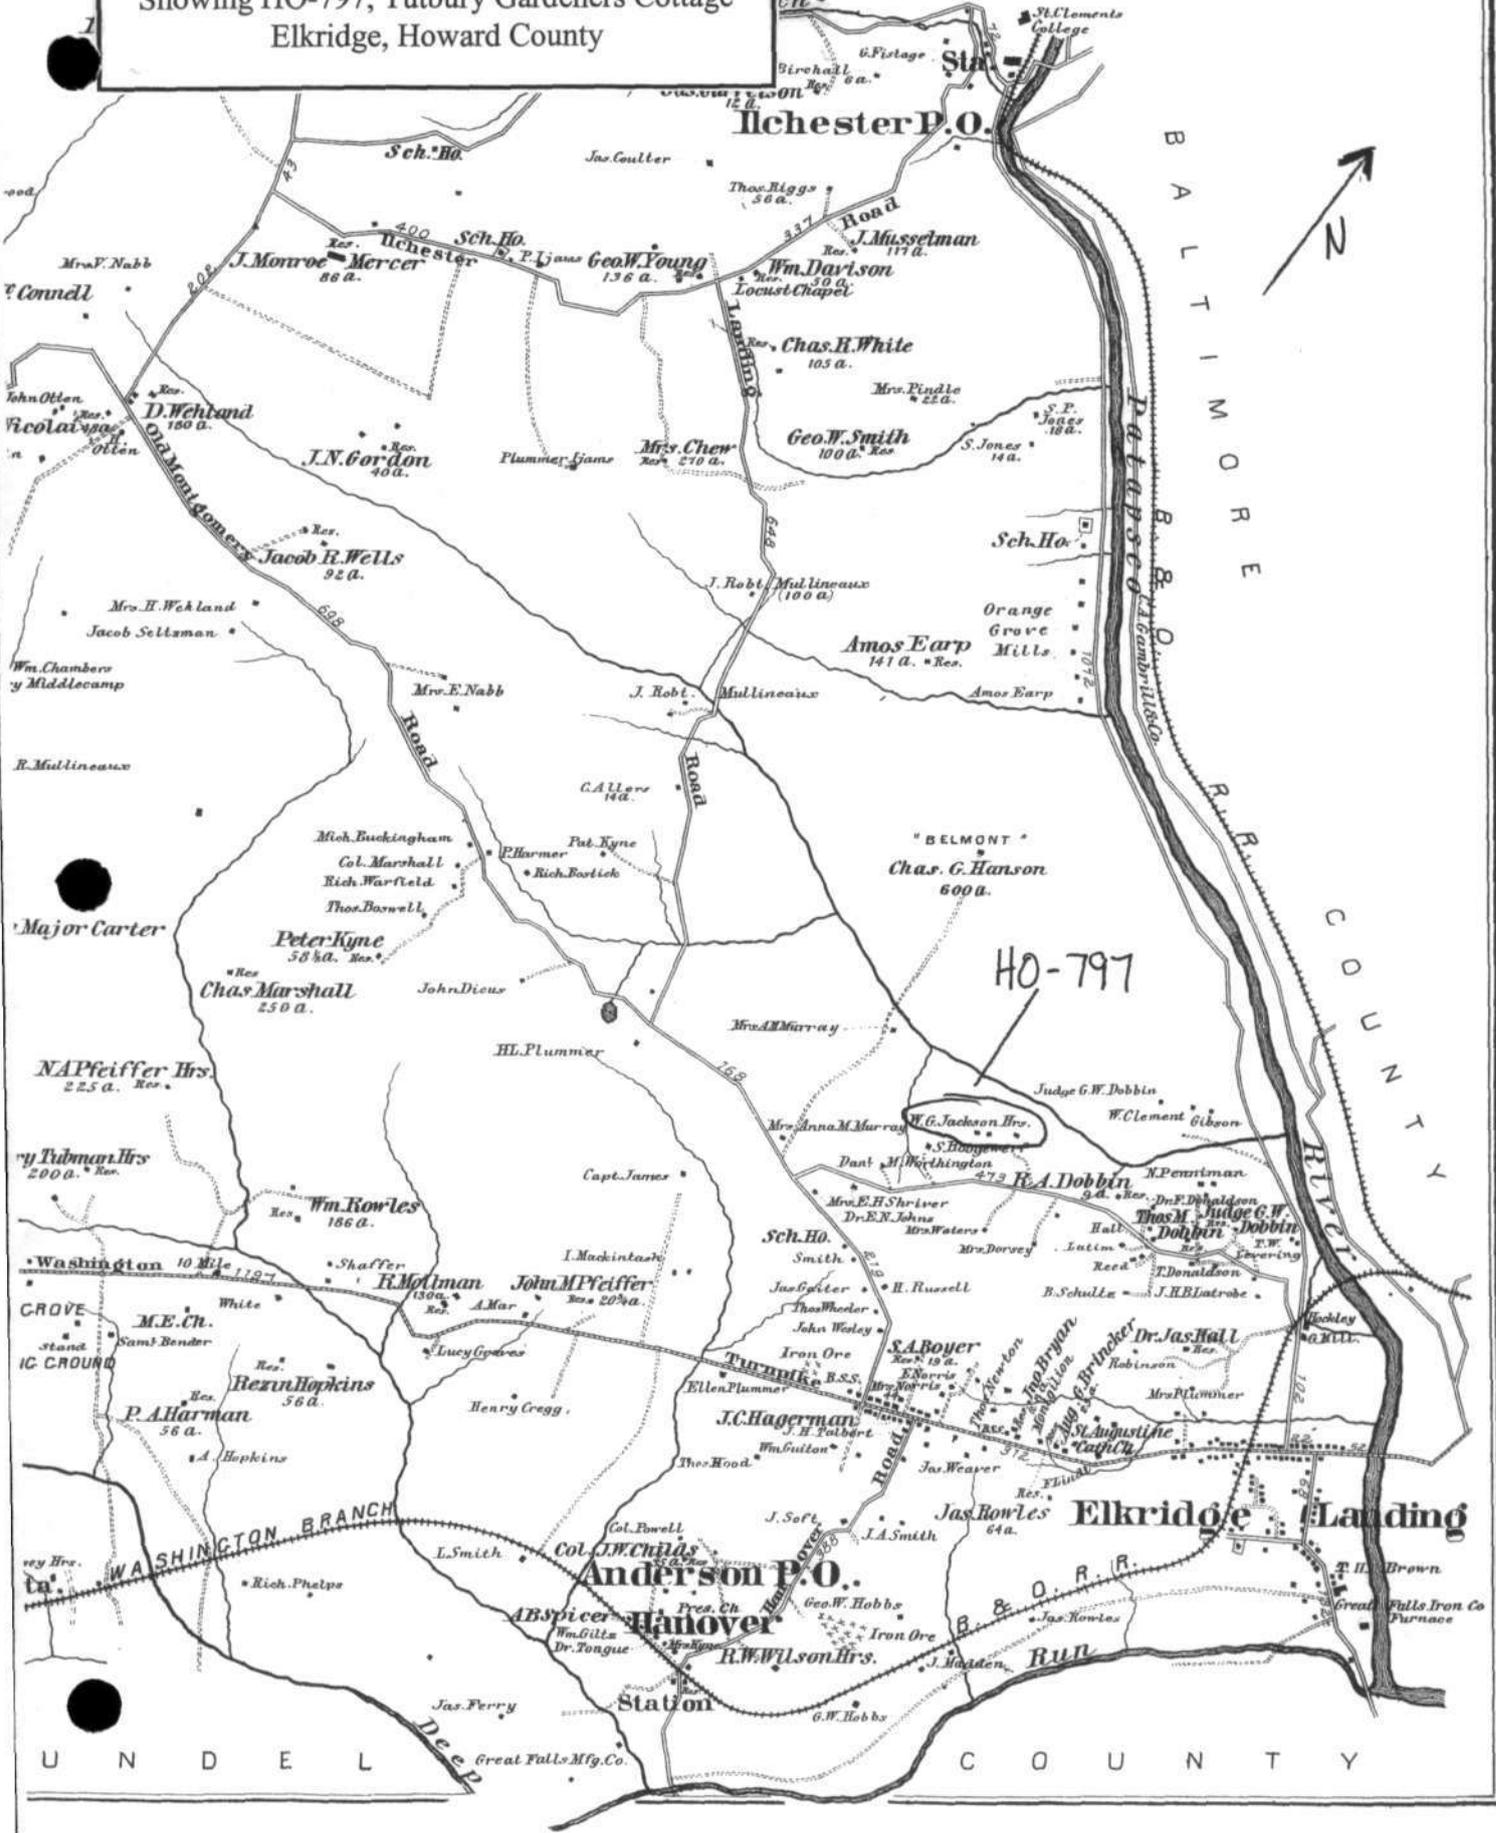

Elkridge P.O.

BALTIMORE
 R.R.
 CO. A. GAMBRIELSON
 BALTIMORE
 R.R.
 CO. A. GAMBRIELSON
 BALTIMORE
 R.R.
 CO. A. GAMBRIELSON


HO-797

Anderson P.O.

Elkridge Landing

UNDELL

COUNTY

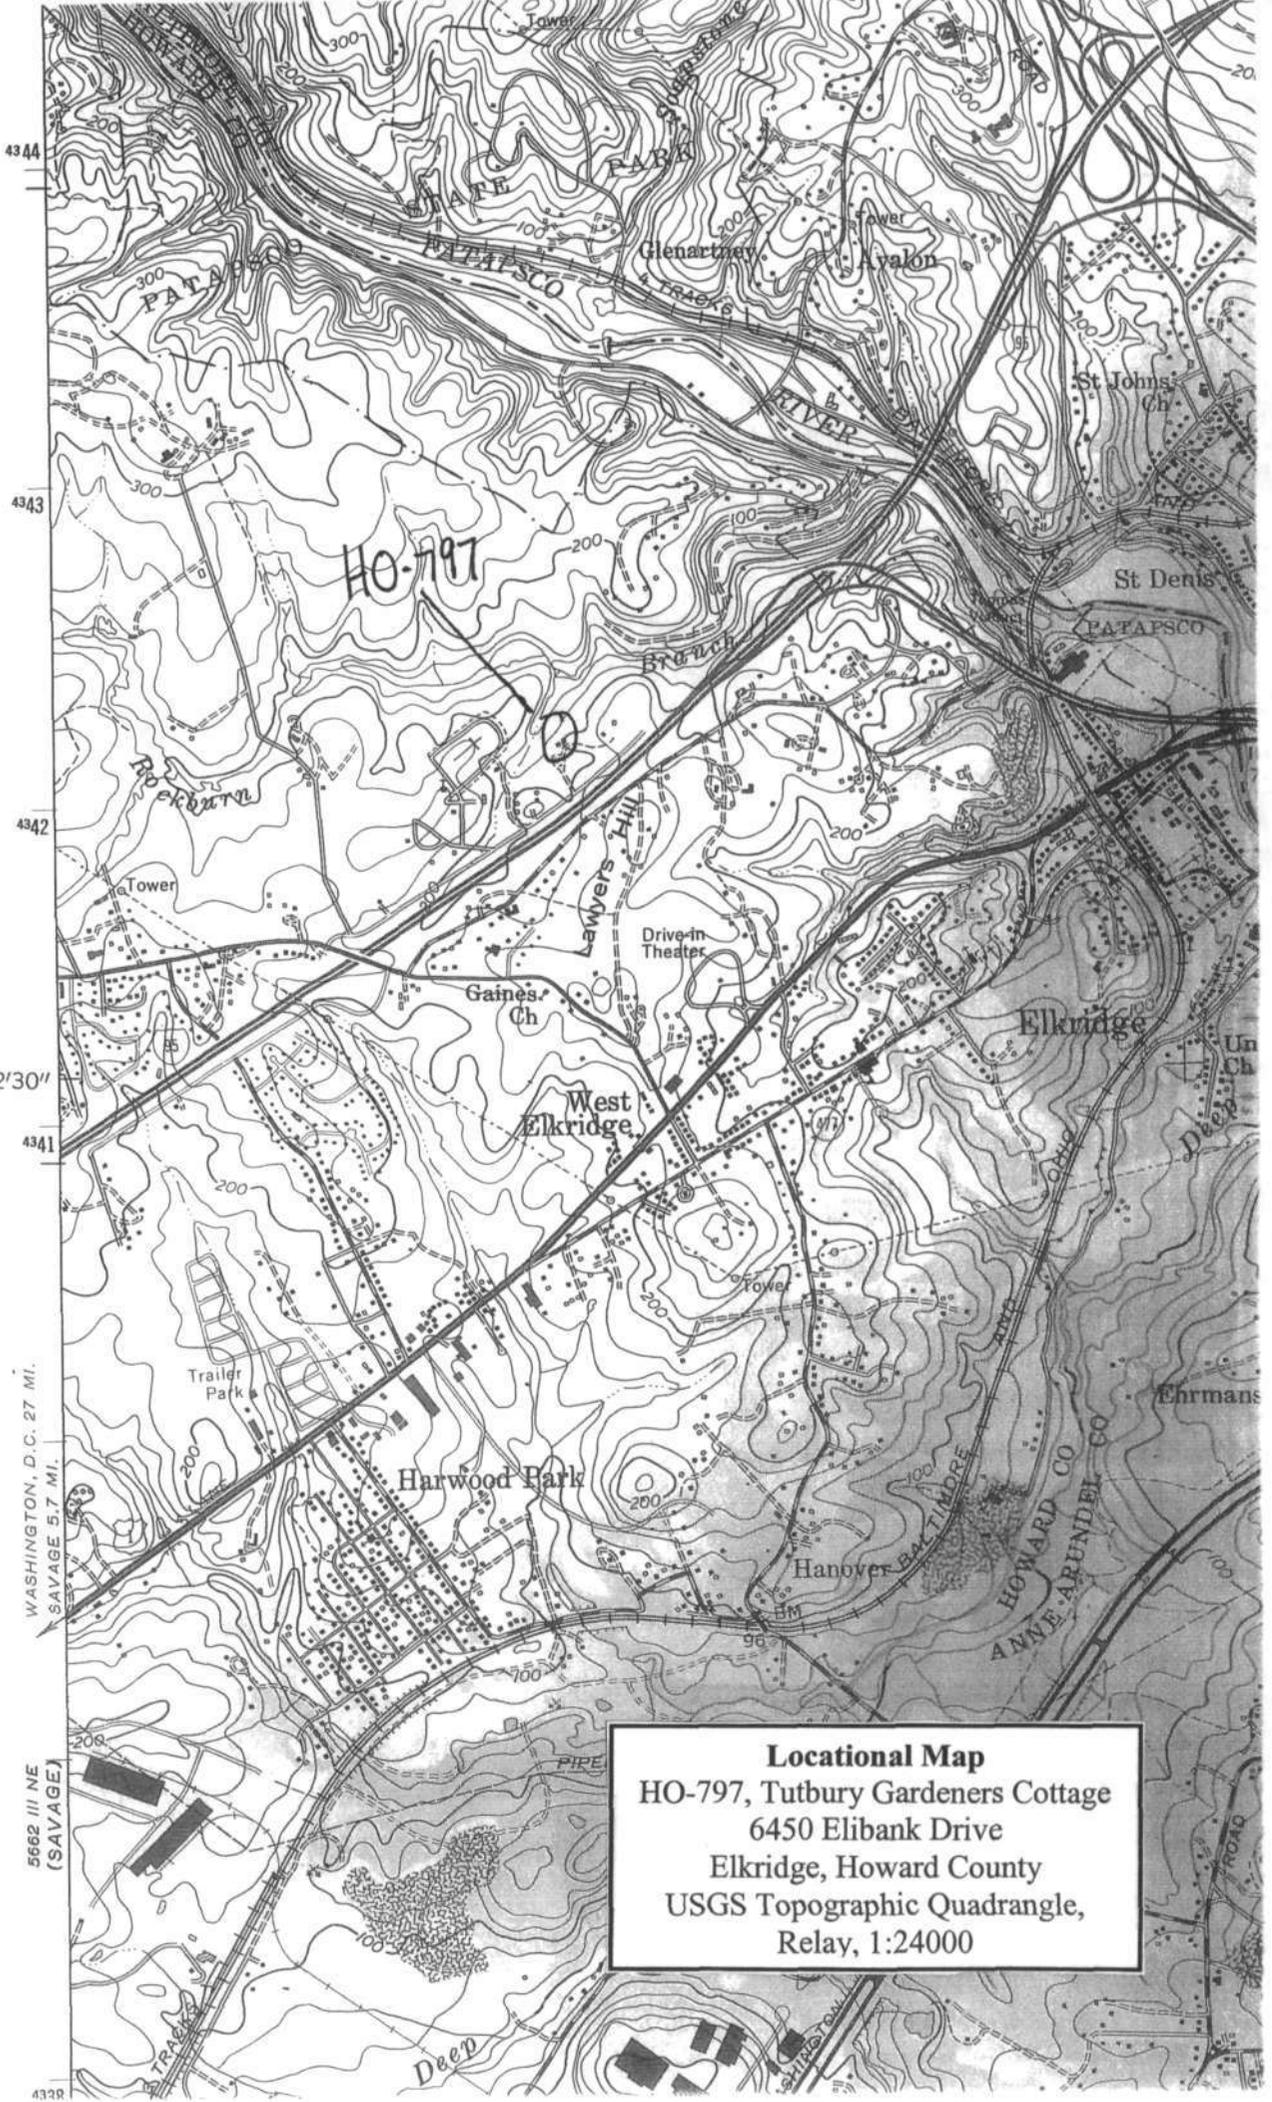

4344
4343
4342
12°30'
4341
WASHINGTON, D.C. 27 MI.
SAVAGE 5.7 MI.
5662 III NE (SAVAGE)
4338

Locational Map
HO-797, Tutbury Gardeners Cottage
6450 Elibank Drive
Elkridge, Howard County
USGS Topographic Quadrangle,
Relay, 1:24000



HO-797, Tutbury Gardeners Cottage
6450 Elibank Dr., Elkridge

Howard County, MD

16 21+02 NNNNN 431

Kristin Hill, 8/03

Negative at MDSHPD

South elevation, Period 1 cross gabled cottage on right

1/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

Knott Hill, 8/03

05 21+00 NNNNN 431

Negative at MDSTPO

Original section, east elevation

2/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

15 21+01 NNNNN 431

Kristin Hill, 8/03

Negative at MDSHPD

SE elevation, original section

3/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr, Elkridge

Howard County, MD

11 21+01 NNNNN 431

Kristin Hill, 8/03

Negative at MDSHPD

Period 1 (night) and Period 2, south elevation

4/26



HO-797, Tutbury Gardens Cottage
6450 Elibank Dr, Elkridge

Howard County, MD

14 21+01 NNNNN 431

Kristin Hill, 8/03

Negative at MDSHPD

Period 2 addition, south elevation

5/26



Tutbury
HO-797, Gardeners Cottage
6400 Elitbank Dr, Elkridge

Howard County MD

Kristin Hill, 8/03

13 21+01 NNNNN 431

Negative at MDSHPD

Period 2 addition, South elevation

6/26



HO-797, Tutbury Gardeners cottage

6450 Elibank Dr., Elkridge

Howard County, MD

12 21+01 NNNNN 431

Rnsth Hill, 8/03

Negative at MDSHPO

Period 2 and 3 additions, S elevation

7/26



HO-797, Tutbury Gardeners cottage

6450 Elibank Dr., Elkridge

Howard County, MD

09 21+01 NNNNN 431

Kristin Hill, 8/03

Negative at MASHPO

West elevation, Period 3 + 4 additions

8/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank, Elkridge

Howard County, MD

00 21+00 NNNNN 431

Kristin Hill, 8/03

Negative at MDSTPC

North (rear) elevation

9/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

Kristin Hill, 8/03

06 21+01 NNNNN 431

Negative at MDSHPD

North (rear) elevation

10/26



HO-797, Tatbun Gardeners Cottage
6450 Elibank Dr., Elkridge
Howard County, MD

Kristin Hill, 8/03

01 21-01 NNNNN 431

Negative at MDSHP0

Front door, Period 2

11/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

Kristin Hill, 8/03

24 21+00 NNNNN 431

Negative at MDSH20

1st floor, Period 1 room, East wall w/ casement windows, FP
originally located between windows

12/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

20 21+00 NNNNN 431

Kristin Hill, 8/03

Negative at MDSTPO

Period 1, 2nd floor room

13/26



HO. 797, Tatbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

Knzstin Hill, 8/03

19 21+01 NNNNN 431

Negative at MDSPRO

2nd floor, Period 1 room

14/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County. MD

Kristin Hill, 8/03

18 21+00 NNNNN 431

Negative at MDSTPO

Period 2 stair, looking down from 2nd floor

15/26



HO-797, Tutbury Gardeners Cottage
6450 Elibank Dr., Elkridge

Howard County, MD 27 21-01 NNNNN 431

Kristin Hill, 8/03

Negative at MDS480

Stair to 2nd floor, Period 2, bookcase concealing stair
to basement is on right in photo

16/26



HO-797, Tutbury Gardeners Cottage
6450 Elibank Dr., Elkridge

Howard County, MD

23 21-01 NNNNN 431

Kristin Hill, 8/03

Negative at MD5HPO

Penal 2 stair

17/26



H0-797, Tutbury Gardeners Cottage

6450 Ellbank Dr. Elkridge

Howard County, MD

25 21+00 NNNNN 431

Kristin Hill, 8/03

Negative at MDSHPO

Period 2 stair and bookcase concealing basement stair

18/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr, Elkridge

Howard County, MD

26 21+00 NNNNN 431

Knzth Hill, 8/03

Negative at MOSAPO

Newel post, Period 2 stair

19/26



HO-797, Tutbury Gardeners Cottage
6450 Elibank Dr., Elkridge

Howard County MD

21 21+00 NNNNN 431

Kristin Hill, 8/03

Negative at MDSHO?

1st floor, Period 2 room, redone FP

20/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

17 21-01 NNNNN 431

Kn3th Hill, 8/03

Negative at MDSHPD

Period 2 interior trim

21/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

Howard County, MD

10 21+82 NNNNN 431

Kristin Hill, 8/03

Negative at MDSDPO

rooflines, S elevation, Period 1 cottage in foreground, then
garage/cottage, then barn

22/26



1A0-797, Tutbury Gardeners Cottage

6450 Elibank Dr, Elkridge

Howard County, MD 07 21+00 NNNNN 431

Kinzin Hill, 8/03

Negative at MDS/HPD

garage/cottage, west elevation

23/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., ElKridge

Howard County, MD

03 21+00 NNNNN 431

Kristin Hill, 8/03

Negative at MDSHPD

Barn, garage/cottage, original cottage, east elevation

24/26



HO-797, Tutbury Gardeners Cottage

6450 Elibank Dr., Elkridge

02 1700 NNNNN 431

Howard County, MD

Kristin Hill, 8/03

Negative at MDSHPO

barn, SE elevation

25/26



HO-797, Tutbury Gardeners Cottage

6400 Elibank Dr., Elkridge

Howard County, MD

Kristin Hill, 8/03

Negative at MDSHPD

barn, south elevation

26/26

04 21+00 NNNNN 431