

CAPSULE SUMMARY SHEET

Survey No.: M: 28-51 Construction Date: circa 1885, 1941-1947

Name: Round Oak Missionary Baptist Church

Location: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

Private/Religious/Occupied/Good/Restricted

Description:

The Round Oak Missionary Baptist Church, constructed from 1941 to 1947 with a cemetery dating from circa 1885, is a 1-story, 3-bay vernacular front-gable church on the west side of Good Hope Road in the Cloverly area of Silver Spring, Montgomery County. The building has been altered by a 1-story addition to the north. The structure has a projecting gable entry and an asphalt shingle, front-gable roof with an interior concrete block chimney. The church is of concrete block construction with a stucco finish, and the foundation is also concrete block. There are a series of concrete block buttresses on each elevation of the original structure. The church has several different window types, including leaded stained glass. The cemetery, which is located northeast of the church, is laid out in a grid pattern with the stones facing east. The earliest stone located dates from 1888. Many of the stones, especially the stones from circa 1920 to circa 1945, have simple, hand carved inscriptions.

Significance:

The Round Oak Missionary Baptist Church is significant for its association with the African-American community of Good Hope during the late nineteenth and twentieth centuries. The property has been associated with an African-American congregation since 1868 and represents the continuation of an important social and cultural part of the African-American community. The cemetery, which dates from circa 1885, is significant for its folk-art stone carving and retains its integrity of design representative of a vernacular church cemetery. The 1861 Martenet Map of Montgomery County does not show any buildings in the vicinity of the present church, while the 1879 Hopkins Atlas of Montgomery County shows a Baptist Church at the location. The cornerstone of the church indicates construction began in 1941. A date plaque on the 1982 church indicates the congregation was organized in 1868; however, according to the associate pastor of the church, the current church property was purchased in 1872. The church building was completed in 1947.

Preparer:

P.A.C. Spero & Company
August 1997

Maryland Historical Trust
Maryland Inventory of Historic Properties Form
Intercounty Connector Project

Survey No.: M: 28-51
DOE ___yes ___no

Name: (indicate preferred name)

historic Round Oak Missionary Baptist Church

and/or common

2. Location:

street & number 15812 Good Hope Road ___ not for publication

city, town Silver Spring vicinity of congressional district

state Maryland county Montgomery

3. Classification:

Category	Ownership	Status	Present Use
<input type="checkbox"/> district	<input type="checkbox"/> public	<input checked="" type="checkbox"/> occupied	<input type="checkbox"/> agriculture <input type="checkbox"/> museum
<input checked="" type="checkbox"/> building(s)	<input checked="" type="checkbox"/> private	<input type="checkbox"/> unoccupied	<input type="checkbox"/> commercial <input type="checkbox"/> park
<input type="checkbox"/> structure	<input type="checkbox"/> both	<input type="checkbox"/> work in progress	<input type="checkbox"/> education <input type="checkbox"/> private
<input checked="" type="checkbox"/> site	Public Acquisition	Accessible	<input type="checkbox"/> entertainment <input type="checkbox"/> residence
<input type="checkbox"/> object	<input type="checkbox"/> in process	<input checked="" type="checkbox"/> yes: restricted	<input type="checkbox"/> government <input checked="" type="checkbox"/> religious
	<input type="checkbox"/> being considered	<input type="checkbox"/> yes: unrestricted	<input type="checkbox"/> industrial <input type="checkbox"/> scientific
	<input checked="" type="checkbox"/> not applicable	<input type="checkbox"/> no	<input type="checkbox"/> military <input type="checkbox"/> other:
			<input type="checkbox"/> transportation

4. Owner of Property: (give names and mailing addresses of all owners)

name Round Oak Missionary Baptist Church

street & number 15812 Good Hope Road telephone no.: (301) 384-3199

city, town Silver Spring state and zip code Maryland 20905

5. Location of Legal Description

Land Records Office of Montgomery County liber

street & number Montgomery County Judicial Center folio

city, town Rockville state MD

6. Representation in Existing Historical Surveys

title

date ___ federal ___ state ___ county ___ local

depository/survey records

y, town state

7. Description

Survey No.: M: 28-51

Condition		Check one	Check one	
<input checked="" type="checkbox"/> excellent	<input type="checkbox"/> deteriorated	<input type="checkbox"/> unaltered	<input checked="" type="checkbox"/> original site	
<input type="checkbox"/> good	<input type="checkbox"/> ruins	<input checked="" type="checkbox"/> altered	<input type="checkbox"/> moved	date of move _____
<input type="checkbox"/> fair	<input type="checkbox"/> unexposed			

Resource Count: 5

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

The Round Oak Missionary Baptist Church, constructed from 1941 to 1947 with a cemetery dating from circa 1885, is a 1-story, 3-bay vernacular front-gable church on the west side of Good Hope Road in the Cloverly area of Silver Spring, Montgomery County. The building has been altered by a 1-story addition to the north. The alteration concealed the location of the cornerstone, which was removed and placed on grade at the southeast corner of the building.

The structure has an asphalt shingle, front-gable roof with an interior concrete block chimney. The church is of concrete block construction with a stucco finish, and the foundation is also concrete block. There are a series of concrete block buttresses on each elevation of the original structure. The church has several different window types, including 8/8, 6/6, and 4/4 double-hung wood, leaded stained glass, and vinyl sliding replacement windows.

The east, or front elevation has a projecting gable entry with a wood double door with raised panels, accessed from grade by concrete steps. The first bay has a round arch, leaded stained glass window between two buttresses. Most of the third bay has been concealed by the north addition.

The south elevation has five buttresses that extend to the roof overhang. Between the buttresses are three round arch, leaded stained glass windows and one wood door. The door, which has decorative raised panels and concrete steps to grade, has a round arch leaded stained glass transom.

The west, or rear elevation has four buttresses and a paired, round arch, leaded stained glass double-hung wood window. The window is located in the center of the elevation. The first bay has a wood door with a round arch leaded stained glass transom. The door is accessed by concrete steps. The third bay has air handling unit ductwork secured to the exterior wall.

The north elevation is concealed by the 1-story, flat-roof addition. The addition was built in two sections. The east section, constructed in 1953, is a stucco covered concrete block entry hall with a wood door and five 4/4 double-hung wood windows. The west section, constructed in 1973 and enlarged in 1977, has vinyl siding, a wood door, and seven vinyl sliding windows.

The interior of the original part of the church has not been altered and contains the original sanctuary.

There are a cemetery and three buildings associated with this property. The cemetery, which is located northeast of the church, is laid out in a grid pattern with the stones facing east. The earliest stone located dates from 1888. Many of the stones, especially the stones from circa 1920 to circa 1945, have simple, hand carved inscriptions. The remaining stones are standard engraved types. Several of the stones have been broken and the inscriptions have been worn or damaged. Evidence indicates that the cemetery was still in use in the 1950s.

The first building associated with this property is a residence. Constructed circa 1945, the residence is a small, 1½-story, side-gable concrete block cottage. The structure is in deteriorated condition and many of the windows have been removed. It has an asphalt shingle roof with a large, plywood sheathed shed-roof dormer on the east side.

CONTINUATION SHEET

MARYLAND HISTORICAL TRUST

STATE HISTORIC SITES INVENTORY FORM

RESOURCE NAME: Round Oak Missionary Baptist Church

INVENTORY NO.: M: 28-51

ADDRESS: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

7. Description (Continued)

The second building is a small 1-story, concrete block shed with an standing seam metal, side-gable roof. The shed, constructed circa 1945, is in deteriorated condition; the door has been removed and there are three large openings on the west elevation. The shed is located west of the church and northeast of the residence. The first and second buildings were acquired by the church in 1987.

The third building is a large 1½-story church sanctuary and offices, constructed in 1982. The church is of concrete block construction with brick veneer. The east, or front elevation has a front-gable brick veneer facade with glass doors and a section of enamel panels in the gable end. The church is located a short distance west of the historic church.

The property is located on the west side of Good Hope Road, with residential property to the north, south, and west. A playground and several trees are located east of the church, and rows of trees are located at the north and west property boundaries. The property's setting is a residential area.

8. Significance

Survey No.: M: 28-51

Period	Areas of Significance—Check and justify below			
<input checked="" type="checkbox"/> Prehistoric	<input type="checkbox"/> archaeology-prehistoric	<input type="checkbox"/> Community planning	<input type="checkbox"/> landscape architecture	<input type="checkbox"/> religion
<input type="checkbox"/> 400-1499	<input type="checkbox"/> archeology-historic	<input type="checkbox"/> conservation	<input type="checkbox"/> law	<input type="checkbox"/> science
<input type="checkbox"/> 1500-1599	<input type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> literature	<input type="checkbox"/> sculpture
<input type="checkbox"/> 1600-1699	<input type="checkbox"/> architecture	<input type="checkbox"/> education	<input type="checkbox"/> military	<input checked="" type="checkbox"/> social/
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> art	<input type="checkbox"/> engineering	<input type="checkbox"/> music	humanitarian
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> commerce	<input type="checkbox"/> exploration/settlement	<input type="checkbox"/> philosophy	<input type="checkbox"/> theater
<input type="checkbox"/> 1900-	<input type="checkbox"/> communication	<input type="checkbox"/> industry	<input type="checkbox"/> politics/government	<input type="checkbox"/> transportation
		<input type="checkbox"/> invention		<input type="checkbox"/> other:

Specific dates 1868, 1941-1947

Builder/Architect

check: Applicable Criteria: A B C D
 and/or
 Applicable Exceptions: A B C D E F G
 Level of Significance: national state local

Prepare both a summary paragraph of significance and a general statement of history and support.

The Round Oak Missionary Baptist Church is significant for its association with the African-American community of Good Hope during the late nineteenth and twentieth centuries. The property has been associated with an African-American congregation since 1872 and represents the continuation of an important social and cultural part of the African-American community. The cemetery, which dates from circa 1885, is significant for its folk-art stone carving and retains integrity of design representative of a vernacular church cemetery. The 1861 Martenet Map of Montgomery County does not show any buildings in the vicinity of the present church, while the 1879 Hopkins Atlas of Montgomery County shows a Baptist Church at the location. A cornerstone on the site indicates construction began on the extant church in 1941. A date plaque on the 1982 church indicates that the congregation was organized in 1868; however, according to the associate pastor of the church, the current church property was purchased in 1872. The church building was completed in 1947.

The Round Oak Missionary Baptist Church is located in the area known as Cloverly. Cloverly is the name given to a region in Eastern Montgomery County which extends for several miles around the town of Spencerville. On present maps, Cloverly is often linked to the intersection of New Hampshire Avenue and Briggs Chaney Road. In the nineteenth century this area consisted of agricultural and open land and small villages. Farmsteads produced tobacco in the early nineteenth century, followed by wheat and dairy production in the mid to late nineteenth century. The development of the region was aided by a network of major travel routes, including the Ashton-Colesville Turnpike (New Hampshire Avenue), Old Baltimore Road (Layhill/Ednor Road) and the Laurel Road (Spencerville Road). The town of Spencerville developed in the late nineteenth century and prospered into the twentieth century as the commercial center of the Cloverly area. The region had a large number of Quaker and Methodist settlers, and several nineteenth century African American settlements.

During the twentieth century, the economy of Montgomery County shifted away from agrarian to service, government, insurance and banking industries to support the growing Washington D.C metropolitan area. The effect of this change spread north into the Cloverly area. Many of the historic farmsteads were developed into suburban neighborhoods, small villages were infilled with construction and farmhouses were "updated" with additions, stylistic alterations and infrastructure improvements. Today, few farmhouses, and even fewer farmsteads, exist in the Cloverly area, as suburban development continues (M-NCPPC 1995, 34-37).

The Round Oak Missionary Baptist Church consists of a vernacular church and a cemetery. Religious architecture in the project area frequently melded vernacular residential building

CONTINUATION SHEET

MARYLAND HISTORICAL TRUST

STATE HISTORIC SITES INVENTORY FORM

RESOURCE NAME: Round Oak Missionary Baptist Church

REVIEW NO.: M: 28-51

ADDRESS: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

8. Significance (Continued)

types with religious architectural elements such as bell towers and front-gable orientation. The degree of architectural pretention exhibited by the churches of the area depended upon congregation size, wealth, and denomination. The design of churches reflected both functional and symbolic concerns. Churches (as opposed to meeting houses) in the area, as well as the nation, almost invariably featured front-gables. The front-gable orientation was the logical exterior architectural accommodation of the lengthened nave so frequently utilized by denominations tracing their lineage ultimately to the Roman Catholic Church, rather than the Eastern Orthodox Church. A bell tower not only called parishioners to worship, but also provided a visual symbol of the building's spiritual, rather than secular, function. Fenestration also frequently symbolized the building's function; rounded, Gothic arches, and pointed shapes helped distinguish the church from its secular neighbors. However, vernacular churches occasionally omitted these distinguishing shapes in the interest of economy.

Cemeteries provide information about the religious affiliation, ethnicity, and level of affluence of the people who settled a region. The earliest burial places found in any given area are the isolated, crudely marked graves found along country roads or even in the middle of a forest. Such graves were usually for male family members sent ahead to a frontier area to clear land for the family which would follow. The first grave sites that could be referred to as a cemetery are family burial grounds. If churches were not yet present in an area, a family would choose a burial place in a corner of their farmstead. Today, in many cases, these farms no longer exist, but the cemeteries survive on land which is used for other purposes.

Once a region was settled sufficiently, church cemeteries appeared. A typical church cemetery had a church located at one corner, graves laid in a grid pattern, and a building used for tools and storage. It was typical for graveyards to be built on hilltops because such sites were thought to be closer to heaven. In addition, from a practical standpoint, a family generally preferred to use a hilltop as a graveyard because it was the least viable land for farming. In the majority of graveyards, the deceased were buried with their feet oriented towards the east. Again, from a practical point of view, the forces of weather are least severe from the east, thereby making an easterly orientation a good choice in order to preserve tombstones for as long as possible (Meyer 1989, 237-251).

CONTINUATION SHEET

MARYLAND HISTORICAL TRUST

STATE HISTORIC SITES INVENTORY FORM

RESOURCE NAME: Round Oak Missionary Baptist Church

RVEY NO.: M: 28-51

ADDRESS: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

8. Significance (Continued)

NATIONAL REGISTER EVALUATION:

The Round Oak Missionary Baptist Church, constructed from 1941 to 1947, with a cemetery dating from circa 1885, is eligible for the National Register of Historic Places. The property is eligible under Criterion A for its association with the African-American community of Good Hope, which flourished during the late nineteenth and early twentieth centuries. The property has been associated with an African-American congregation since 1872 and represents the continuation of an important social and cultural part of the African-American community. As a result, this property meets Criterion Consideration A, as a religious property deriving primary significance from its historical importance. The period of significance for the property extends from 1868 to 1947.

Historic research indicates that the property has no association with persons who have made specific contributions to history, and therefore, it does not meet Criterion B. The property is not eligible under Criterion C, as the church building has been altered through the construction of an addition on the north elevation which has severely compromised the architectural integrity of the structure. Finally, the property has no known potential to yield important information, and therefore, does not meet Criterion D.

MARYLAND HISTORICAL TRUST

Eligibility Recommended _____

Eligibility Not Recommended XX

Comments: _____

Documentation is insufficient to support significance under Criterion A.

Reviewer, OPS: *[Signature]*

Date: *10/2/1997*

Reviewer, NR Program: *[Signature]*

Date: *8/28/98*

[Handwritten initials]

9. Major Bibliographical References

Survey No.: M: 28-51

See Continuation Sheet

10. Geographical Data

Acreeage of nominated property 1.57 hectares (3.87 acres)

Quadrangle name Beltsville, MD

Quadrangle Scale 1:24,000

Verbal boundary description and justification

See Continuation Sheet

List all states and counties for properties overlapping state or county boundaries

state	code	county	code
-------	------	--------	------

state	code	county	code
-------	------	--------	------

11. Form Prepared By

e/title Caroline Hall/Ryan McKay

organization P.A.C. Spero & Company

date August 1997

street & number 40 W. Chesapeake Avenue, Suite 412

telephone (410) 296-1635

city or town Baltimore

state Maryland

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to: Maryland Historical Trust
DHCP/DHCD
100 Community Place
Crownsville, MD 21032-2023
(410) 514-7600

CONTINUATION SHEET

MARYLAND HISTORICAL TRUST

STATE HISTORIC SITES INVENTORY FORM

RESOURCE NAME: Round Oak Missionary Baptist Church

SURVEY NO.: M: 28-51

ADDRESS: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

9. Major Bibliographical References (Continued)

- Boyd, T.H.S. The History of Montgomery County, Maryland, From its Earliest Settlement in 1650 to 1879. Baltimore: Regional Publishing Company, 1968.
- Brugger, Robert A. Maryland, A Middle Temperament 1634-1980. Baltimore and London: Johns Hopkins University Press, 1988.
- Farquhar, Roger Brooke. Old Homes and History of Montgomery County, Maryland. Washington: Judd and Detweiller, Inc., 1962.
- Gottfried, Herbert and Jennings, Jan. American Vernacular Design, 1870-1940. Ames, Iowa: Iowa State University Press, 1988.
- Hopkins, G.M. Atlas of 15 Miles Around Washington including County of Montgomery, Maryland. Philadelphia: G.M. Hopkins, 1879; reprint, Rockville, Maryland: Montgomery County Historical Society, 1975.
- Israel, Rev. Archie S., Sr., Telephone conversation with author, 25 August 1997.
- Records of Montgomery County, Maryland.
- Martenet, Simon J. Martenet and Bond's Map of Montgomery County, Maryland. Baltimore, Maryland: Simon J. Martenet, 1865; reprint, Rockville, Maryland: Montgomery County Historical Society.
- Maryland-National Capital Park and Planning Commission. Historic Resources of the Eastern Montgomery County Master Plan Areas. Silver Spring, Maryland: M-NCPPC, 1995.
- Meyer, Richard E., ed. Voices of American Culture. Ann Arbor, Michigan: UMI Research Press, 1989.
- Taylor, Alda C. History of the Round Oak Baptist Church. Silver Spring, Maryland: Round Oak Missionary Baptist Church, 1990.

CONTINUATION SHEET

MARYLAND HISTORICAL TRUST

STATE HISTORIC SITES INVENTORY FORM

RESOURCE NAME: Round Oak Missionary Baptist Church

REVIEW NO.: M: 28-51

ADDRESS: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

10. Geographical Data (Continued)

Verbal Boundary Description and Justification:

The National Register boundary of the Round Oak Missionary Baptist Church follows the current property lines of 15812 Good Hope Road (Tax Map KS 122, Parcel 510). This 1.04 hectare (2.56 acre) property is bounded on three sides by adjacent tax parcels, and on the east by Good Hope Road. The boundary includes the church and cemetery, which contribute to the significance of the property. The modern church does not contribute to the significance of the property. The boundary excludes an adjacent parcel owned by the church (Tax Map KS 122, Parcel 507) containing the residence and shed, which do not contribute to the significance of the property. The adjacent parcel was purchased in 1987 and is not historically associated with the property.

CONTINUATION SHEET

MARYLAND HISTORICAL TRUST

STATE HISTORIC SITES INVENTORY FORM


RESOURCE NAME: Round Oak Missionary Baptist Church

INVENTORY NO.: M: 28-51

ADDRESS: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

10. Geographical Data (Continued)

National Register Boundary Map:

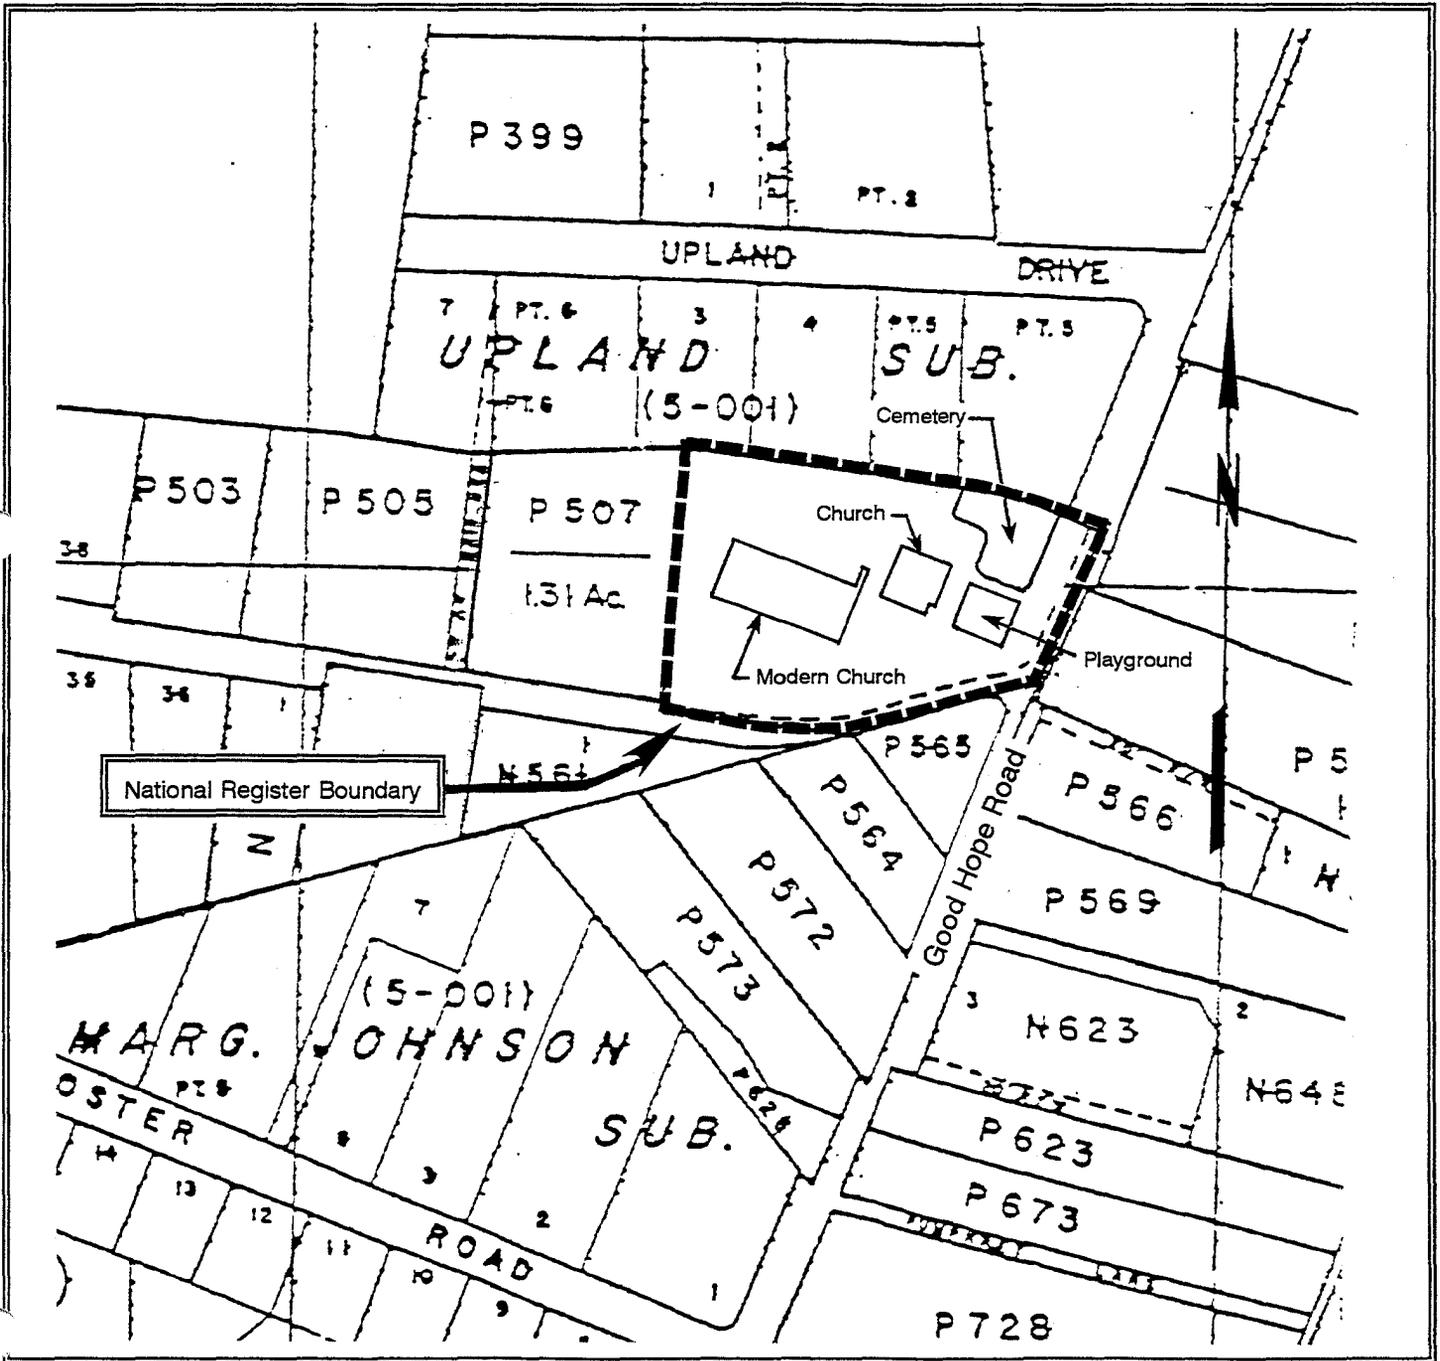

CONTINUATION SHEET

MARYLAND HISTORICAL TRUST

STATE HISTORIC SITES INVENTORY FORM

RESOURCE NAME: Round Oak Missionary Baptist Church

SURVEY NO.: M: 28-51

ADDRESS: 15812 Good Hope Road, Silver Spring vicinity (Cloverly), Montgomery County

Maryland Comprehensive Historic Preservation Plan Data Sheet

Historic Context:

MARYLAND COMPREHENSIVE PRESERVATION PLAN DATA

Geographic Organization:

Piedmont

Chronological/Developmental Period Theme (s):

Agricultural-Industrial Transition A.D. 1815-1870

Industrial/Urban Dominance A.D. 1870-1930

Modern Period A.D. 1930-Present

Prehistoric/Historic Period Theme(s):

Religion; Social/Educational; Cultural

RESOURCE TYPE:

Category (see Section 3 of survey form):

Building; Site

Historic Environment (urban, suburban, village, or rural):

Village

Historic Function(s) and Use(s):

Religious

Known Design Source (write none if unknown):


None

Preparer

P.A.C. Spero & Company

August 1997

57°30" 31
USGS Resource Locational Map
Beltsville, MD Quadrangle
Cloverly, Montgomery County
Round Oak Miss. Baptist Church
Survey #: M: 28-51

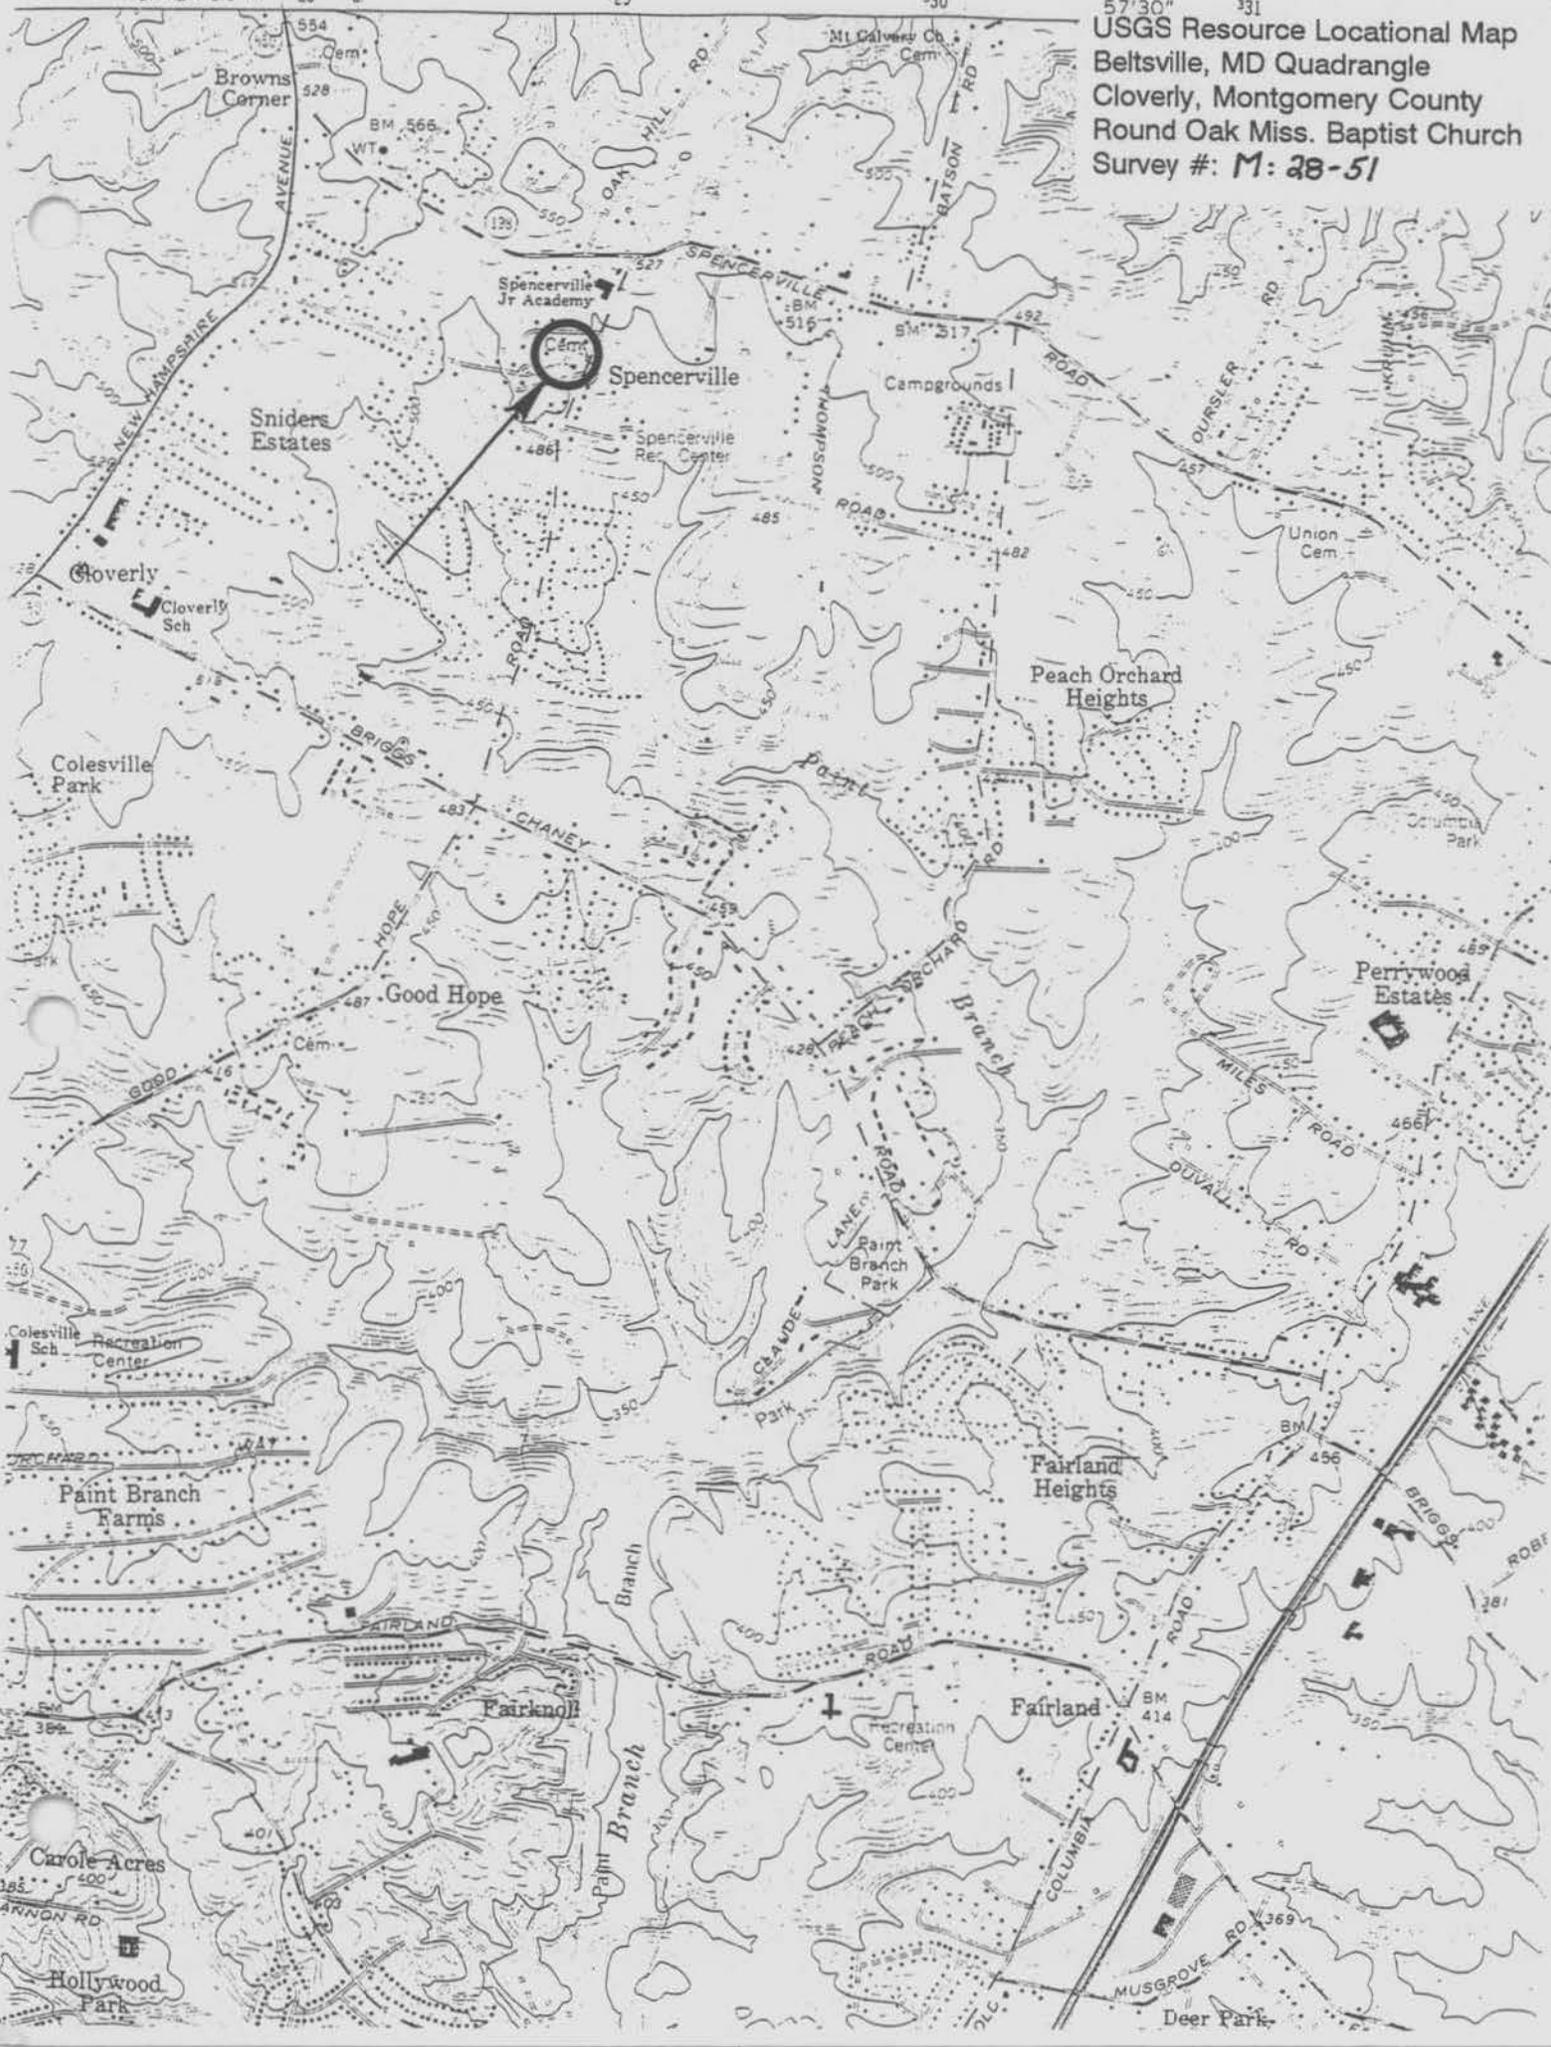



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Sporo & Co.
5. 8/97
6. MD SHPO
7. Church, south & east elevations
8. 1 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co, MD
4. PAC Spero & Co.
5. 8/97
6. MD SHPO
7. Church, north & east elevations
8. 2 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spaw & Co.
5. 8/97
6. MD SHPO
7. Church, south elevation
8. 3 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spaw & Co.
5. 8/97
6. MD SHPO
7. Church, west elevation
8. 4 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spero & Co.
5. 8/97
6. MD SHPO
7. residence, south & east elevations
8. 5 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co, MD
4. PAC Speer & Co.
5. 8/97
6. MD SHPO
7. shed, south + east elevations
8. 6 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Sperry & Co.
5. 8/97
6. MD SHPO
7. modern church, east elevation
8. 7 of 15



ROUND OAK
BAPTIST CHURCH
ERECTED
JUNE 29 1941

1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Sperry & Co.
5. 8/97
6. MD SHPO
7. cornerstone, view north
8. 8 of 15

ROUND OAK MISSIONARY BAPTIST CHURCH

ORGANIZED 1868 BY REV. ROBERT TAYLOR.

PRESENT EDIFICE BUILT GRATIS BY W.R. LEE

DEDICATED SEPTEMBER 19, 1982

CORNERSTONE LAID SEPTEMBER 15, 1990

REV. LIONEL P. POINTER, JR., PASTOR (1976)

1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spurr & Co.
5. 8/97
6. MD SHPO
7. modern church plaque, view southwest
8. 9 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spaw & Co.
5. 8/97
6. MD SHPO
7. cemetery
8. 10 of 15

WIFE OF
MARY E
WIFE OF
HENRY H. WILSON
DIED JULY 18 1888

1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Sperry & Co.
5. 8/97
6. MD SHPO
7. 1888 headstone
8. 11 of 15




S. P. Miller
Born July 4
1843
Died Aug
1913

1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spero & Co.
5. 8/97
6. MD SHPO
7. 1923 headstone
8. 12 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spero & Co.
5. 8/97
6. MD SHPO
7. 1945 headstone
8. 13 of 15

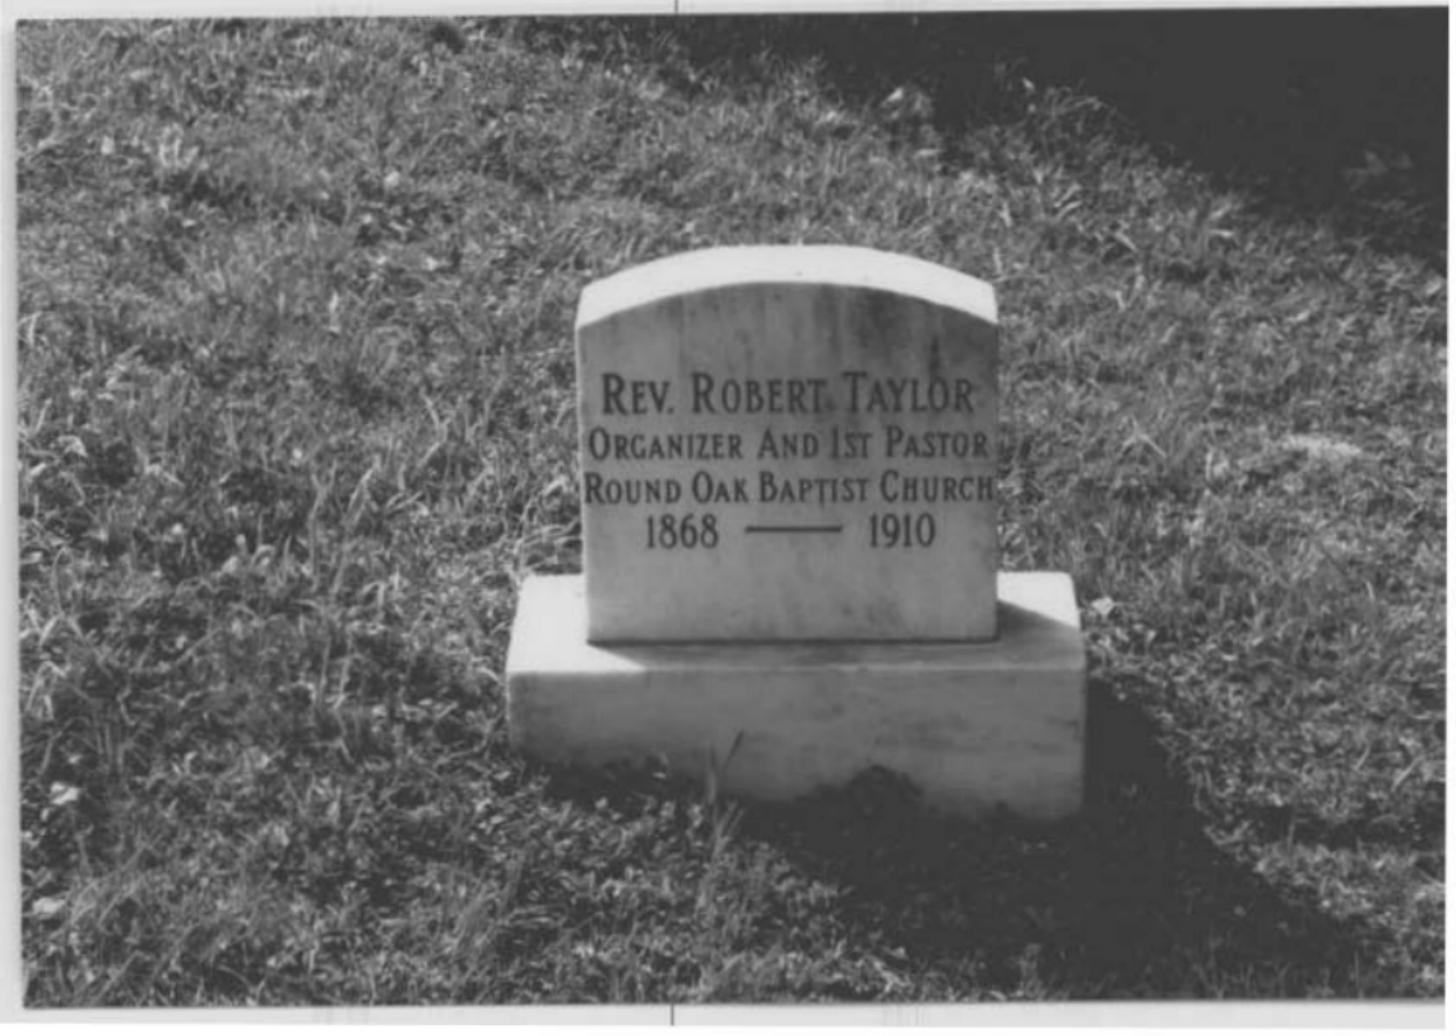

REV. ROBERT TAYLOR
ORGANIZER AND 1ST PASTOR
ROUND OAK BAPTIST CHURCH
1868 ——— 1910

1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co., MD
4. PAC Spero & Co.
5. 8/97
6. MD SHPO
7. headstone of church organizer & 1st pastor
8. 14 of 15



1. M: 28-51
2. Round Oak Missionary Baptist Church
3. Montgomery Co, MD
4. PAC Spero & Co.
5. 8/97
6. MD SHPO
7. 1930 headstone
8. 15 of 15