

MARYLAND HISTORICAL TRUST
DETERMINATION OF ELIGIBILITY FORM

NR Eligible: yes ___
no ___

Property Name: Woodstock Laundry Log Cabin Inventory Number: BA-1581
Address: 10820 Old Court Road Historic district: ___ yes no
City: Woodstock Zip Code: 21163 County: Baltimore County
USGS Quadrangle(s): Ellicott City
Property Owner: Maryland Department of Natural Resources Tax Account ID Number: 1600005160
Tax Map Parcel Number(s): 0001 Tax Map Number: 86
Project: Documentation of the Woodstock Laundry Log Cabin Agency: Maryland Department of Natural Resources
Agency Prepared By: JMA
Preparer's Name: Sarah G. Traum Date Prepared: 7/19/2015

Documentation is presented in: see continuation sheet

Preparer's Eligibility Recommendation: ___ Eligibility recommended Eligibility not recommended

Criteria: ___ A ___ B ___ C ___ D Considerations: ___ A ___ B ___ C ___ D ___ E ___ F ___ G

Complete if the property is a contributing or non-contributing resource to a NR district/property.

Name of the District/Property: _____

Inventory Number: _____ Eligible: ___ yes Listed: ___ yes

Site visit by MHT Staf ___ yes no Name: _____ Date: _____

Description of Property and Justification: *(Please attach map and photo)*

The Woodstock Laundry Log Cabin property is a ca. 1880 outbuilding, comprised of three adjoining buildings. The buildings stand immediately east of the former laundry for Woodstock College (now a residence). They are located at the west end of a gravel driveway on the west side of Old Court Road, within the Woodstock section of Patapsco Valley State Park.

The Woodstock Laundry Log Cabin currently stand vacant. It is comprised of three adjoining buildings, arranged in an L plan. The largest component is the southern block. It stands on a rubble stone foundation and faces west towards the former laundry (now residence). It measures three bays wide and one bay deep. The side-gabled roof is covered with corrugated metal. This block has board-and-batten siding, with drop siding in the gable ends. Some of the siding is missing, which exposes the square-cut, v-notched logs that make up the structure of this block. These logs have stone chinking. A stuccoed, brick chimney rises through the northern gable end. The doors and windows of this block are boarded over, and the interior was not accessible. Adjoining the northern gable end of the southern block is a smaller, log structure. This component measures two bays wide and one bay deep. It shares the southern block's board-and-batten exterior and corrugated metal roof. In the northwest corner of the northern block, the siding is missing, exposing the square-cut, v-notch log structure beneath. The windows on the north and west elevations of this block are also boarded over. Adjoining the east elevation of the northern block is a shorter, side-gabled structure. This component

MARYLAND HISTORICAL TRUST REVIEW

Eligibility recommended ___ Eligibility not recommended

Criteria: ___ A ___ B ___ C ___ D Considerations: ___ A ___ B ___ C ___ D ___ E ___ F ___ G

MHT Comments:

Jonathan Sager
Reviewer, Office of Preservation Services

9/30/15
Date

NA
Reviewer, National Register Program

Date

201504100

BA-1581

Woodstock Laundry Log Cabin

measures two bays wide and one bay deep. It stands on brick piers and has a corrugated metal roof with a brick chimney rising through the eastern gable. The exterior is board-and-batten, and the windows are boarded over. The door on the south elevation is not boarded over and allows a view of the interior of this block. The single-room interior of this block has a painted plaster finish.

The Woodstock Laundry Log Cabin was built ca. 1880-1890 as a support building for the former Jesuit Woodstock College. Woodstock College (BA-7, located approximately 0.75 miles southwest of the Woodstock Laundry Log Cabin). Woodstock College opened in 1869 as the first Jesuit House of Studies in the United States. This institution provided advanced academic and theological studies for American Jesuits. It educated many teachers and scholars that served in Jesuit educational institutions such as Georgetown University, Boston College, and Loyola College (Grandine and Show 2012). The graduate seminary operated until 1969. In July 1971, the State of Maryland purchased 673 acres of the former college, including the Woodstock Laundry Log Cabin (Baltimore County Land Records 5206:389).

The Woodstock Laundry Log Cabin is an example of a late nineteenth century domestic outbuilding that was built for the use of a religious institution, the Woodstock College. It lacks integrity of design and materials due to the deteriorated nature of the building. While these buildings are associated with the National Register eligible Woodstock College historic district (BA-7), the large distance separating the Woodstock Laundry Log Cabin and the intervening vegetation serve to break the association between these two buildings.

REFERENCES CITED:

Grandine K., K. Dixon, M. Williams, C. Heindenrich, D. Grosse, K. Child
2004 Maryland Inventory of Historic Properties Form: Patapsco Valley State Park. On file at the Maryland Historical Trust.

Grandine, Katherine and Travis Shaw
2012 Maryland Historical Trust, Determination of Eligibility Form, Woodstock College (BA-7). On file at the Maryland Historical Trust.

Baltimore County Land Records (BCLR)
1971 on file at MDLANDREC.net.

MARYLAND HISTORICAL TRUST REVIEW													
Eligibility recommended _____				Eligibility not recommended _____									
Criteria:	___ A	___ B	___ C	___ D	Considerations:	___ A	___ B	___ C	___ D	___ E	___ F	___ G	
MHT Comments:													
_____							_____						
Reviewer, Office of Preservation Services							Date						
_____							_____						
Reviewer, National Register Program							Date						

CAPSULE SUMMARY

Woodstock Laundry Log Cabin

BA-1581

Woodstock vicinity

Baltimore County, Maryland

Ca. 1880

Public

The Woodstock Laundry Log Cabin property is a ca. 1880 outbuilding, comprised of three adjoining buildings. The buildings stand immediately east of the former laundry for Woodstock College (now a residence). They are located at the west end of a gravel driveway on the west side of Old Court Road, within the Woodstock section of Patapsco Valley State Park.

The Woodstock Laundry Log Cabin is currently vacant. It is an example of a vernacular, log, domestic outbuilding. Three one-story tall, rectangular structures adjoin to form the L-plan building. The western two structures are built of square-cut, v-notched logs. The Brown House is associated with the National Register-eligible Woodstock College (BA-7), but is separated from this historic district by almost one mile and dense woods. It also lacks integrity of design and materials due to the deteriorated nature of the building.

Maryland Historical Trust Maryland Inventory of Historic Properties Form

Inventory No. BA-1581

1. Name of Property (indicate preferred name)

historic Woodstock Laundry Log Cabin
other Buchanan House outbuildings

2. Location

street and number 10820 Old Court Road ___ not for publication
city, town Woodstock ___ vicinity
county Baltimore County

3. Owner of Property (give names and mailing addresses of all owners)

name State of Maryland, Department of Natural Resources
street and number Tawes State Office Building, 580 Taylor Avenue telephone
city, town Annapolis state MD zip code 21401

4. Location of Legal Description

courthouse, registry of deeds, etc. Baltimore County Courthouse liber 5206 folio 389
city, town Towson tax map 86 tax parcel 0001 tax ID number 1600005160

5. Primary Location of Additional Data

- Contributing Resource in National Register District
 Contributing Resource in Local Historic District
 Determined Eligible for the National Register/Maryland Register
 Determined Ineligible for the National Register/Maryland Register
 Recorded by HABS/HAER
 Historic Structure Report or Research Report at MHT
 Other: _____

6. Classification

Category	Ownership	Current Function		Resource Count
<input type="checkbox"/> district	<input checked="" type="checkbox"/> public	<input type="checkbox"/> agriculture	<input type="checkbox"/> landscape	Contributing
<input checked="" type="checkbox"/> building(s)	<input type="checkbox"/> private	<input type="checkbox"/> commerce/trade	<input type="checkbox"/> recreation/culture	Noncontributing
<input type="checkbox"/> structure	<input type="checkbox"/> both	<input type="checkbox"/> defense	<input type="checkbox"/> religion	<input type="checkbox"/> 1 buildings
<input type="checkbox"/> site		<input type="checkbox"/> domestic	<input type="checkbox"/> social	<input type="checkbox"/> sites
<input type="checkbox"/> object		<input type="checkbox"/> education	<input type="checkbox"/> transportation	<input type="checkbox"/> structures
		<input type="checkbox"/> funerary	<input type="checkbox"/> work in progress	<input type="checkbox"/> objects
		<input type="checkbox"/> government	<input type="checkbox"/> unknown	<input type="checkbox"/> 1 Total
		<input type="checkbox"/> health care	<input checked="" type="checkbox"/> vacant/not in use	Number of Contributing Resources
		<input type="checkbox"/> industry	<input type="checkbox"/> other:	previously listed in the Inventory

7. Description

Inventory No. BA-1581

Condition

excellent deteriorated
 good ruins
 fair altered

Prepare both a one paragraph summary and a comprehensive description of the resource and its various elements as it exists today.

The Woodstock Laundry Log Cabin property is a ca. 1880 outbuilding, comprised of three adjoining buildings. The buildings stand immediately east of the former laundry for Woodstock College (now a residence). They are located at the west end of a gravel driveway on the west side of Old Court Road, within the Woodstock section of Patapsco Valley State Park.

The Woodstock Laundry Log Cabin currently stand vacant. It is comprised of three adjoining buildings, arranged in an L plan. The largest component is the southern block. It stands on a rubble stone foundation and faces west toward the former laundry (now residence). It measures three bays wide and one bay deep. The side-gabled roof is covered with corrugated metal. This block has board-and-batten siding, with drop siding in the gable ends. Some of the siding is missing, which exposes the square-cut, v-notched logs that make up the structure of this block. These logs have stone chinking. A stuccoed, brick chimney rises through the northern gable end. The doors and windows of this block are boarded over, and the interior was not accessible. Adjoining the northern gable end of the southern block is a smaller, log structure. This component measures two bays wide and one bay deep. It shares the southern block's board-and-batten exterior and corrugated metal roof. In the northwest corner of the northern block, the siding is missing, exposing the square-cut, v-notch log structure beneath. The windows on the north and west elevations of this block are also boarded over. Adjoining the east elevation of the northern block is a shorter, side-gabled structure. This component measures two bays wide and one bay deep. It stands on brick piers and has a corrugated metal roof with a brick chimney rising through the eastern gable. The exterior is board-and-batten, and the windows are boarded over. The door on the south elevation is not boarded over and allows a view of the interior of this block. The interior of this block has a painted plaster finish.

8. Significance

Inventory No. BA-1581

Period	Areas of Significance	Check and justify below		
<input type="checkbox"/> 1600-1699	<input type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> health/medicine	<input type="checkbox"/> performing arts
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> archeology	<input type="checkbox"/> education	<input type="checkbox"/> industry	<input type="checkbox"/> philosophy
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> architecture	<input type="checkbox"/> engineering	<input type="checkbox"/> invention	<input type="checkbox"/> politics/government
<input type="checkbox"/> 1900-1999	<input type="checkbox"/> art	<input type="checkbox"/> entertainment/ recreation	<input type="checkbox"/> landscape architecture	<input checked="" type="checkbox"/> religion
<input type="checkbox"/> 2000-	<input type="checkbox"/> commerce	<input type="checkbox"/> ethnic heritage	<input type="checkbox"/> law	<input type="checkbox"/> science
	<input type="checkbox"/> communications	<input type="checkbox"/> exploration/ settlement	<input type="checkbox"/> literature	<input type="checkbox"/> social history
	<input type="checkbox"/> community planning		<input type="checkbox"/> maritime history	<input type="checkbox"/> transportation
	<input type="checkbox"/> conservation		<input type="checkbox"/> military	<input type="checkbox"/> other: _____

Specific dates

Architect/Builder

Construction dates ca. 1880-1890

Evaluation for:

National Register

Maryland Register

not evaluated

Prepare a one-paragraph summary statement of significance addressing applicable criteria, followed by a narrative discussion of the history of the resource and its context. (For compliance projects, complete evaluation on a DOE Form – see manual.)

The Woodstock Laundry Log Cabin was built ca. 1880-1890 as a support building for the former Jesuit Woodstock College. Woodstock College (BA-7, located approximately 0.75 miles southwest of the Woodstock Laundry Log Cabin). Woodstock College opened in 1869 as the first Jesuit House of Studies in the United States. This institution provided advanced academic and theological studies for American Jesuits. It educated many teachers and scholars that served in Jesuit educational institutions such as Georgetown University, Boston College, and Loyola College (Grandine and Show 2012). The graduate seminary operated until 1969. In July 1971, the State of Maryland purchased 673 acres of the former college, including the Woodstock Laundry Log Cabin (Baltimore County Land Records 5206:389).

The Woodstock Laundry Log Cabin is an example of a late nineteenth century domestic outbuilding that was built for the use of a religious institution, the Woodstock College. It lacks integrity of design and materials due to the deteriorated nature of the building. While these buildings are associated with the National Register-eligible Woodstock College historic district (BA-7), the large distance separating the Woodstock Laundry Log Cabin and the intervening vegetation serve to break the association between these two buildings.

9. Major Bibliographical References

Inventory No. BA-1581

Grandine K., K. Dixon, M. Williams, C. Heindenrich, D. Grosse, K. Child

2004 Maryland Inventory of Historic Properties Form: Patapsco Valley State Park. On file at the Maryland Historical Trust.

Grandine, Katherine and Travis Shaw

2012 Maryland Historical Trust, Determination of Eligibility Form, Woodstock College (BA-7). On file at the Maryland Historical Trust.

Baltimore County Land Records (BCLR)

1971 On file at MDLANDREC.net.

10. Geographical Data

Acreage of surveyed property 2

Acreage of historical setting _____

Quadrangle name Ellicot City

Quadrangle scale: _____

Verbal boundary description and justification

The Woodstock Laundry Log Cabin property is located at the west end of a gravel driveway on the west side of Old Court Road, within the Woodstock section of Patapsco Valley State Park. The cleared space around the building slopes gently to the south. The boundary encompasses the locations of the standing building associated with this resource.

11. Form Prepared by


name/title	Sarah G. Traum		
organization	JMA	date	July 18, 2015
street & number	5250 Cherokee Ave., Ste. 300	telephone	703-698-1277
city or town	Alexandria	state	VA

The Maryland Inventory of Historic Properties was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.


The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:

Maryland Historical Trust
Maryland Department of Planning
100 Community Place
Crownsville, MD 21032-2023
410-514-7600

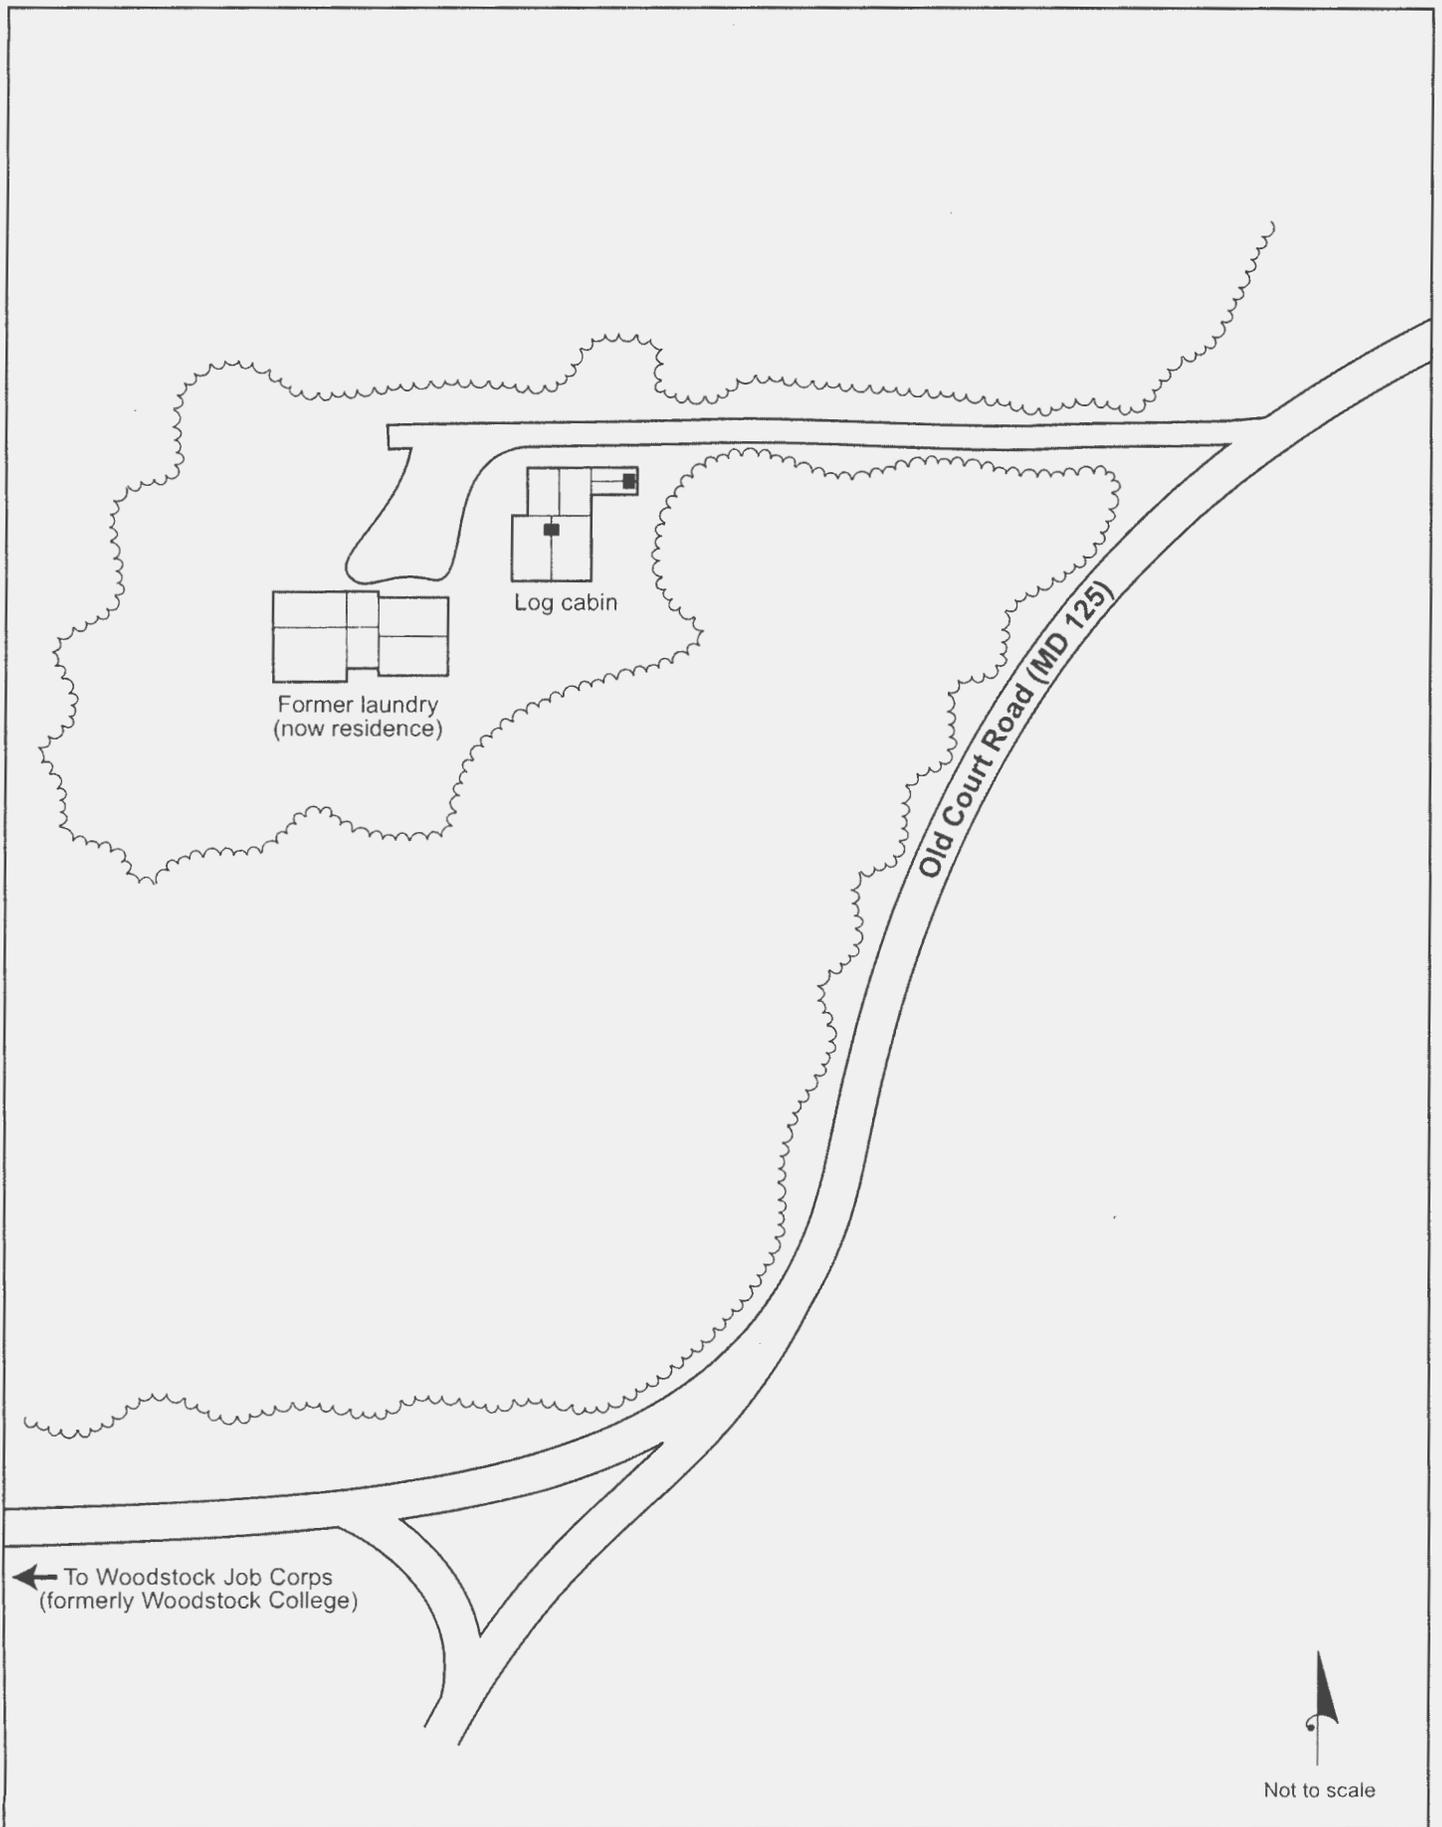

Resource sketch map of the Woodstock Laundry Log Cabin (MIHP BA-1581), Patapsco Valley State Park, Baltimore County, Maryland.

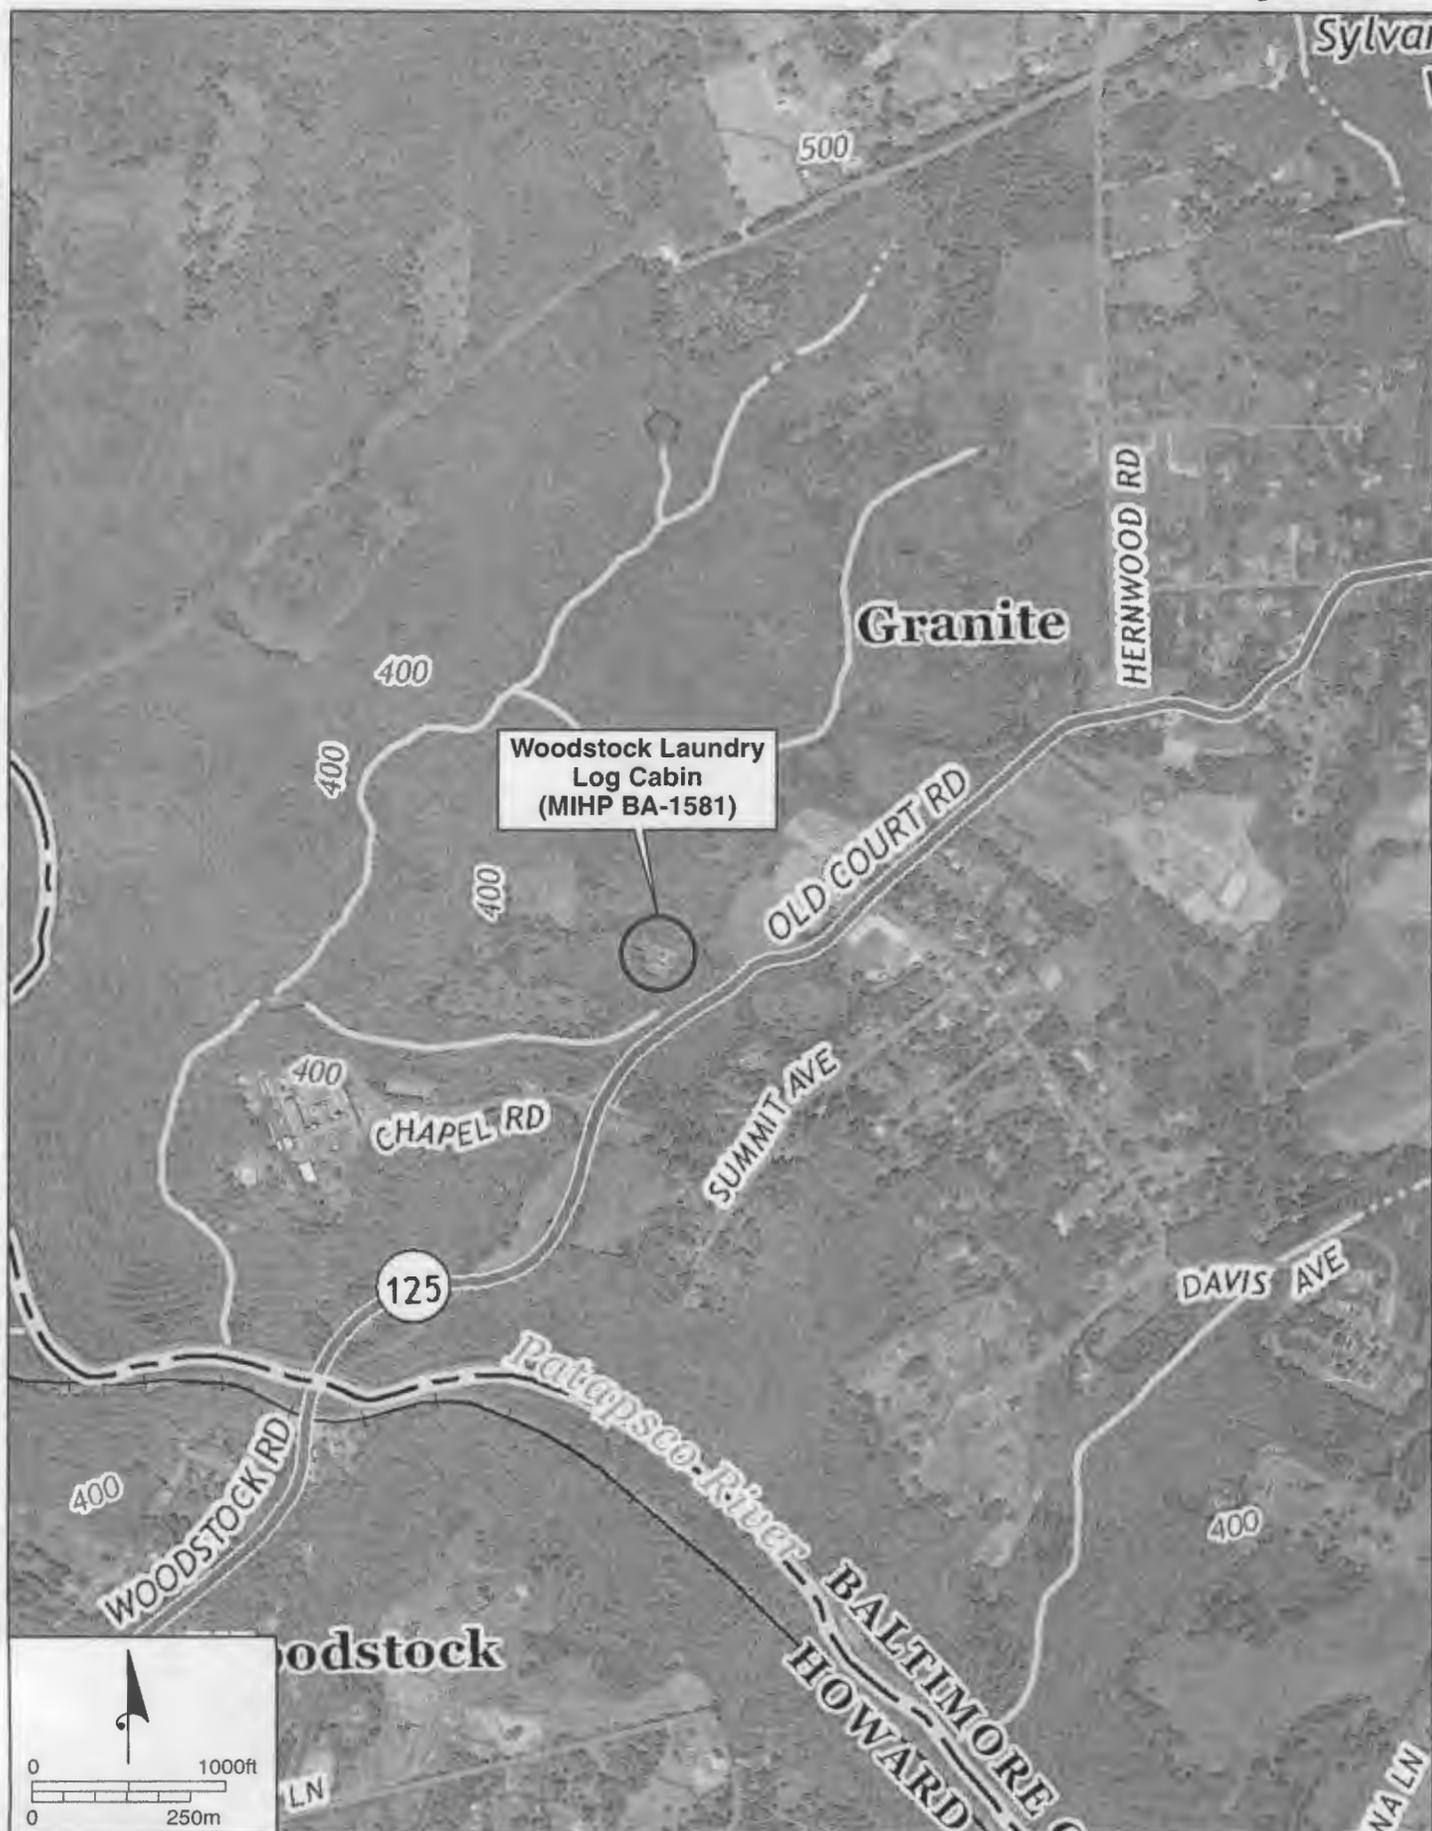

2014 topographic quadrangle showing the location of the Woodstock Laundry Log Cabin (MIHP BA-1581) (USGS 2014).

(ELLICOTT CITY)

Woodstock Laundry Log Cabin
Baltimore County, MD
(BA-1581)
Photograph Log

Photographs printed on HP Premium Plus photo paper using HP Vivera Ink
Photographs taken November 19, 2014

Photo file name	Description
BA-1581_2014-11-19_01	Cabin, west elevation, view toward east.
BA-1581_2014-11-19_02	Cabin, view toward southeast.
BA-1581_2014-11-19_03	Cabin, detail of log construction in northwest corner.
BA-1581_2014-11-19_04	Cabin, east wing, view toward northwest.
BA-1581_2014-11-19_05	Cabin, southeast corner, view toward northwest.
BA-1581_2014-11-19_06	Cabin, southeast corner, detail of log construction and stone chinking, view toward northwest.
BA-1581_2014-11-19_07	Cabin, east wing, interior, view toward east.



HP Premium Plus



HP Premium Plus



HP Premium Plus



HP Premium Plus



BA-1581
WOODSTOCK LAUNDRY LOG CABIN
BALTIMORE COUNTY, MD
NOVEMBER 2014
S. TRAUM
CABIN, WEST ELEVATION
1/7
BA-1581-2014-11-19_01



BA-1581
WOODSTOCK LAUNDRY LOG CABIN
BALTIMORE COUNTY, MD
NOVEMBER 2014
S. TRAUM
CABIN, NORTHWEST CORNER
2/7
BA-1581-2014-11-19-02



BA-1581 LAUNDRY LOG CABIN
WOODSTOCK COUNTY, MD
BALTIMORE COUNTY, MD
NOVEMBER 2014

S. TRAUM
CABIN, NORTHWEST CORNER, DETAIL
317

BA-1581 - 2014-11-19-03



BA-1581
WOODSTOCK LAUNDRY LOG CABIN
BALTIMORE COUNTY, MD
NOVEMBER 2014
S. TRAUM WING
CABIN, EAST

4/7
BA-1581-2014-11-19-04



BA-1581
WOODSTOCK LAUNDRY LOG CABIN
BALTIMORE COUNTY, MD
NOVEMBER 2014
S. TRAUM
CABIN, SOUTHEAST CORNER
5/7

BA-1581_2014-11-19_05



HP Premium Plus

BA-1581
WOODSTOCK LAUNDRY LOG CABIN

BALTIMORE COUNTY, MD

NOVEMBER 2014

S. TRAUM

CABIN, SOUTHEAST CORNER, LOG CONSTRUCTION AND CHIMNEY DETAIL

6/7

BA-1581-2014-11-19-06



BA-1581
WOODSTOCK LAUNDRY LOG CABIN
BALTIMORE COUNTY, MD

NOVEMBER 2014
S. TRAUM

CABIN, EAST WING INTERIOR

7/7

BA-1581-2014-11-19-07

MARYLAND HISTORICAL TRUST

0315813

INVENTORY FORM FOR STATE HISTORIC SITES SURVEY

1 NAME

HISTORIC

AND/OR COMMON

[Woodstock College, dwelling and attached laundry]

2 LOCATION

STREET & NUMBER

Old Court Road

CITY, TOWN

Woodstock [Granite]

CONGRESSIONAL DISTRICT

VICINITY OF

STATE

Maryland

COUNTY

Baltimore

3 CLASSIFICATION

CATEGORY	OWNERSHIP	STATUS	PRESENT USE	
<input type="checkbox"/> DISTRICT	<input checked="" type="checkbox"/> PUBLIC	<input checked="" type="checkbox"/> OCCUPIED (house)	<input type="checkbox"/> AGRICULTURE	<input type="checkbox"/> MUSEUM
<input checked="" type="checkbox"/> BUILDING(S)	<input type="checkbox"/> PRIVATE	<input checked="" type="checkbox"/> UNOCCUPIED (laundry)	<input type="checkbox"/> COMMERCIAL	<input type="checkbox"/> PARK
<input type="checkbox"/> STRUCTURE	<input type="checkbox"/> BOTH	<input type="checkbox"/> WORK IN PROGRESS	<input type="checkbox"/> EDUCATIONAL	<input checked="" type="checkbox"/> PRIVATE RESIDENCE
<input type="checkbox"/> SITE	PUBLIC ACQUISITION	ACCESSIBLE	<input type="checkbox"/> ENTERTAINMENT	<input type="checkbox"/> RELIGIOUS
<input type="checkbox"/> OBJECT	<input type="checkbox"/> IN PROCESS	<input type="checkbox"/> YES: RESTRICTED	<input type="checkbox"/> GOVERNMENT	<input type="checkbox"/> SCIENTIFIC
	<input type="checkbox"/> BEING CONSIDERED	<input type="checkbox"/> YES: UNRESTRICTED	<input type="checkbox"/> INDUSTRIAL	<input type="checkbox"/> TRANSPORTATION
		<input type="checkbox"/> NO	<input type="checkbox"/> MILITARY	<input type="checkbox"/> OTHER:

4 OWNER OF PROPERTY

NAME

Maryland Department of Natural Resources

Telephone #:

STREET & NUMBER

Taylor Avenue

CITY, TOWN

Annapolis

VICINITY OF

STATE, zip code

Maryland 21401

5 LOCATION OF LEGAL DESCRIPTION

COURTHOUSE,
REGISTRY OF DEEDS, ETC.

Baltimore County Court House

Liber #:

Folio #:

STREET & NUMBER

CITY, TOWN

Towson

STATE

Maryland

6 REPRESENTATION IN EXISTING SURVEYS

TITLE

DATE

FEDERAL STATE COUNTY LOCAL

DEPOSITORY FOR
SURVEY RECORDS

CITY, TOWN

STATE

7 DESCRIPTION

CONDITION		CHECK ONE	CHECK ONE
<input type="checkbox"/> EXCELLENT	<input type="checkbox"/> DETERIORATED	<input checked="" type="checkbox"/> UNALTERED	<input checked="" type="checkbox"/> ORIGINAL SITE
<input checked="" type="checkbox"/> GOOD	<input type="checkbox"/> RUINS	<input type="checkbox"/> ALTERED	<input type="checkbox"/> MOVED DATE _____
<input checked="" type="checkbox"/> FAIR	<input type="checkbox"/> UNEXPOSED		

DESCRIBE THE PRESENT AND ORIGINAL (IF KNOWN) PHYSICAL APPEARANCE

The structure was built in several sections, beginning with what appears to have been the original dwelling and proceeding westward.

The original house is a one-and-one-half-story brick building of common bond with a gable roof, ridge on the long axis (as are all gables in the larger structure). The four-bay facade with entrance in the second bay has a shed porch across the first story. Windows are 6/6 except for the half story, which are 3/3. The gable end (east) has two windows in the first story, one above. The rear (north) elevation is three bays with windows only in the first story, with an entrance at the west; the east window is bricked in.

The west gable end adjoins the large frame laundry building, built in two sections. The first, wider than the brick structure, is a two-story, two-bay, gabled frame building, south wall flush with the brick wall, with a chimney in the west wall. The gable is not as steep as that of the brick house. The second addition is a long low gable roof frame structure. The south wall remains continuous with the first parts of that elevation for two bays, a window and a door, and then cones forward one bay to accommodate a window on the east. Both frame additions are built on high granite basements. There is a small stone loading dock on the north wall. The first addition is clapboard, the second has German siding.

CONTINUE ON SEPARATE SHEET IF NECESSARY

SIGNIFICANCE

PERIOD	AREAS OF SIGNIFICANCE -- CHECK AND JUSTIFY BELOW			
<input type="checkbox"/> PREHISTORIC	<input type="checkbox"/> ARCHEOLOGY-PREHISTORIC	<input type="checkbox"/> COMMUNITY PLANNING	<input type="checkbox"/> LANDSCAPE ARCHITECTURE	<input type="checkbox"/> RELIGION
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> ARCHEOLOGY-HISTORIC	<input type="checkbox"/> CONSERVATION	<input type="checkbox"/> LAW	<input type="checkbox"/> SCIENCE
<input type="checkbox"/> 1500-1599	<input type="checkbox"/> AGRICULTURE	<input type="checkbox"/> ECONOMICS	<input type="checkbox"/> LITERATURE	<input type="checkbox"/> SCULPTURE
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> ARCHITECTURE	<input type="checkbox"/> EDUCATION	<input type="checkbox"/> MILITARY	<input type="checkbox"/> SOCIAL/HUMANITARIAN
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> ART	<input type="checkbox"/> ENGINEERING	<input type="checkbox"/> MUSIC	<input type="checkbox"/> THEATER
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> COMMERCE	<input type="checkbox"/> EXPLORATION/SETTLEMENT	<input type="checkbox"/> PHILOSOPHY	<input type="checkbox"/> TRANSPORTATION
<input type="checkbox"/> 1900-	<input type="checkbox"/> COMMUNICATIONS	<input type="checkbox"/> INDUSTRY	<input type="checkbox"/> POLITICS/GOVERNMENT	<input type="checkbox"/> OTHER (SPECIFY)
		<input type="checkbox"/> INVENTION		

SPECIFIC DATES	BUILDER/ARCHITECT
----------------	-------------------

STATEMENT OF SIGNIFICANCE

The significance is primarily visual. The brick house may have some age and should be retained.

Recommendations

The frame sections of the building are sound, but vacant at present. Some use should be found for them. The brick house is occupied and should continue so. Alterations, changes in use should be discouraged. Routine maintenance and repair should be carried out with regard for the historic fabric. The slat screens beneath the porch need repair. The house should be kept painted.

9 MAJOR BIBLIOGRAPHICAL REFERENCES

CONTINUE ON SEPARATE SHEET IF NECESSARY

10 GEOGRAPHICAL DATA

ACREAGE OF NOMINATED PROPERTY _____

VERBAL BOUNDARY DESCRIPTION

LIST ALL STATES AND COUNTIES FOR PROPERTIES OVERLAPPING STATE OR COUNTY BOUNDARIES

STATE COUNTY

STATE COUNTY

11 FORM PREPARED BY

NAME / TITLE

John D. Hnedak, Historic Sites Survey Team Captain

ORGANIZATION

Maryland Historical Trust

DATE

1978-79

STREET & NUMBER

21 State Circle

TELEPHONE

269-2438

CITY OR TOWN

Annapolis

STATE

Maryland 21401

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature, to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 Supplement.

The Survey and Inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

RETURN TO: Maryland Historical Trust
The Shaw House, 21 State Circle
Annapolis, Maryland 21401
(301) 267-1438

BA-1581





BA-1581

Woodstock College Dwelling

Patapoco State Park

North Elevation

JOH 6/78



BA-1581
Woodstock Duelling
Patapsco State Park

JDH 6/58





BA - 1581

Woodstock College Dwelling

Patapsco State Park

South Elevation

JDH

6/78



BA-1581

Woodstock College Dwelling

Patapsco State Park

North Elevation

JDH 6/78