

CARR-1149

Benjamin Bowser Farm  
4864 Schalk Road One  
Alesia (vicinity)

1873; 1878

The Benjamin Bowser Farm was assembled from several smaller parcels by John Fair, Jr., beginning in 1837. By 1852, he had a house of wood on the property. Four years later John and Rebecca Fair sold the farm, 136 acres, to Benjamin Bowser for \$3100. By 1866, he had a log house and frame barn. On 14 May 1873, it was noted that he had a new barn worth \$100. Bowser had a machine shop on the premises. He also had a sawmill worth \$550. According to the painted date placque on the gable end of the existing house, Bowser was successful enough that he could build this new brick dwelling in 1878.

KS/lh:7/8/92:signif12

# Maryland Historical Trust State Historic Sites Inventory Form

MARYLAND INVENTORY OF  
HISTORIC PROPERTIES

Magi No.

DOE  yes  no

## 1. Name (indicate preferred name)

historic Benjamin Bowser Farm

and/or common

## 2. Location

street & number 4864 Schalk Road One  not for publicationcity, town Alesia  vicinity of congressional district

state Maryland county Carroll

## 3. Classification

Category	Ownership	Status	Present Use
<input type="checkbox"/> district	<input type="checkbox"/> public	<input checked="" type="checkbox"/> occupied	<input type="checkbox"/> agriculture <input type="checkbox"/> museum
<input checked="" type="checkbox"/> building(s)	<input checked="" type="checkbox"/> private	<input type="checkbox"/> unoccupied	<input type="checkbox"/> commercial <input type="checkbox"/> park
<input type="checkbox"/> structure	<input type="checkbox"/> both	<input type="checkbox"/> work in progress	<input type="checkbox"/> educational <input checked="" type="checkbox"/> private residence
<input type="checkbox"/> site	<b>Public Acquisition</b>	<b>Accessible</b>	<input type="checkbox"/> entertainment <input type="checkbox"/> religious
<input type="checkbox"/> object	<input type="checkbox"/> in process	<input checked="" type="checkbox"/> yes: restricted	<input type="checkbox"/> government <input type="checkbox"/> scientific
	<input type="checkbox"/> being considered	<input type="checkbox"/> yes: unrestricted	<input type="checkbox"/> industrial <input type="checkbox"/> transportation
	<input checked="" type="checkbox"/> not applicable	<input type="checkbox"/> no	<input type="checkbox"/> military <input type="checkbox"/> other:

## 4. Owner of Property (give names and mailing addresses of all owners)

name Wayne I. Miller

street &amp; number 4850 Schalk Road One telephone no.: 374-9550

city, town Millers state and zip code Maryland 21107

## 5. Location of Legal Description

courthouse, registry of deeds, etc. Courthouse Annex liber 930

street &amp; number 55 North Court Street folio 378

city, town Westminster state Maryland

## 6. Representation in Existing Historical Surveys

title

date  federal  state  county  local

depository for survey records

city, town state

# 7. Description

Survey No. CARR-1149

<b>Condition</b>		<b>Check one</b>	<b>Check one</b>	
<input type="checkbox"/> excellent	<input type="checkbox"/> deteriorated	<input type="checkbox"/> unaltered	<input checked="" type="checkbox"/> original site	
<input checked="" type="checkbox"/> good	<input type="checkbox"/> ruins	<input checked="" type="checkbox"/> altered	<input type="checkbox"/> moved	date of move _____
<input type="checkbox"/> fair	<input type="checkbox"/> unexposed			

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

**Summary:** The Benjamin Bowser Farm is located on the west side of Schalk Road One. The house faces east, toward Schalk Road, and is a two-story, four-bay by two-bay building of 5-1 common bond brick. It is banked into the hill on the west. The first story has two center entrances. The windows have 2/2 double hung sash. The openings are not spaced regularly. There is a raised one-story porch that wraps around the east, south, and west elevations. The south elevation has a semicircular date panel painted "Built 1878 By B. Bowser." South of the house is a 5-1 common bond brick smokehouse on a rubble stone foundation. East of the smokehouse is a stone and frame combination springhouse and summer kitchen banked into a hill on the southwest corner. The building is a rubble stone one-story structure with a cantilevered frame attic on the north side that is clapboarded. The first floor plan has an enclosed central staircase against an east-west wall that is placed north of center and divides the house. The north half is divided into two even rooms. The south half has a large kitchen in the southwest room. Under the cantilevered section is an enclosed stair. North of the house is a wagon shed and a privy attached. Just north of the wagon shed is a frame shop building with slate gable roof. It is one bay by three bays, with an east-of-center entrance on the south gable end. The shop is one-and-one-half stories tall, having a raised attic, and is covered in German siding. North of all these structures, and set very close to the road, is the barn complex. The banked barn has the forebay facing south. Attached to the southwest corner of the barn is a poultry house. It is two stories and is banked into the hill. South of the barn is a vertical board, wood-shingled gable roof hog pen. North of the barn is a wagon shed with corn cribs on the east and west sides, and open ends on the north and south.

The Benjamin Bowser Farm is located on the west side of Schalk Road One approximately one-and-one-half miles north of Alesia and one-and-one-half miles southeast of Lineboro. The farm complex is laid out on a linear plan at the base of a steep ridge, and consists of a brick house built in 1878, a brick smokehouse, a stone and frame summer kitchen/springhouse, a frame shop building, frame wagon shed with attached privy, corn crib, hog pen, and bank barn with attached poultry house wing.

The house faces east, toward Schalk Road, and is a two-story, four-bay by two-bay building of 5-1 common bond brick on a rubble stone foundation. It is banked into the hill on the west. The exposed east cellar wall has one six-light sash in the south bay. The first story has two center entrances with three-light transoms and doors with one light over two vertical panels. The windows have 2/2 double hung sash with beaded-edge frames, and wood sills, lintels, and corner blocks. The openings are not spaced regularly, the two north bays being close together. The gable roof has inverted-V-seam

Description (continued)

Section 7 Page 2

metal and a boxed cornice. There is a raised one-story porch that wraps around the east, south, and west elevations. Stone and brick piers support the deck. The posts on the east have been boxed and the balusters on the south replaced, but original posts survive on the south. They are chamfered, with tripartite capital blocks. The original balusters on the east are vertical, and are square in plan. The steps are off the center of the east porch. The south elevation of the house is two bays, with two small four-light windows in the gable end and a semicircular date panel painted "Built 1878 By B. Bowser." Between the first story windows is a smaller one-light sash with a bullnose frame, and wood sill, lintel and corner blocks. The mortar joints show evidence of striping, some of which is missing around the small window, suggesting it was cut into the wall later, and new bricks toothed in. There is a door in the eastern-most end of the south elevation of the cellar. The north elevation has identical windows in the gable, but has an external brick chimney centered on the wall, and a six-light sash in the east bay of the cellar. An old aerial photograph in the owners possession shows an internal brick chimney at each end, and apparently a wood shingle roof. There were no steps east of the porch, which had six posts and balusters between them across the whole front.

The cellar is not subdivided, and the owner is not aware of the existence of any walls in the past. The stone walls are plastered, and there are the remains of a brick kitchen fireplace on the north wall. On the south wall are two brick piers that support a chimney above. There are beaded-edge board doors on the front and wood shelves between the piers. The hewn joists are supported by a single longitudinal summer beam. The oak flooring in the first story is stamped "Royal Oak Flooring; Clear Plain Red; Crossett Lumber Co., Crossett Arkansas." The first floor plan has an enclosed central staircase against an east-west wall that is placed north of center and divides the house. The north half is divided into two even rooms. The south half has a large kitchen in the south room that once had wainscot, a driesink, and a cookstove in the southeast corner. The southeast room is small, and the entrance to the stairs up to the second story is here. A door between the southeast and northeast rooms has been closed off, and the doorways between the southwest and southeast rooms and southwest and northwest rooms, have been enlarged and given segmental arches at a later date. The window and door surrounds are flat, with a rounded interior edge. The south half of the attic has vertical studs under each rafter. The studs contain nail holes suggesting this was finished as a room, and plaster survives on the south brick wall. The north half of the attic is not finished. The rafters are sawn and are mitered at the ridge.

South of the house is a 5-1 common bond brick smokehouse on a rubble stone foundation. The north elevation has a vertical board door with wood lintel and corner blocks. Above four bricks were omitted in the gable end for ventilation, but these are

Description (continued)

Section 7 Page 3

now filled by loose bricks. The same arrangement is on the south gable end, as well. The gable roof has an inverted V-seam covering and a box cornice. The interior retains its tree, which is a square post with three levels of racks. Each rack has four arms that support a diamond frame holding the hooks for the meat. The remains of a large brick fire pit are inside.

East of the smokehouse is a stone and frame combination springhouse and summer kitchen banked into a hill on the southwest corner. The building is a rubble stone one-story structure with a cantilevered frame attic on the north side that is clapboarded. There is a 6/6 double hung sash in the north gable end. Under the cantilevered section is an enclosed stair that is centered east to west on the north wall, and is flush with the north wall of the attic above. The clapboard is carried down to cover only the central section below the attic, where the stairs are. On the east side of the enclosed stairs are two risers and a vertical board door above them that leads to the remaining stairs. The sections east and west of the stairs, under the cantilevered north wall, are left open. The east bay of the north elevation has a vertical board door in a mitered wood frame set in the stone wall under the cantilever. There is a square wood post under the northeast corner of the cantilever. The east elevation has a 6/3 double hung sash north of center in the stone section. The east wall of the cantilevered section is covered in clapboard. The south elevation has clapboard in the gable end, with a 6/6 sash west of center. The west elevation has six-light sash north of center and a brick wall on a stone foundation from ground level to the plate of the cantilevered section. The stone and brick are not tied into the stone wall of the main structure, and are severely cracked. The north end girt of the cantilevered section projects through the brick wall.

The lower story has plastered walls inside and a concrete floor with concrete trough on the west wall. There is a large brick fireplace in the southeast corner with a wood mantel tree and the original cranes still hanging in it. The joists are hewn on top and bottom. There are wood lintels over the windows and doors in the interior. In the attic story the brick chimney is corbelled toward the ridge but the top has collapsed and no longer projects through the roof. The stone walls project about 2½ feet above the floor level. The large plates are one piece, spanning the entire length from the south wall to the end of the north wall of the cantilever. The north attic girt is hewn and has a central tenon set in a mortise in each plate and pegged. The framing on the north end is nailed. The rafters are sawn and mitered at the ridge.

North of the house is a wagon shed with nailed 2x4 frame and beaded-edge-and-center vertical board siding. The south end is open, only the pintles of the former doors that were here surviving. The shed is set on wood piers and has a gable roof with

Description (continued)

Section 7 Page 4

corrugated metal on the west half and inverted V-seam on the east. On the north end is a boarded-over opening in the center, and a privy attached to the wall west of the opening. The siding, and the door on the east, are the same as the wagon shed. The shed roof of the privy is inverted V-seam.

Just north of the wagon shed is a frame shop building with slate gable roof and rubble stone foundation. It is one bay by three bays, with an east-of-center entrance on the south gable end, and a 6/6 double hung sash in the center of the gable end. It is one-and-one-half stories tall, having a raised attic, and is covered in German siding. The door is of vertical, beaded-edge-and-center boards. The east elevation has three six-light sash. All openings have flat surrounds with gabled tops. The north elevation has a 6/6 sash centered in the gable end. The west elevation is vertical boards with several openings cut into it. The shop is built of 2x4 studs on the east and 4x4 studs on the west. The studs are full height, with 1x6 clamps nailed to them and 2x6 sawn joists that rest on the clamps. The floor is concrete. There are three posts down the middle of the building, on a north-south line. The straight run stairs begin in the northeast corner and run along the north wall. There is a trap door at the top of the stairs. The rafters are circular sawn 2x4's that are mitered at the ridge.

Northwest of the shop is a barrel-vaulted, poured concrete ground cellar set into the hill. It has a four-panel wood door on the east end.

North of all these structures, and set very close to the road, is the barn complex. The banked barn has the forebay facing south. The foundation is of rubble stone on all sides, with quoins at the corners. The lower story of the south elevation has a vertical board dutch door on strap hinges, a wood vent with louvers of diamond section, a beaded-edge vertical board dutch door on strap hinges, a similar vent, stone infill where a door was formerly, and two more vertical board dutch doors on strap hinges separated by a similar wood vent. The upper story is five bays, with two gabled wood vents at each end and a center door with the top portion of a gabled vent set above it. The siding is vertical, beaded-edge-and-center, tongue-and-groove boards. The east elevation has a new window in the south bay, with a four-light sash between two six-light sash. The north bay has a beaded-edge-and-center vertical board dutch door on strap hinges. Above is a row of three vents, and a door with gabled surround in the north corner. Above this is a row of two vents, and in the gable end a 6/6 sash with wood vent on either side, all topped by semi-circular wood trim. The north elevation has the ramp. The east bay of the lower story has an adjustable wood-louvered vent. In the upper story a six-light window with gabled surround flanks each side of the center double wagon doors. These doors match the siding, and have a smaller door inset in the west door. The west

Description (continued)

Section 7 Page 5

elevation has one 6/6 sash with gabled surround in the gable end. There is a foundation for a silo here, with rubble stone set on a brick base, and an opening into the lower story. Attached to the southwest corner of the barn is a poultry house. The interior of the lower story has been altered some, but retains the feed boxes, troughs, and hay racks. The large joists are hewn on top and bottom, and are supported by two summer beams. The upper story has a central threshing floor with a hay mow on each side and a granary in the northeast corner. Some of the original framing has been cut out, and some new members have been added. There are three-quarter round log rafters joined at the ridge with a central tenon in mortise, and pegged. The roof has several wind braces of small section.

The poultry house is a large ell that encloses the west end of the barnyard. The short section of the ell is attached to the barn, with the long section running south from the end of it. It is two stories and is banked into the hill, with a stone wall on the west and north sides of the lower story. The south and east sides are open, and have posts with braces that support the structure above. The upper story has a shed roof, with vertical board and batten siding on the north and west and beaded-edge-and-center vertical board siding on the south and east. The south elevation of the long section has a 6/6 sash and a board door to match the siding, while the short section has two 6/6 sash. The east elevation of the upper story has six 6/6 sash. The joists are hewn top and bottom, but the frame and rafters are sawn and nailed 2x4's. The west side of this structure is collapsing and it is slated to be demolished this summer (1992).

South of the barn is a vertical board, wood-shingled gabled-roof hog pen. It has a large door and a small door on the west, and one low opening for hogs on the east, at the south corner. This building helps to define the barnyard. There are the remains of fences west of the pen to the poultry house, and east of the pen to the road. Part of the eastern section of fence is wide, picket cut boards on horizontal rails. Horizontal rail and horizontal board fences and gates run along the road and enclose the east side of the barnyard.

North of the barn is a wagon shed with corn cribs on the east and west sides, and open ends on the north and south. It has a shed roof with inverted V-seam on lath. The foundation is dry-laid stone. There are horizontal laths on the east and north sides, with clapboard above. The west and south sides have clapboard only, with a vertical board door to each crib on the south side. The west crib has been rebuilt. The structure is built of sawn and nailed 4x4's.

# 8. Significance

Survey No. CARR-1149

Period	Areas of Significance—Check and justify below			
<input type="checkbox"/> prehistoric	<input type="checkbox"/> archeology-prehistoric	<input type="checkbox"/> community planning	<input type="checkbox"/> landscape architecture	<input type="checkbox"/> religion
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> archeology-historic	<input type="checkbox"/> conservation	<input type="checkbox"/> law	<input type="checkbox"/> science
<input type="checkbox"/> 1500-1599	<input checked="" type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> literature	<input type="checkbox"/> sculpture
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> architecture	<input type="checkbox"/> education	<input type="checkbox"/> military	<input type="checkbox"/> social/ humanitarian
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> art	<input type="checkbox"/> engineering	<input type="checkbox"/> music	<input type="checkbox"/> theater
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> commerce	<input type="checkbox"/> exploration/settlement	<input type="checkbox"/> philosophy	<input type="checkbox"/> transportation
<input type="checkbox"/> 1900-	<input type="checkbox"/> communications	<input type="checkbox"/> industry	<input type="checkbox"/> politics/government	<input type="checkbox"/> other (specify)
		<input type="checkbox"/> invention		

**Specific dates** 1873; 1878 **Builder/Architect**

check: Applicable Criteria:  A  B  C  D  
and/or

Applicable Exception:  A  B  C  D  E  F  G

Level of Significance:  national  state  local

Prepare both a summary paragraph of significance and a general statement of history and support.

**Summary:** The Benjamin Bowser Farm was assembled from several smaller parcels by John Fair, Jr., beginning in 1837. By 1852, he had a house of wood on the property. Four years later John and Rebecca Fair sold the farm, 136 acres, to Benjamin Bowser for \$3100. By 1866, he had a log house and frame barn. On 14 May 1873, it was noted that he had a new barn worth \$100. Bowser had a machine shop on the premises. He also had a sawmill worth \$550. According to the painted date placque on the gable end of the existing house, Bowser was successful enough that he could build this new brick dwelling in 1878.

Historic Period: Agriculture, Architecture  
 Geographic Organization: Piedmont  
 Chronological/Development Period: Industrial/Urban Dominance A.D. 1870-1930  
 Resource Types: Small family farmstead, Rural vernacular

The Benjamin Bowser Farm was assembled from several smaller parcels by John Fair, Jr. beginning in 1837 when he purchased 70 acres of what had been "Shaffer's Folly". He had a fulling mill on the property by 1841. The other major land purchase was 65 acres of "Sugar Valley" owned by the late George Fair, which was acquired in 1849. By 1852 he had a house of wood on the property. Four years later, John and Rebecca Fair sold the farm, 136 acres, to Benjamin Bowser for \$3100. Bowser, who was born in Pennsylvania, was 31. Bowser's first decade was a successful one. The 1860 census notes that he had a 17-year-old male farm hand and an 18-year-old female servant. By 1866, he had a log house and frame barn, livestock worth \$503 and farm machinery worth \$130. The growth of his farm continued. On 14 May 1873, it was noted that he had a new barn worth \$100. The barn and outbuildings were together valued at \$700. This high figure, in 1876, was due to the fact that Bowser had a machine shop on the premises. What exactly he was producing in his shop is not clear. The 1880 census simply lists him as a farmer. He also had a sawmill worth \$550 and his two-story log dwelling worth \$350. His farm was an above average operation, with three

Significance (continued)

Section 8 Page 2

horses, four cattle and nine hogs, despite his many other enterprises. According to the painted date placque on the gable end of the existing house, Bowser was successful enough that he could build this new brick dwelling in 1878. In 1883, it was noted that a new house and barn were worth \$500. This may have been a different house and barn, since it was noted in 1894 that 27 acres with a new house and barn were sold to Frederick and Emma Balters. Bowser's brick house, on the other hand, was sold in 1895, after his death, to Samuel and Amanda Garvick. By this time, the farm had been reduced to 67 acres, which is its current size. After Samuel Garvick's death, Amanda married John S. Werner, who retained the farm until 1933.

The house has several unique features. The porch that wraps around three sides is unusual for this area. Most houses have separate porches front and back. The irregular placement of openings in the front facade is characteristic of earlier "Pennsylvania Farmhouse" plan buildings, especially log structures. After the Civil War, most houses were more regular. Unusual and unexplained is the small window that appears to have been added later to the south side of the first story. It is almost like a pass-through from the smokehouse, springhouse, and summer kitchen on this side of the house. This farm has one of the most intact collections of farm outbuildings in northeast Carroll County. According to the owner, there was a bake oven next to the smokehouse, on the east, and a garage north of the house. Laid out basically on a linear farm plan, the barn is turned with one end to the road, presumably so the forebay will face south. This must have been a more important consideration to Bowser than having the barn "front" face the road and thus have the ramp side banked into the hill, as would be ideal.

KS/lh:6/29/92:signif12.kcn

# 9. Major Bibliographical References

Survey No. CARR-1149

Carroll County Land Records  
Tax Assessments - 1841; 1852; 1866, 1866-76, 1876, 1876-96  
1862 & 1877 maps  
Census - 1860, 1880

# 10. Geographical Data

Acreage of nominated property 62.41 acres

Quadrangle name Lineboro

Quadrangle scale 1:24000

UTM References do NOT complete UTM references

A	<input type="text"/>	<input type="text"/>	<input type="text"/>
	Zone	Easting	Northing
C	<input type="text"/>	<input type="text"/>	<input type="text"/>
E	<input type="text"/>	<input type="text"/>	<input type="text"/>
G	<input type="text"/>	<input type="text"/>	<input type="text"/>

B	<input type="text"/>	<input type="text"/>	<input type="text"/>
	Zone	Easting	Northing
D	<input type="text"/>	<input type="text"/>	<input type="text"/>
F	<input type="text"/>	<input type="text"/>	<input type="text"/>
H	<input type="text"/>	<input type="text"/>	<input type="text"/>

Verbal boundary description and justification

List all states and counties for properties overlapping state or county boundaries

state	code	county	code

# 11. Form Prepared By

name/title Kenneth M. Short, Historic Planner

organization Carroll County Department of Planning date July 8, 1992

street & number 225 North Center Street telephone (410) 857-2145

city or town Westminster state Maryland

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to: Maryland Historical Trust  
Shaw House  
21 State Circle  
Annapolis, Maryland 21401  
(301) 269-2438

MARYLAND HISTORICAL TRUST  
DHCP/DHCD  
100 COMMUNITY PLACE  
CROWNSVILLE, MD 21032-2023  
514-7600

CAK. 1149  
4864 Schalk Road #1

CHAIN OF TITLE

GRANTOR	HOME COUNTY	GRANTEE	HOME COUNTY	DATE	LIBER	FOLIO	TRANS ACTION	COMMENTS
Ralph & Hannah Laughman	Carroll	Wayne & Catherine Miller	?	12-28-1985	LWS 930	378	Deed fee simple	\$75,000 67+ a.
Aaron & Anna Werner	York	Ralph & Hannah Laughman	?	4-1-1941	LDM 175	205	Deed fee simple	\$1,500 67 a. + 1st tract in 159-144
George B. Werner, exec. of John S. Werner	Carroll	Aaron & Anna Werner	?	8-19-1933	EMM 159	144	Deed fee simple	\$1,275, sold 1 April 1933
Amanda Werner (wife of John S. Werner) & Rebecca Garvick (widow of Jacob Garvick)	Carroll Woodberry, Baltimore City	John S. Werner	Carroll	5-26-1902	JHB 95	493	Deed fee simple	\$2,000 67 a. & 7 a. Garvick holds mortgage 4 January 1890 WNM29-44  refers to 2 deeds
Barbara Bowser et al heirs of Benjamin Bowser dec. intestate	All over creation Carroll County	Samuel & Amanda Garvick (Sam dec., Amanda m. John S. Werner)	?	8-20-1895	BFC 81	390	Deed	67 a. \$2,000 48 a.  (a)
Peter Lucabaugh & wife Sarah		Samuel Garvick		4-4-1883	WNM 70	425	Deed fee simple	7 a. \$250.00 no earlier deed ref. (b)
John Fair & wife Rebecca	Carroll	Benjamin Bowser	Carroll	3-28-1856	GEW 26	331	Deed	\$3,100 136 a. refers to 3 deeds (a)
Joseph Myers & wife Maria	Carroll	John Fair, Jr.	Carroll	4-1-1837	WW 1	276	Indenture of Conveyance	\$2,500 63+ a., 6 a.  (1)
George D. Klinefelter & wife Elizabeth	Carroll	John Fair, Jr.	Carroll	8-8-1848	JS 9	404	Deed	\$50 2 a. part of Bite the Biter no earlier deed ref. (2)

CAK-1149



GRANTOR	HOME COUNTY	GRANTEE	HOME COUNTY	DATE	LIBER	FOLIO	TRANS ACTION	COMMENTS
Henry Fair, exec. George Fair	Carroll	John Fair, Jr.	Carroll	4-6-1849	JS 9	405	Deed of Indenture	will dated 21 Oct. 1843, \$337 Sugar Valley, 65 a., gave public notice. This was highest bid. (3)
Thomas Sater, Michael Miller & William Pepple		Joseph Myers		2-18-1828	Balto. County WG 193	542		(1)

2/2

# 4864 Schalk Rd #1 CARR-1149 Site Plan

Carr  
Carr  
Carr

FILED BY **KMS**  
DATE **4 May 1993**

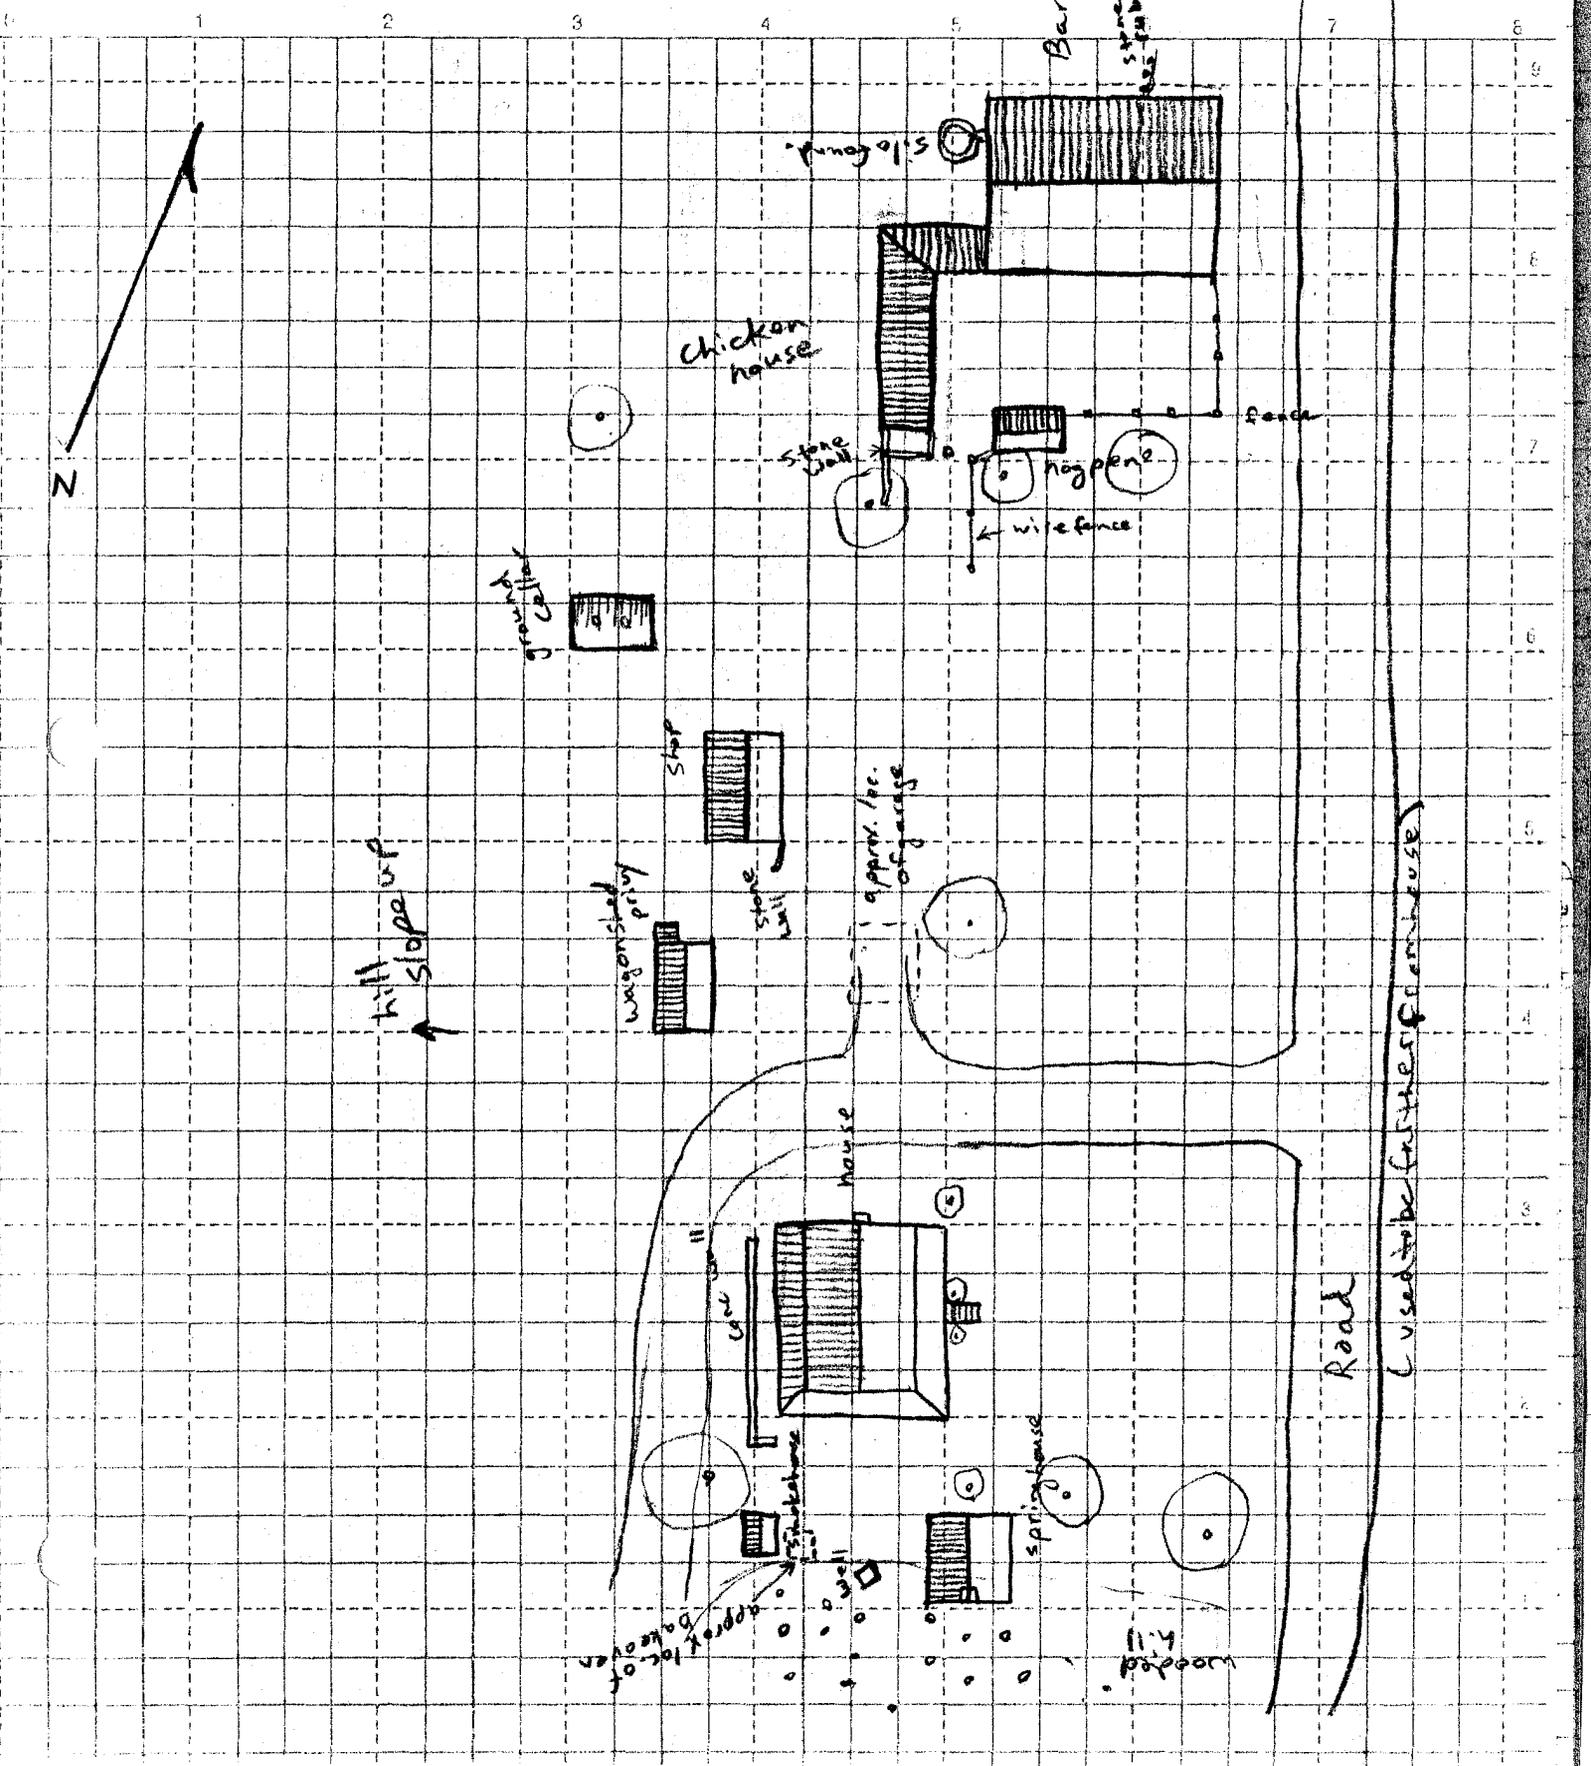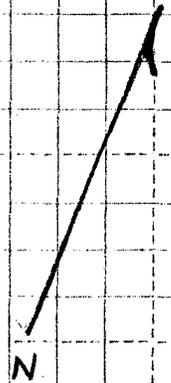

hill slope up

water grade

wagon shed

shed

stone wall

chicken house

stone wall

appr. loc. of garage

spring house

wooded

Barn

spring

Road

used to be further from house


hog pen

wire fence

fence

silage

spring

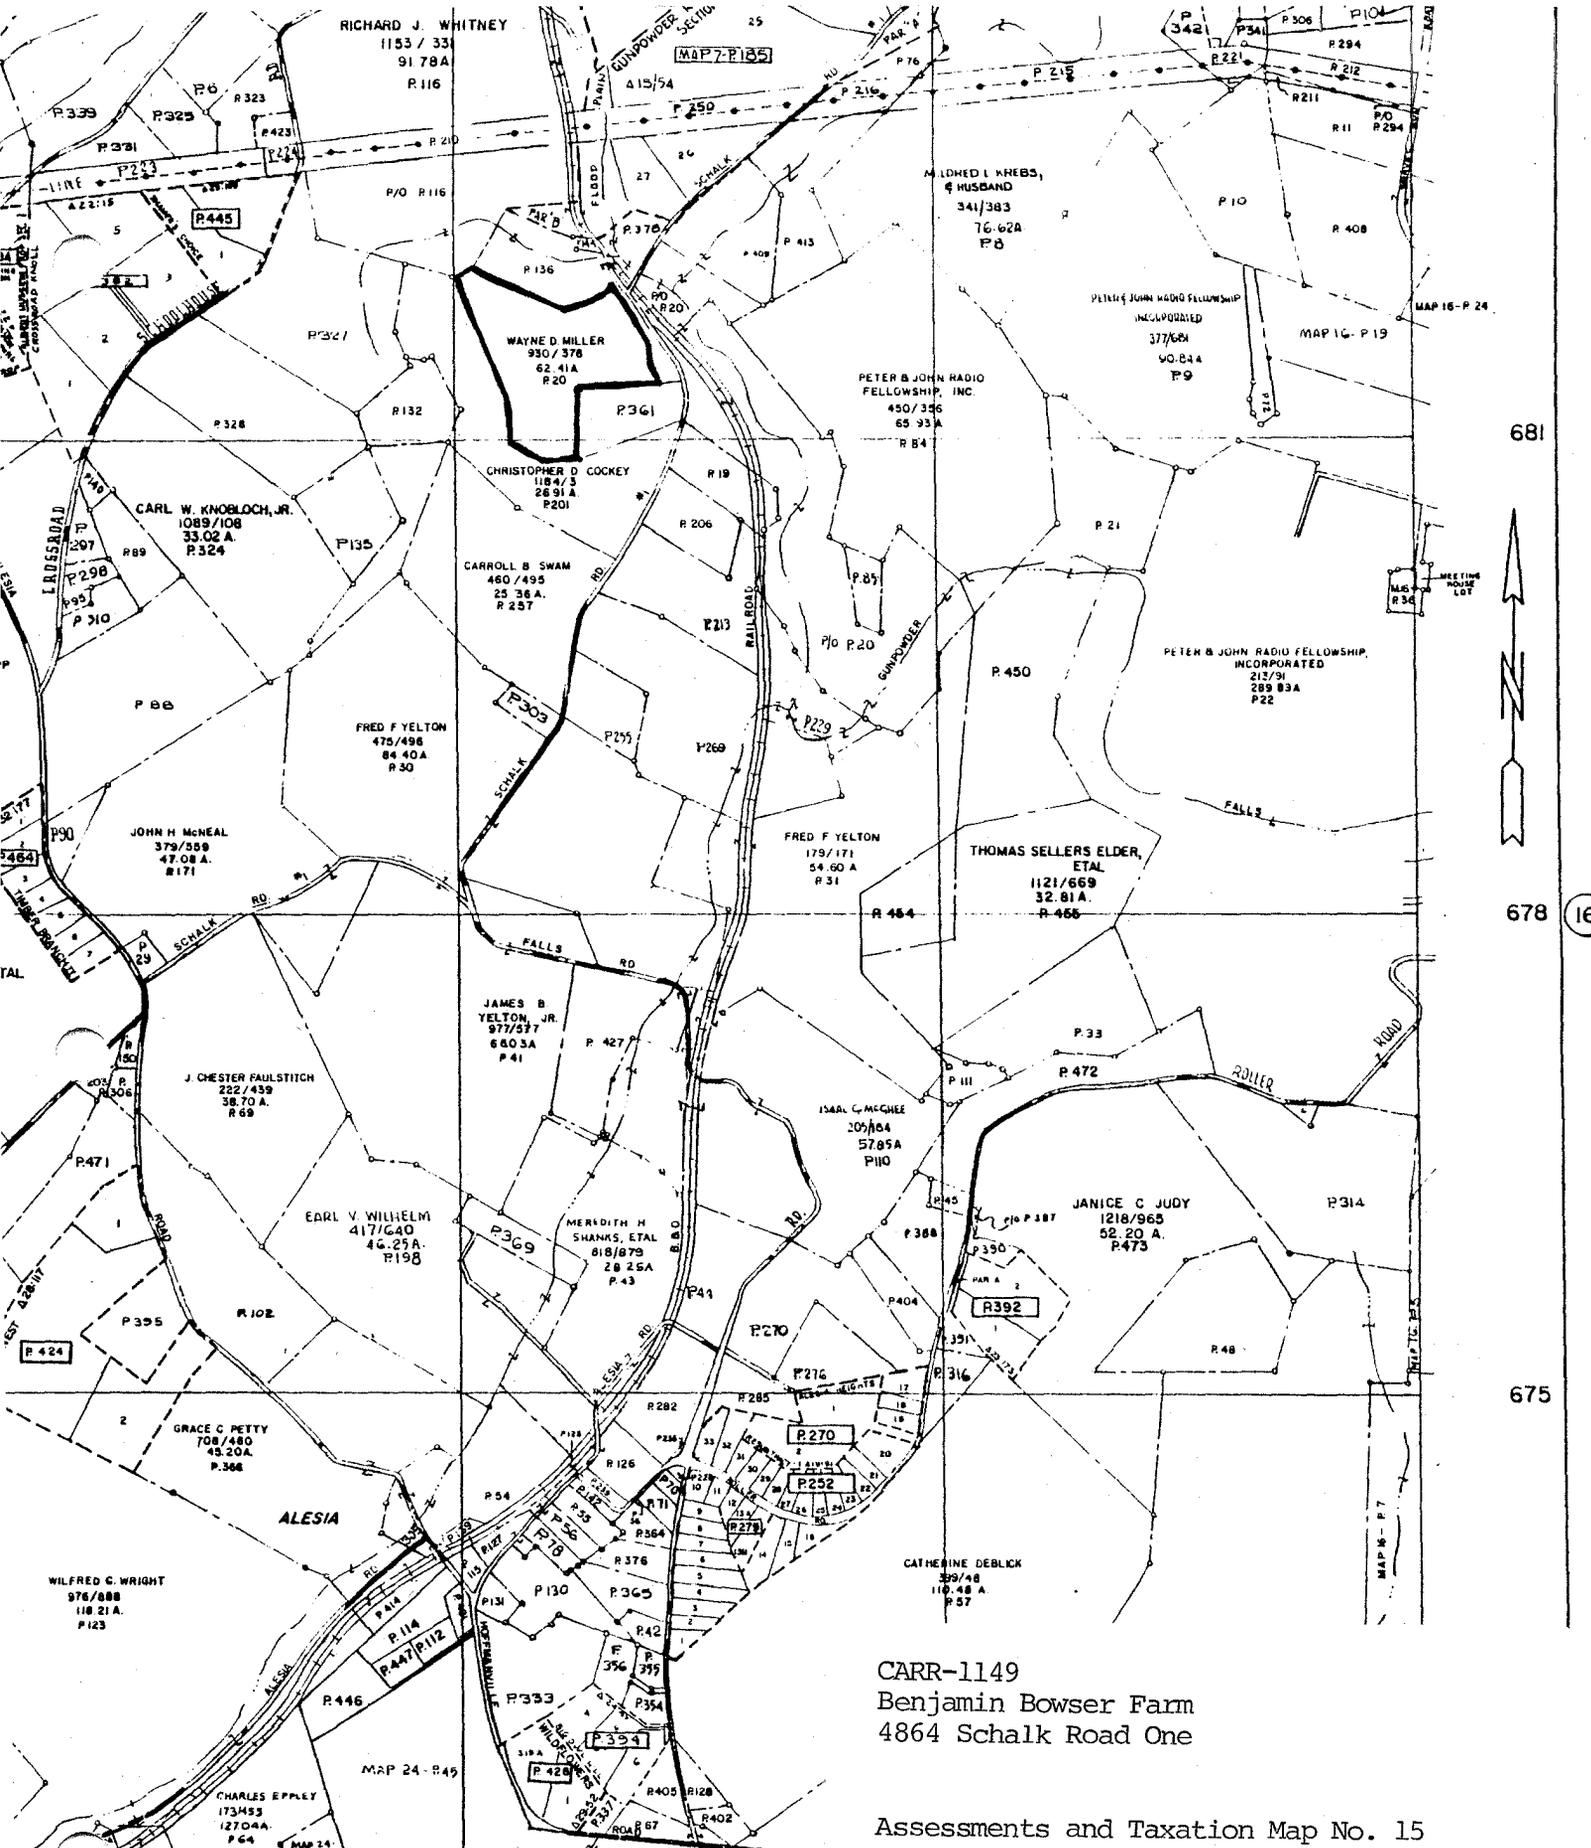


CARR-1149  
 Benjamin Bowser Farm  
 4864 Schalk Road One

Assessments and Taxation Map No. 15

COMPILED BY <b>DEPT. OF ASSESSMENTS &amp; TAXATION</b> <b>PROPERTY MAP DIVISION</b>		PROPERTY LINE SUB-DIVISION BOUNDARY CONTINUING OWNERSHIP - ZIE-Z-#-Z-#			SCALE IN FEET 4164846 ME 	<b>MAP NO.</b> <b>15</b>
THE INFORMATION SHOWN HEREON HAS BEEN COMPILED FROM DEED DESCRIPTIONS AND IS NOT AN ACTUAL SURVEY. IT SHOULD NOT BE USED FOR LEGAL DESCRIPTION. USERS NOTING ERRORS ARE URGED TO NOTIFY THE ABOVE AGENCY.		PARCEL NUMBER - P. 348 (ASSIGNED TO IDENTIFY AND INDEX OWNERSHIP)				
REVISED TO JUNE, 1991	DRAWN LIPER 1274	BY M.M.M.	LAST P. NO. 473	PHOTO	U.S.G.S. QUAD.	854



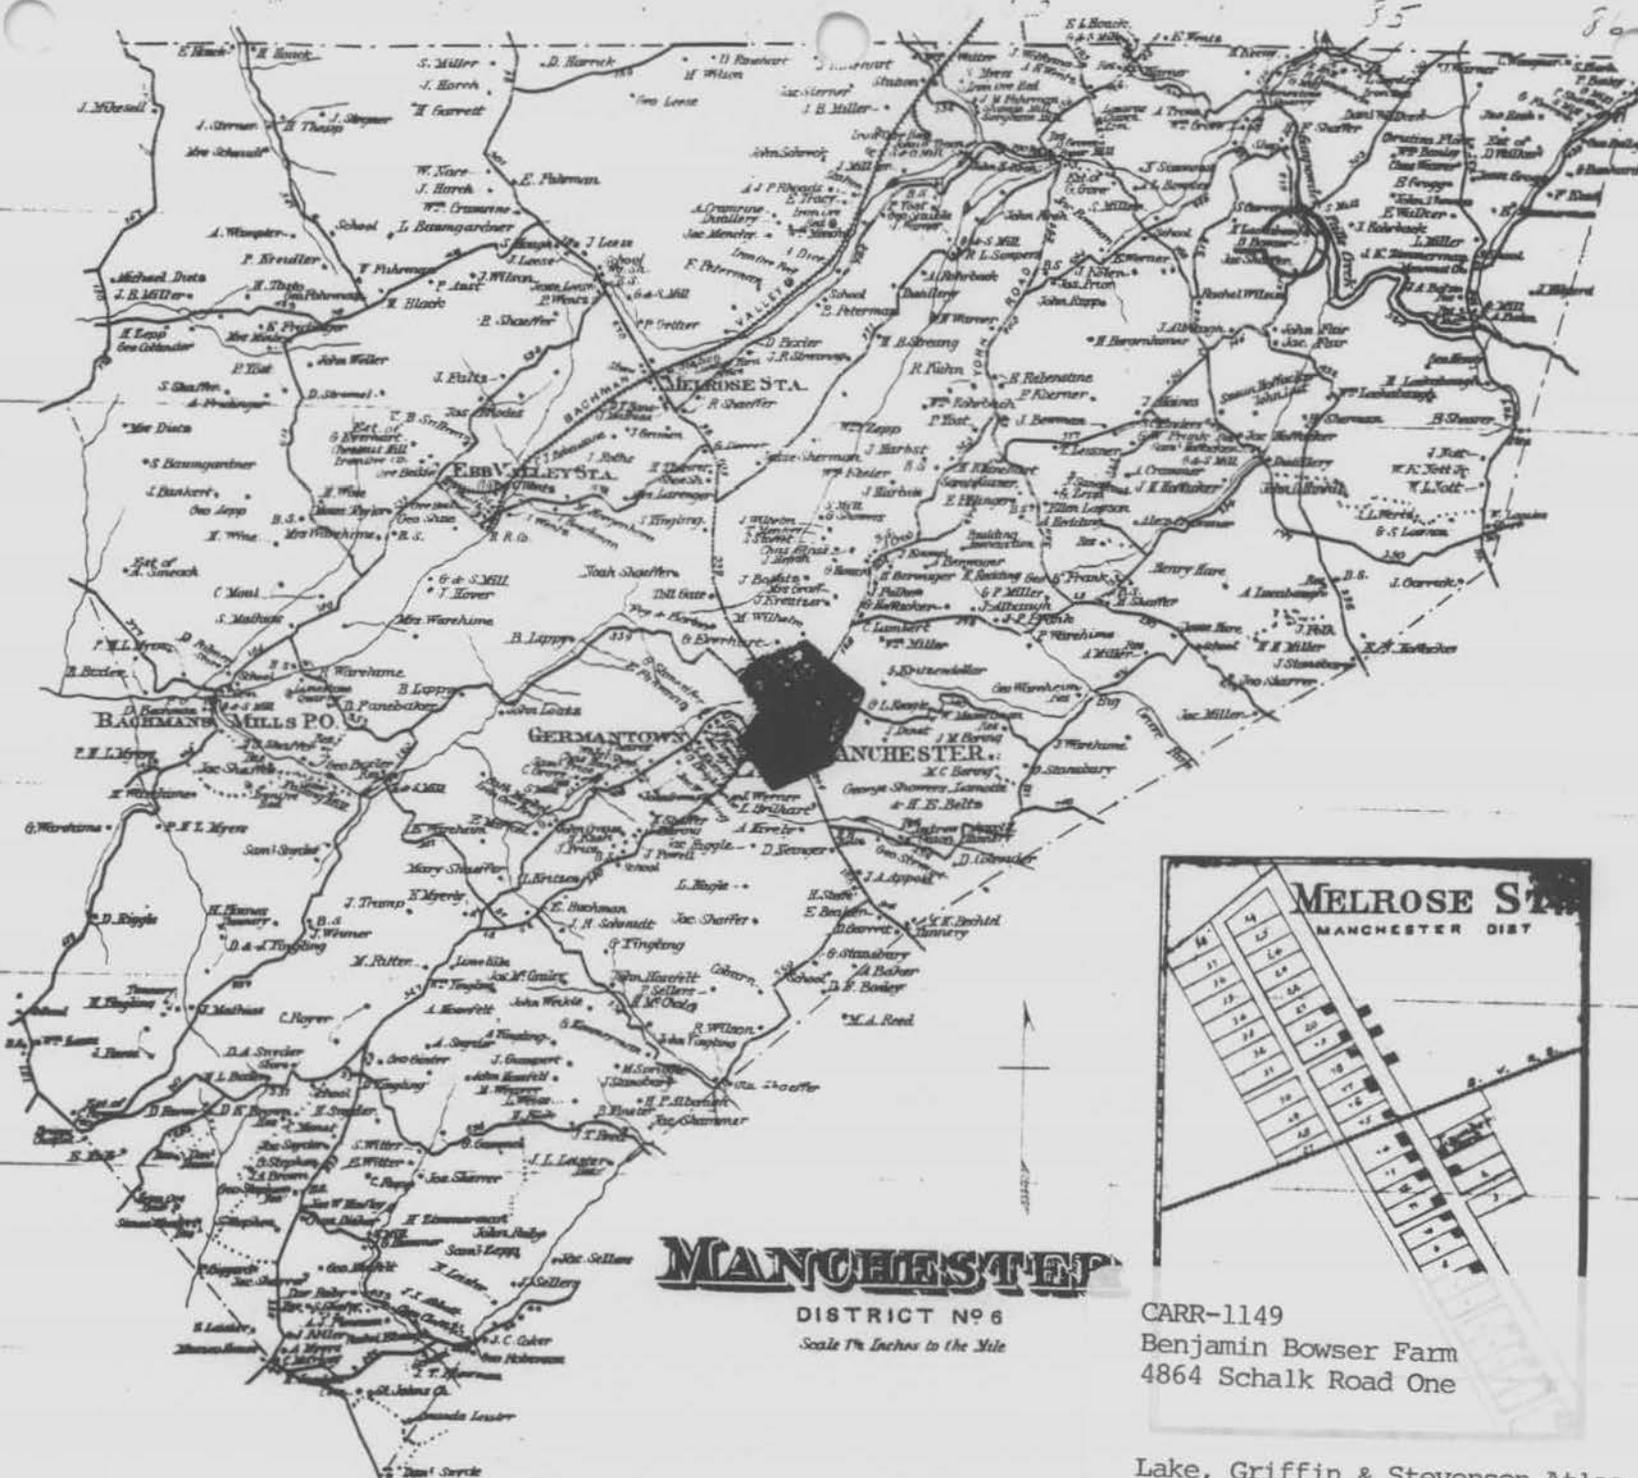


# MANCHESTER

DISTRICT NO 6  
Scale 1/4 Inches to the Mile



CARR-1149  
Benjamin Bowser Farm  
4864 Schalk Road One

Lake, Griffin & Stevenson Atlas, 1877

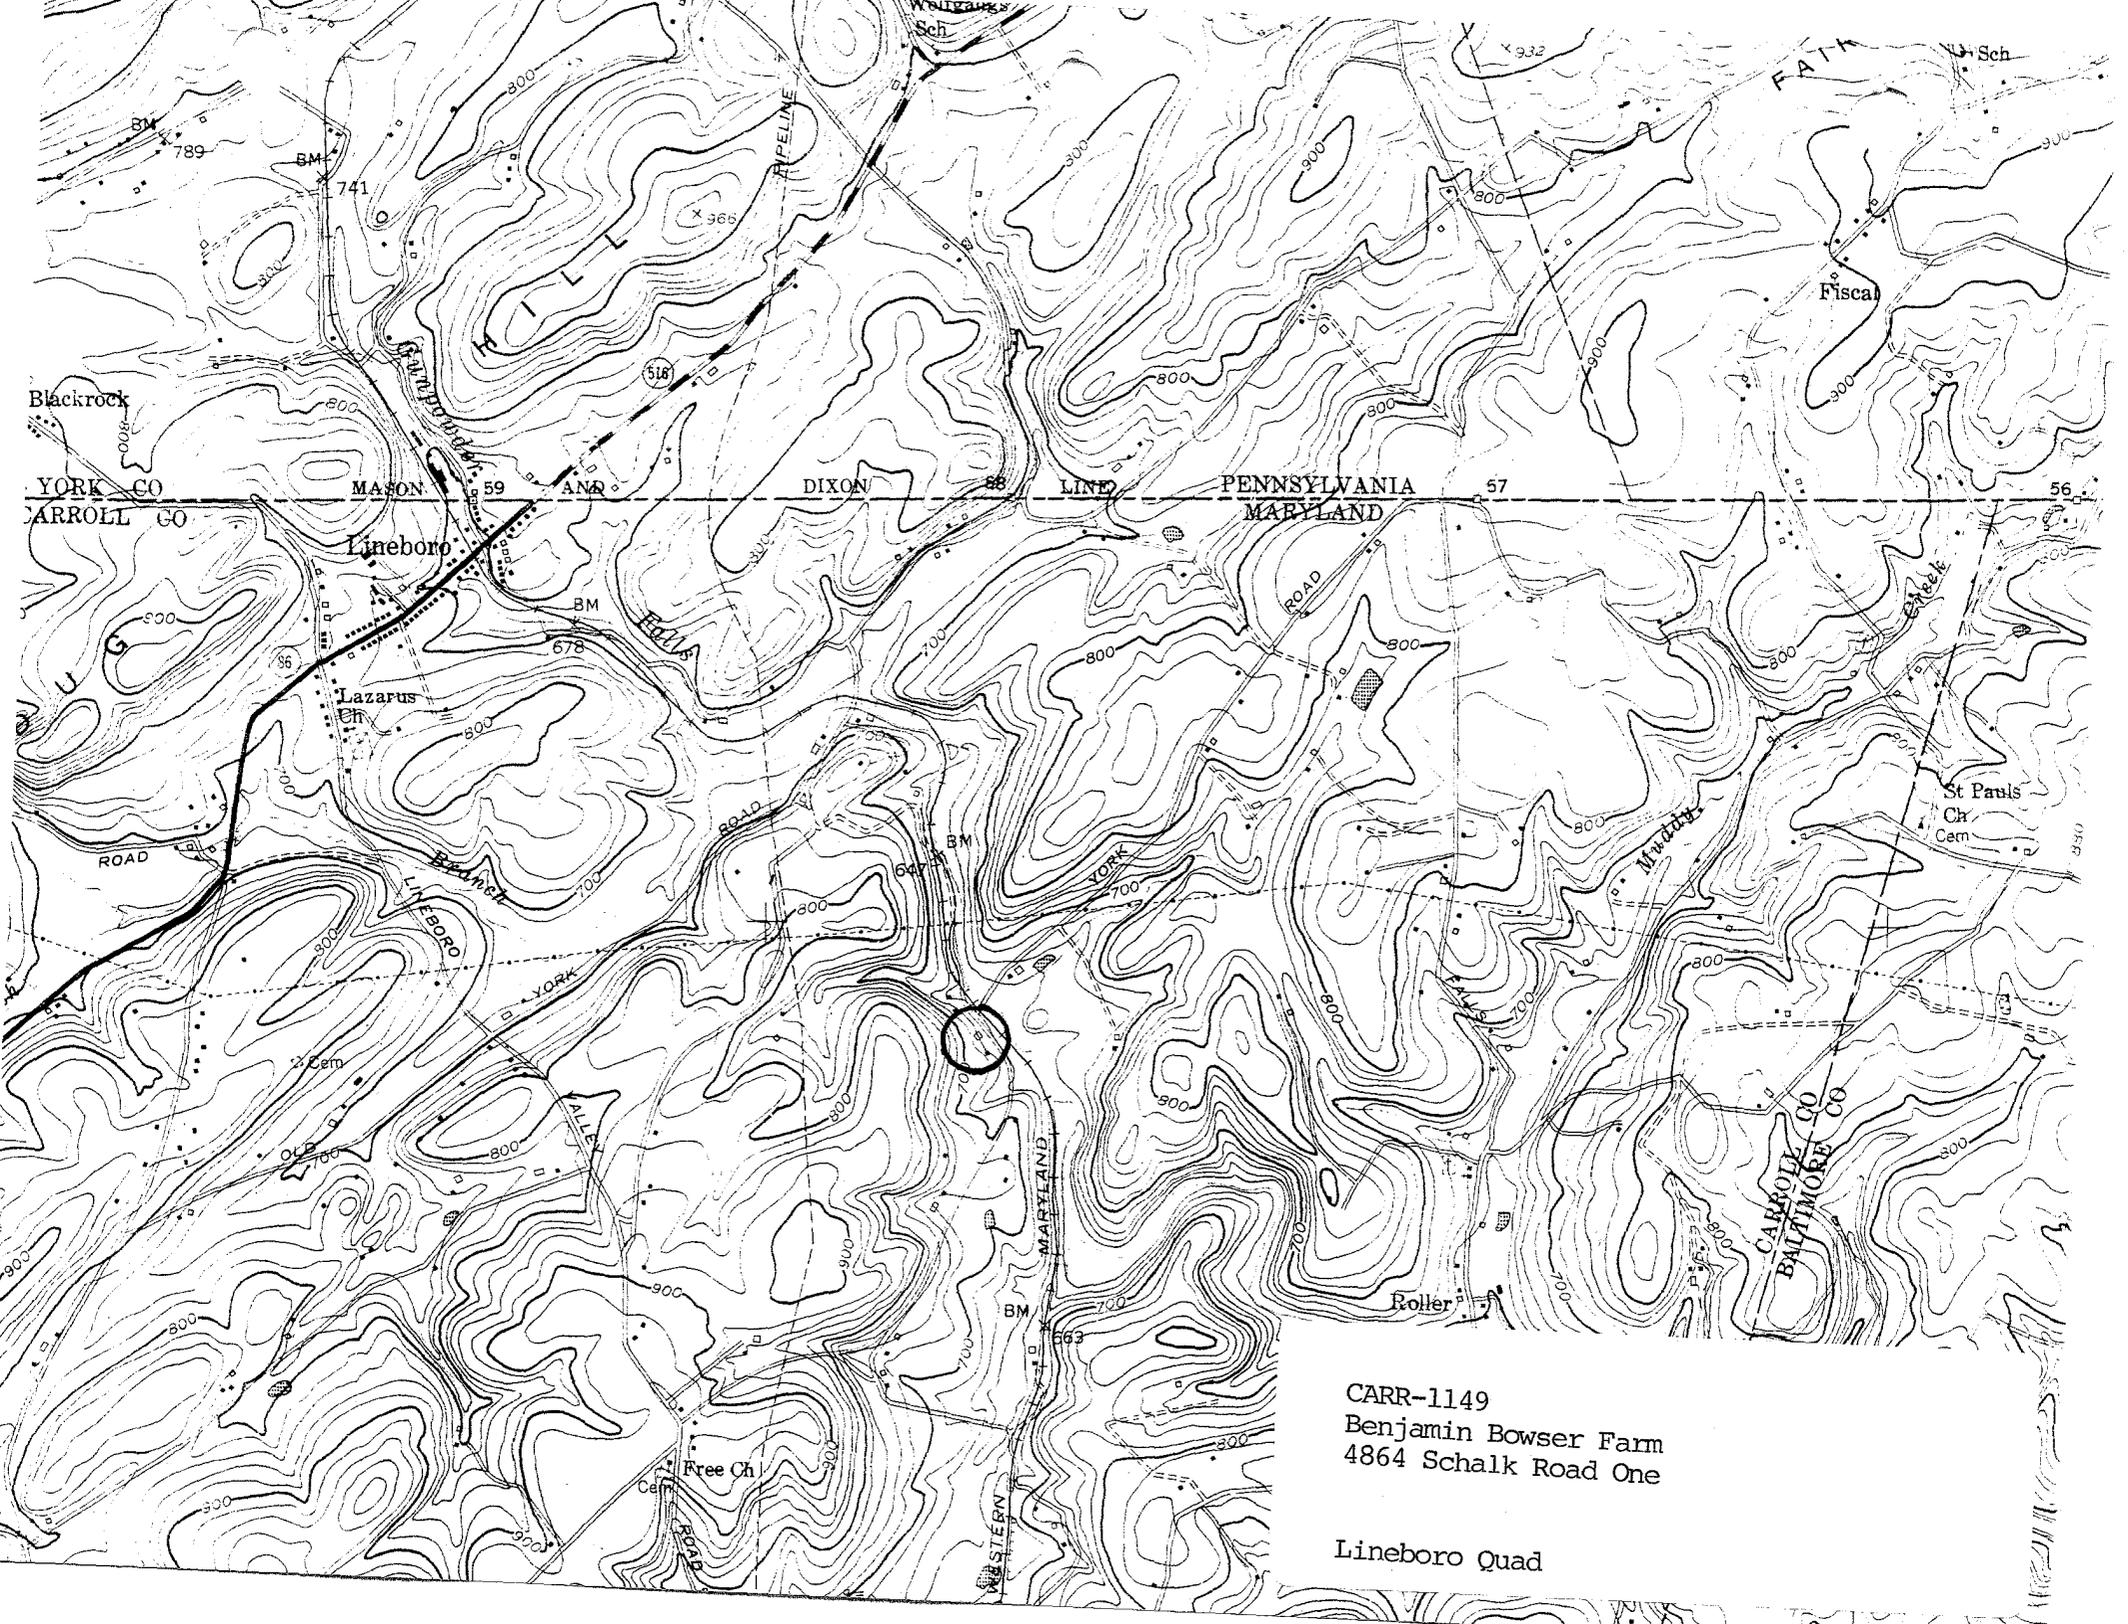

CARR-1149  
Benjamin Bowser Farm  
4864 Schalk Road One

Lineboro Quad



CARR-1149

Benjamin Bouser Farm

4864 Schaik Rd. One

Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. Loc.: Maryland Historical Trust  
House - east: north elevs.

1/11



Benjamin Bowser Farm  
4864 Schalk Rd. One  
Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. Loc.: Maryland Historical Trust  
House - south elev.

2/11



Benjamin Bowser Farm  
4864 Schalk Rd. One  
Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. Loc.: Maryland Historical Trust  
Smokehouse - east: north elevs.

5/11



Benjamin Bowser Farm

4864 Schaik Rd. One

Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. Loc.: Maryland Historical Trust  
Springhouse / Summer Kitchen - east: north elevs.

4/11



Benjamin Bowser Farm

4804 Schalk Rd. One

Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. Loc.: Maryland Historical Trust

Springhouse (summer kitchen - north & west elevs.)

5/11



Benjamin Bowser Farm

4864 Schaik Rd. One

Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. loc.: Maryland Historical Trust

Shed: privy - east: north elevs.

6/11



Benjamin Bowser Farm

4844 Schaik Rd. One

Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. loc.: Maryland Historical Trust  
shop - south: east elevs.

7/11



CARR-1149

Benjamin Bowser Farm  
4864 Schalk Rd. One  
Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. Loc.: Maryland Historical Trust

Barn - South: east elevs.

8/11



CARR-1149

Benjamin Bowser Farm

4864 Schaik Rd. One

Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. Loc.: Maryland Historical Trust

Hog pen, poultry house, : barnyard - vw. from east

9/11



Benjamin Bowser Farm

4864 Schalk Rd. One

Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. loc.: Maryland Historical Trust

Poultry house - South: east elevs.

10/11



Benjamin Bawser Farm  
4864 Schaik Rd. One  
Carroll County, Maryland

Photo: Kenneth M. Short

Date: April 1992

Neg. loc.: Maryland Historical Trust  
corn crib - south: east elevs.

1/11