

CARR-1460
McGee Farm
Carrollton (vicinity)

Summary:

The use of a "Pennsylvania Farmhouse" plan and an original four-bay porch on the log house of the McGee Farm suggest that it was most likely built between c. 1830-1865. The four-panel doors, if original, argue for a late date, after 1860. These doors, of course, could not be examined, so cannot be considered conclusive. It seems to have been owned by the McGee family for much of the second half of the nineteenth century, and is typical of a small family farm in Carroll County. The house has suffered from vandalism and neglect and deserves more thorough investigation before it disappears, but the owner will not permit this. The barn, which sits well back from the road, appears to be in better condition and should also be documented.

Maryland Historical Trust State Historic Sites Inventory Form

MARYLAND INVENTORY OF
HISTORIC PROPERTIES

Magi No.

DOE yes no

1. Name (indicate preferred name)

historic McGee Farm

and/or common

2. Location

street & number Reese Road

 not for publication

city, town Carrollton

 vicinity of

congressional district

state Maryland

county Carroll

3. Classification

Category

district
 building(s)
 structure
 site
 object

Ownership

public
 private
 both
Public Acquisition
 in process
 being considered
 not applicable

Status

occupied
 unoccupied
 work in progress
Accessible
 yes: restricted
 yes: unrestricted
 no

Present Use

agriculture
 commercial
 educational
 entertainment
 government
 industrial
 military
 museum
 park
 private residence
 religious
 scientific
 transportation
 other: vacant

4. Owner of Property (give names and mailing addresses of all owners)

name M. Sterling Long

street & number Reese Road

telephone no.:

city, town

state and zip code

5. Location of Legal Description

courthouse, registry of deeds, etc. Courthouse Annex

liber 177

street & number 55 North Court Street

folio 173

city, town Westminster

state MD

6. Representation in Existing Historical Surveys

title

date

 federal state county local

depository for survey records

city, town

state

7. Description

Survey No. CARR-1460

Condition		Check one	Check one	
<input type="checkbox"/> excellent	<input checked="" type="checkbox"/> deteriorated	<input checked="" type="checkbox"/> unaltered	<input checked="" type="checkbox"/> original site	
<input type="checkbox"/> good	<input type="checkbox"/> ruins	<input type="checkbox"/> altered	<input type="checkbox"/> moved	date of move _____
<input type="checkbox"/> fair	<input type="checkbox"/> unexposed			

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

Summary:

The Magee Farm is located on the east side of Reese Road, approximately 1 mile north of Reese. The house is located about 100 feet north of a small stream. The site slopes generally from north to south toward the stream and consists of a log house, a frame bank barn, a frame shed that may be a hog pen, and a frame smokehouse. The house is a two-story, four-bay by one-bay, V-notched-corner log structure. It formerly had a gable roof with a north-south ridge, but the building has suffered from a fire, and the roof has collapsed. The west elevation on the first story has rough-casting. There are two central four-panel doors, and a window opening on either side of them. There was a one-story, four-bay porch on this elevation. The second story of the west elevation has vertical nailers with some clapboard attached. The property is vacant, and the house has suffered from several set fires. The owner is elderly and will not permit access to the buildings.

Contributing Resources: 2

The Magee Farm is located on the east side of Reese Road, approximately 1 mile north of Reese and approximately $\frac{3}{4}$ of a mile southwest of Carrollton. The house is located about 100 feet north of a small stream. The site slopes generally from north to south toward the stream and consists of a log house, a frame bank barn, a frame shed that may be a hog pen, and a frame smokehouse. The house is a two-story, four-bay by one-bay, V-notched-corner log structure. It formerly had a gable roof with a north-south ridge and standing-seam metal, but the building has suffered from a fire, and the roof has collapsed into the building. The west elevation on the first story has rough-casting on vertical lath that appears to be riven. There are two central four-panel doors, and a window opening on either side of them. There was a one-story, four-bay porch on this elevation, as there are four mortises in one of the logs for the porch joists. The log with the mortises is set above the rough-casting. There is no siding, whitewash or rough-casting on the logs where the porch roof covered them. This feature, in conjunction with the mortises in the log, suggest that the porch was an original feature. The logs are notched on top and bottom to accept the joist ends of the second story. The second story of the west elevation has vertical nailers with some clapboard attached. There is a window opening in each end bay. One rafter foot appears to be notched and tapered to lap over the top log. There is an interior brick chimney on the north end, and the remains of a small interior brick chimney on the south end.

The north elevation has clapboard on vertical nailers and corner boards. There are no openings. The south elevation has vertical nailers and one central window opening on both the first and second stories. This opening is at least partially blocked by the brick chimney,

Description (continued)

Section 7 Page 2

which must be a later addition. The east elevation was not entirely accessible, but appears to have a window in the south bay and a door in the north bay on the first story. There is no evidence of an interior log wall partition.

About 10 to 15 feet east of the house is a large brick fireplace with a splayed-brick jack arch. The chimney is now gone. It is not possible to tell whether this was part of an addition to the rear of the log house or an entirely separate building.

About 50 feet north of the house is a frame structure that is probably a hog pen. It has vertical-board siding and a gable roof with a north-south ridge and inverted V-seam-metal roofing. There is an opening on the west elevation and no openings on the north elevation. A low wall runs east-west from the southwest corner. The building is quite overgrown.

About 20 feet south of the house is a smokehouse. It is a one-story, one-bay square clapboard structure with corner boards and a hip roof of standing-seam metal. It appears that the peak of the hip has a wood box. There is a door on the north elevation.

Approximately 150 feet northeast of the house is a bank barn with a south-facing forebay and a gable roof with a ridge that runs east-west. It has vertical boards on the upper story and appears to have battens on them, as well. The property is vacant, and the house has suffered from several set fires. The owner is elderly and will not permit access to the buildings because he sees no benefit in it for himself.

8. Significance


Period	Areas of Significance—Check and justify below			
<input type="checkbox"/> prehistoric	<input type="checkbox"/> archeology-prehistoric	<input type="checkbox"/> community planning	<input type="checkbox"/> landscape architecture	<input type="checkbox"/> religion
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> archeology-historic	<input type="checkbox"/> conservation	<input type="checkbox"/> law	<input type="checkbox"/> science
<input type="checkbox"/> 1500-1599	<input checked="" type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> literature	<input type="checkbox"/> sculpture
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> architecture	<input type="checkbox"/> education	<input type="checkbox"/> military	<input type="checkbox"/> social/
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> art	<input type="checkbox"/> engineering	<input type="checkbox"/> music	<input type="checkbox"/> humanitarian
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> commerce	<input type="checkbox"/> exploration/settlement	<input type="checkbox"/> philosophy	<input type="checkbox"/> theater
<input type="checkbox"/> 1900-	<input type="checkbox"/> communications	<input type="checkbox"/> industry	<input type="checkbox"/> politics/government	<input type="checkbox"/> transportation
		<input type="checkbox"/> invention		<input type="checkbox"/> other (specify)

Specific dates	Builder/Architect
check: Applicable Criteria: <input type="checkbox"/> A <input type="checkbox"/> B <input checked="" type="checkbox"/> C <input type="checkbox"/> D and/or	
Applicable Exception: <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G	
Level of Significance: <input type="checkbox"/> national <input type="checkbox"/> state <input checked="" type="checkbox"/> local	

Prepare both a summary paragraph of significance and a general statement of history and support.

Geographic Organization: Piedmont
 Chronological/Development Period: Agricultural-Industrial Transition A.D. 1815-1870;
 Industrial/Urban Dominance A.D. 1870-1930
 Historic Period Themes: Agriculture, Architecture
 Resource Types: Small family farm, Rural vernacular

The use of a "Pennsylvania Farmhouse" plan and an original four-bay porch on the log house of the McGee Farm suggest that it was most likely built between c. 1830-1865. The four-panel doors, if original, argue for a late date, after 1860. These doors, of course, could not be examined, so cannot be considered conclusive. It seems to have been owned by the McGee family for much of the second half of the nineteenth century, and is typical of a small family farm in Carroll County. The house has suffered from vandalism and neglect and deserves more thorough investigation before it disappears, but the owner will not permit this. The barn, which sits well back from the road, appears to be in better condition and should also be documented.

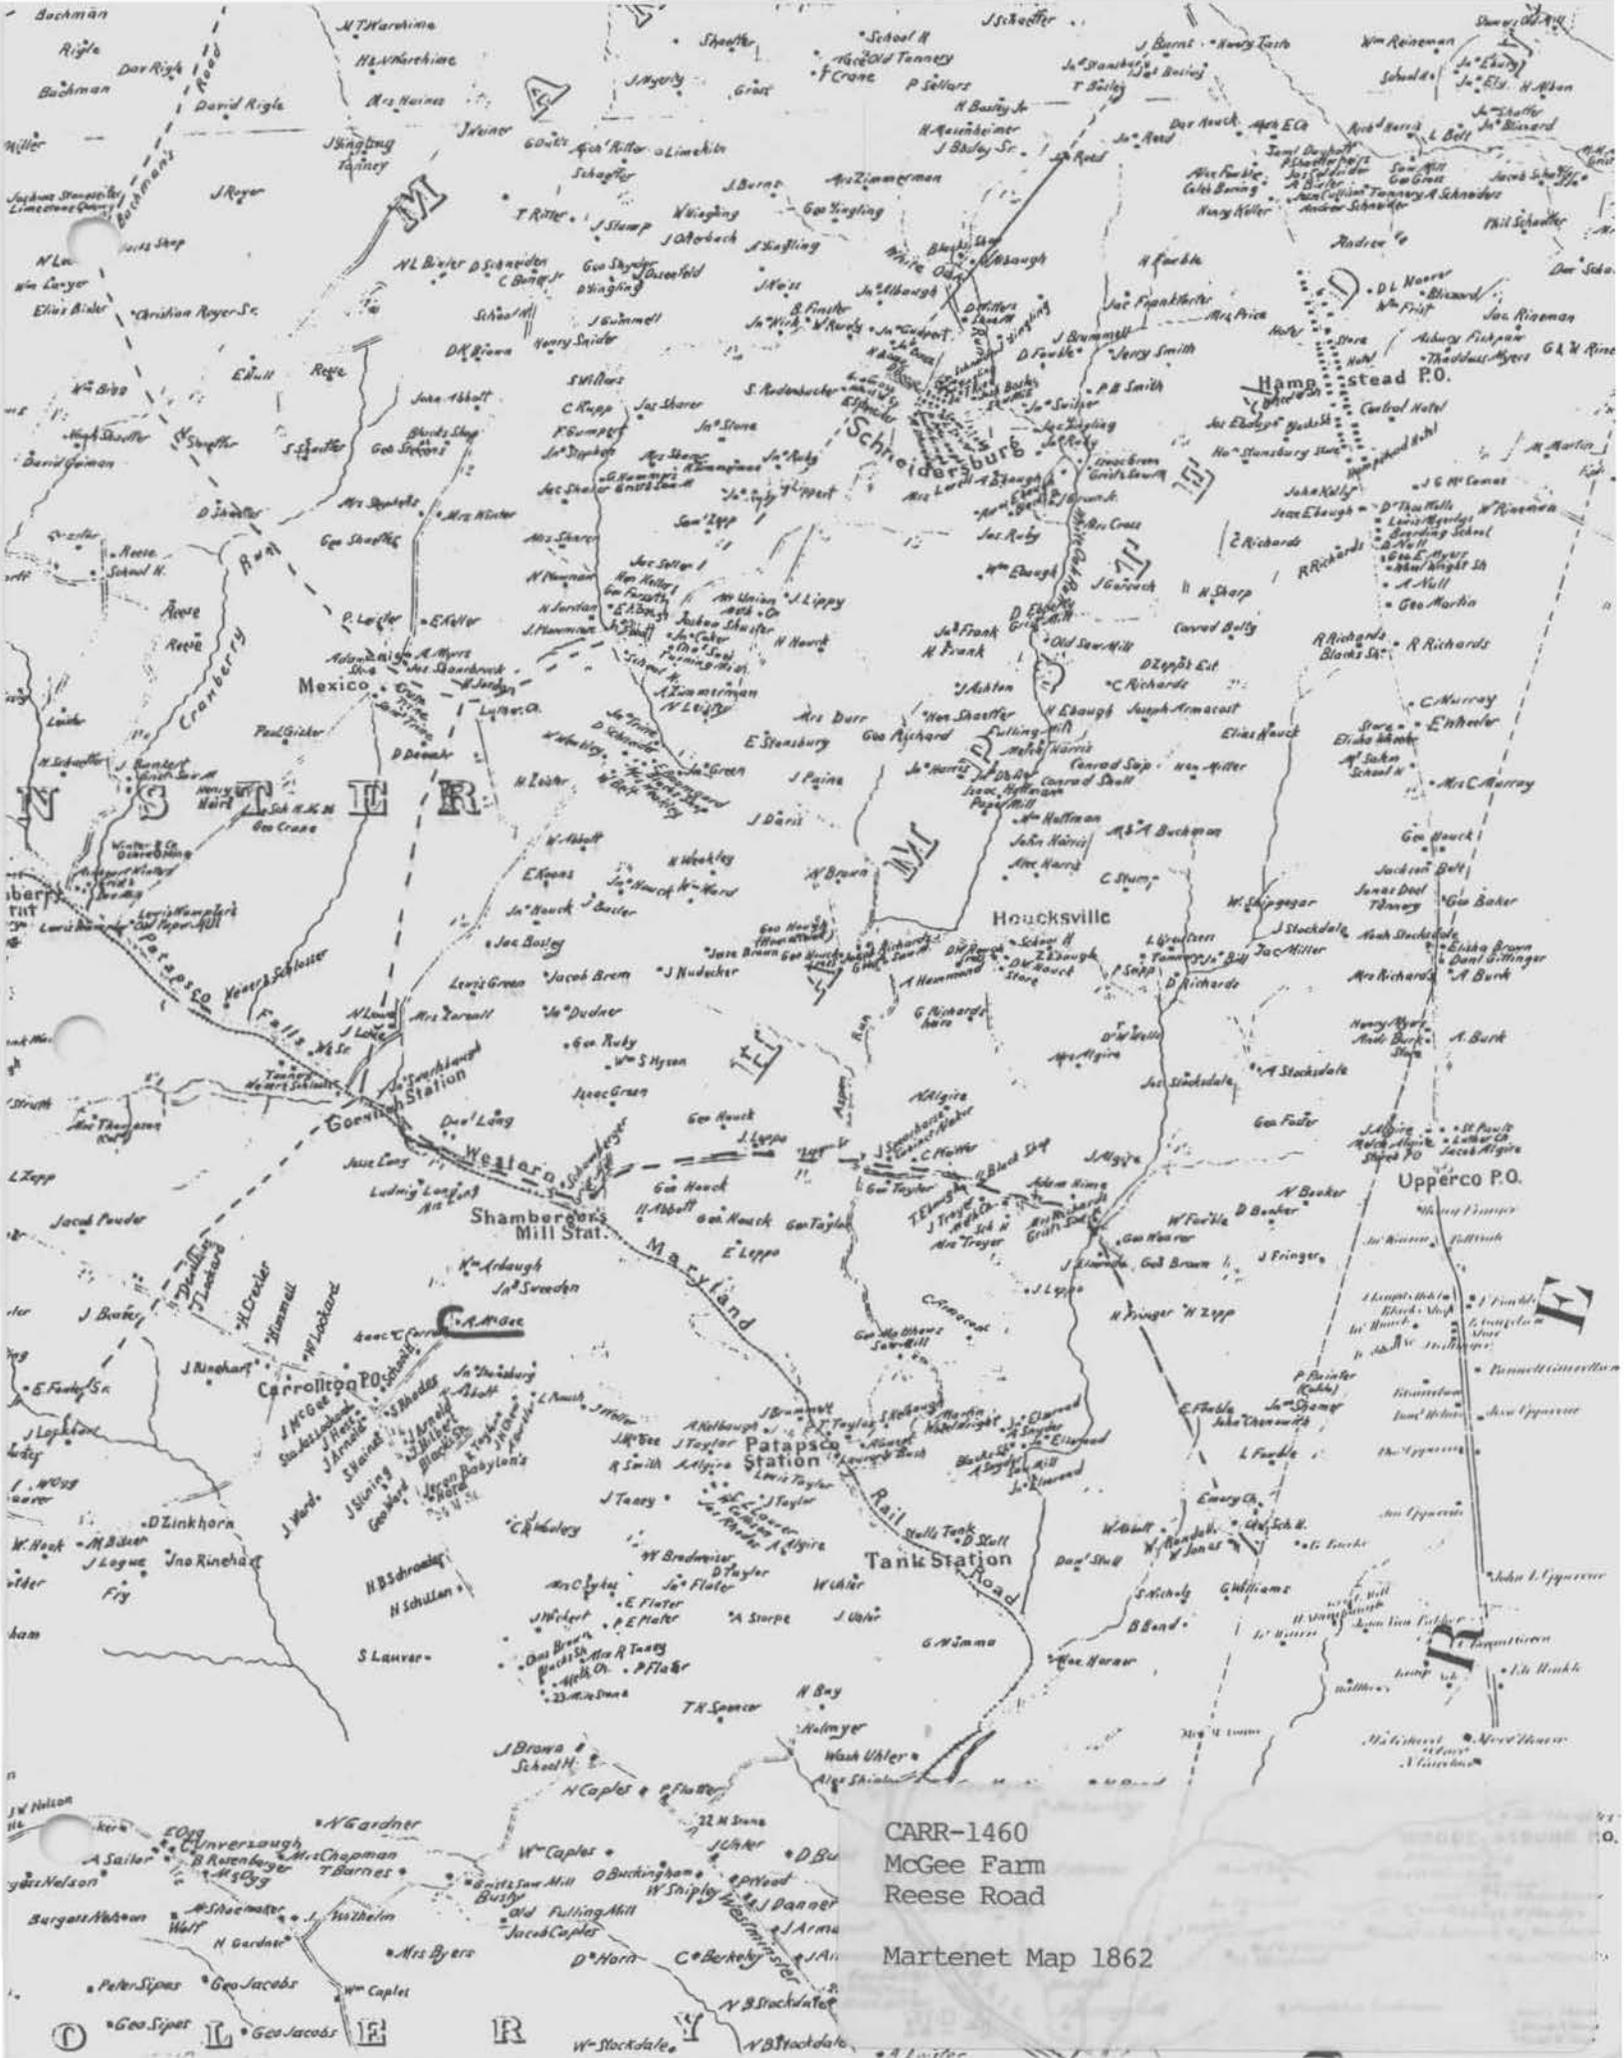

CARR-1460
McGee Farm
Reese Road


Martenet Map 1862

W. Stockdale
N. B. Stockdale
A. L. W. Lister

WOOLERY

DISTRICT No. 4.

Scale 4 inches to the Mile

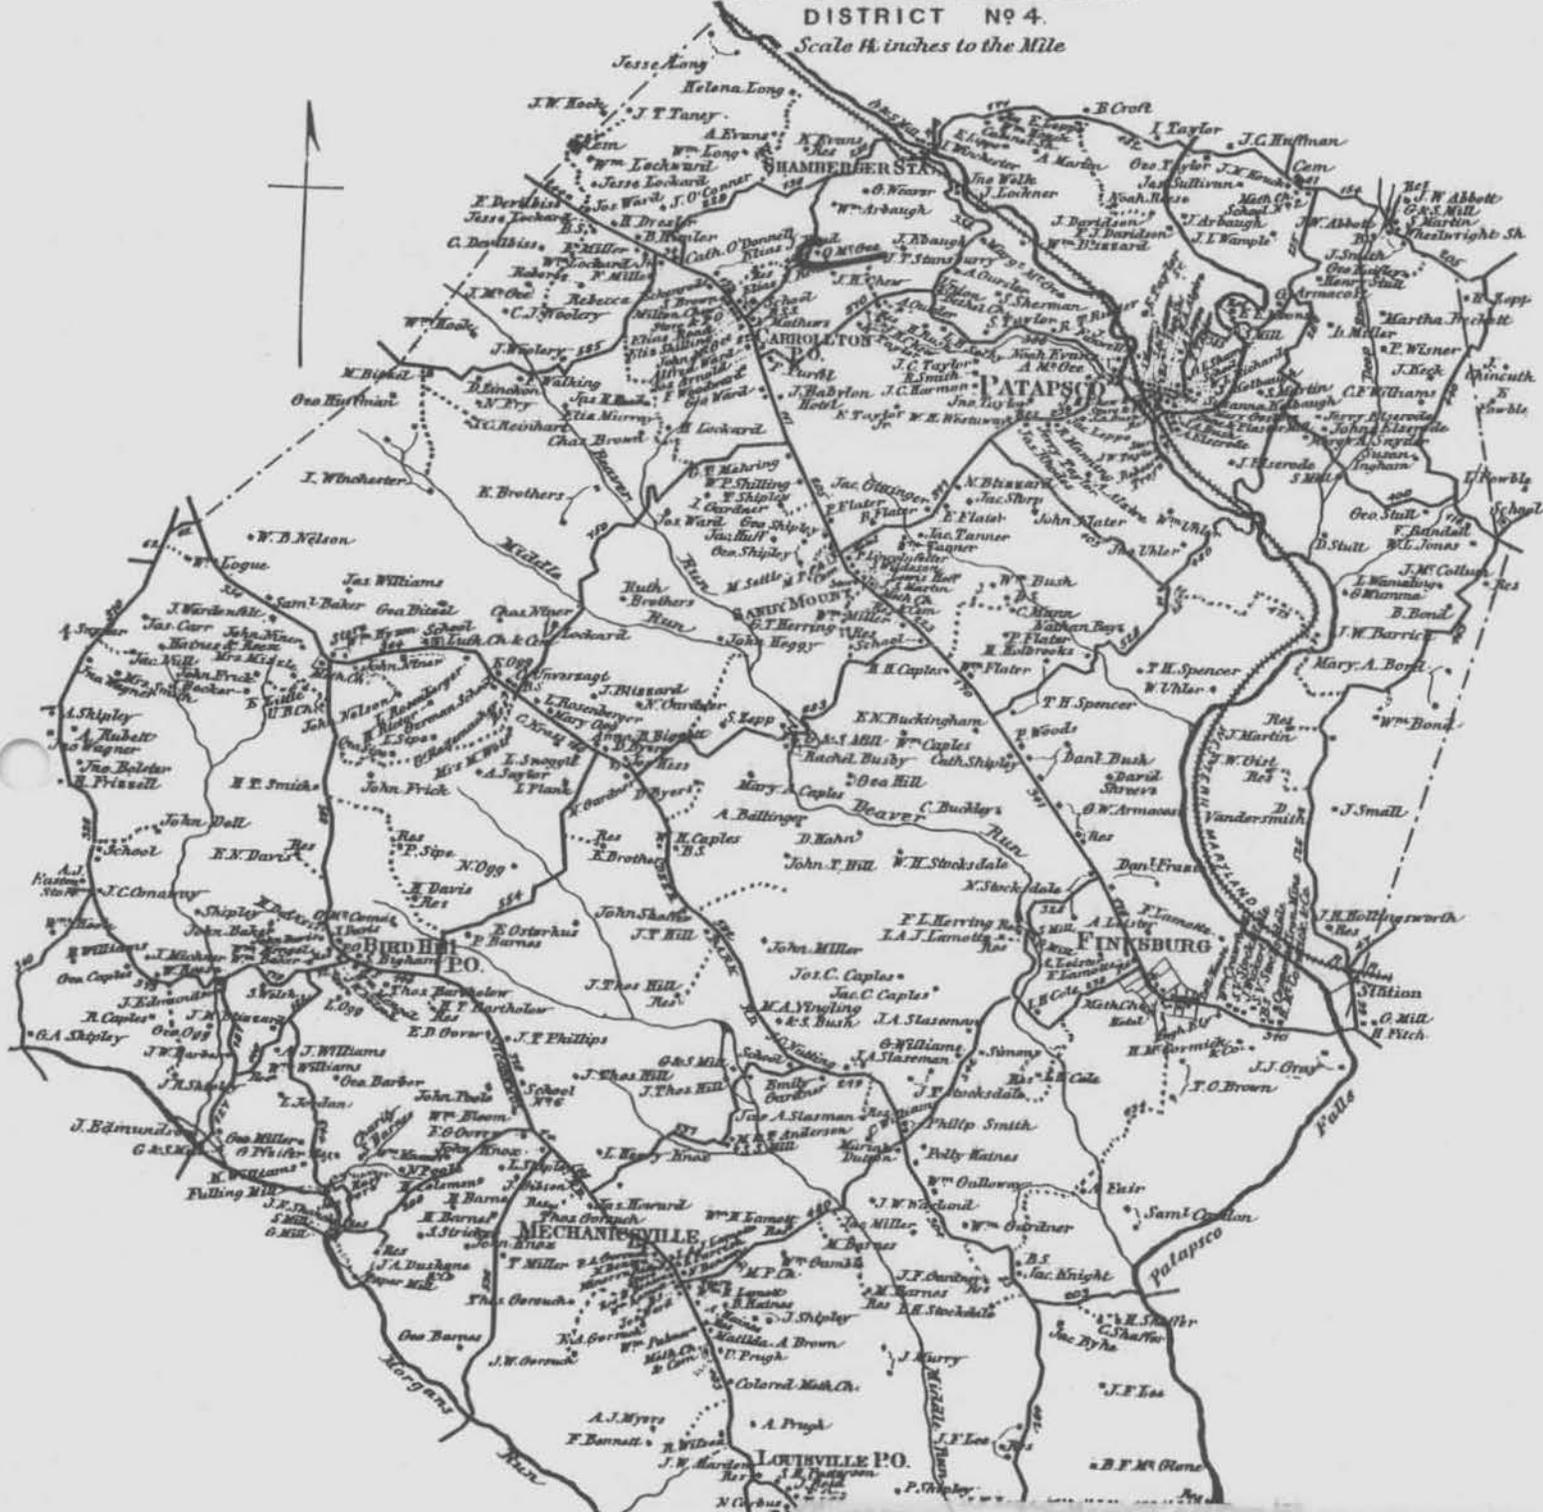

CARR-1460
McGee Farm
Reese Road

Lake, Griffin & Stevenson Atlas, 1877


WOOLERY'S

ELECTION DISTRICT NO. 4

GARROLL CO., MD.


EXPLANATION

- WATER
- RAILROAD
- STATE ROAD
- ROAD
- BRIDGE ON STREAM
- WELL
- POUND
- CHURCH
- METERY
- BOUNDARY ON VILLAGE BOUNDARY
- LAND NAME P. ACRES
- LANDS NAME (S. (ACRES) V. (ACRES))

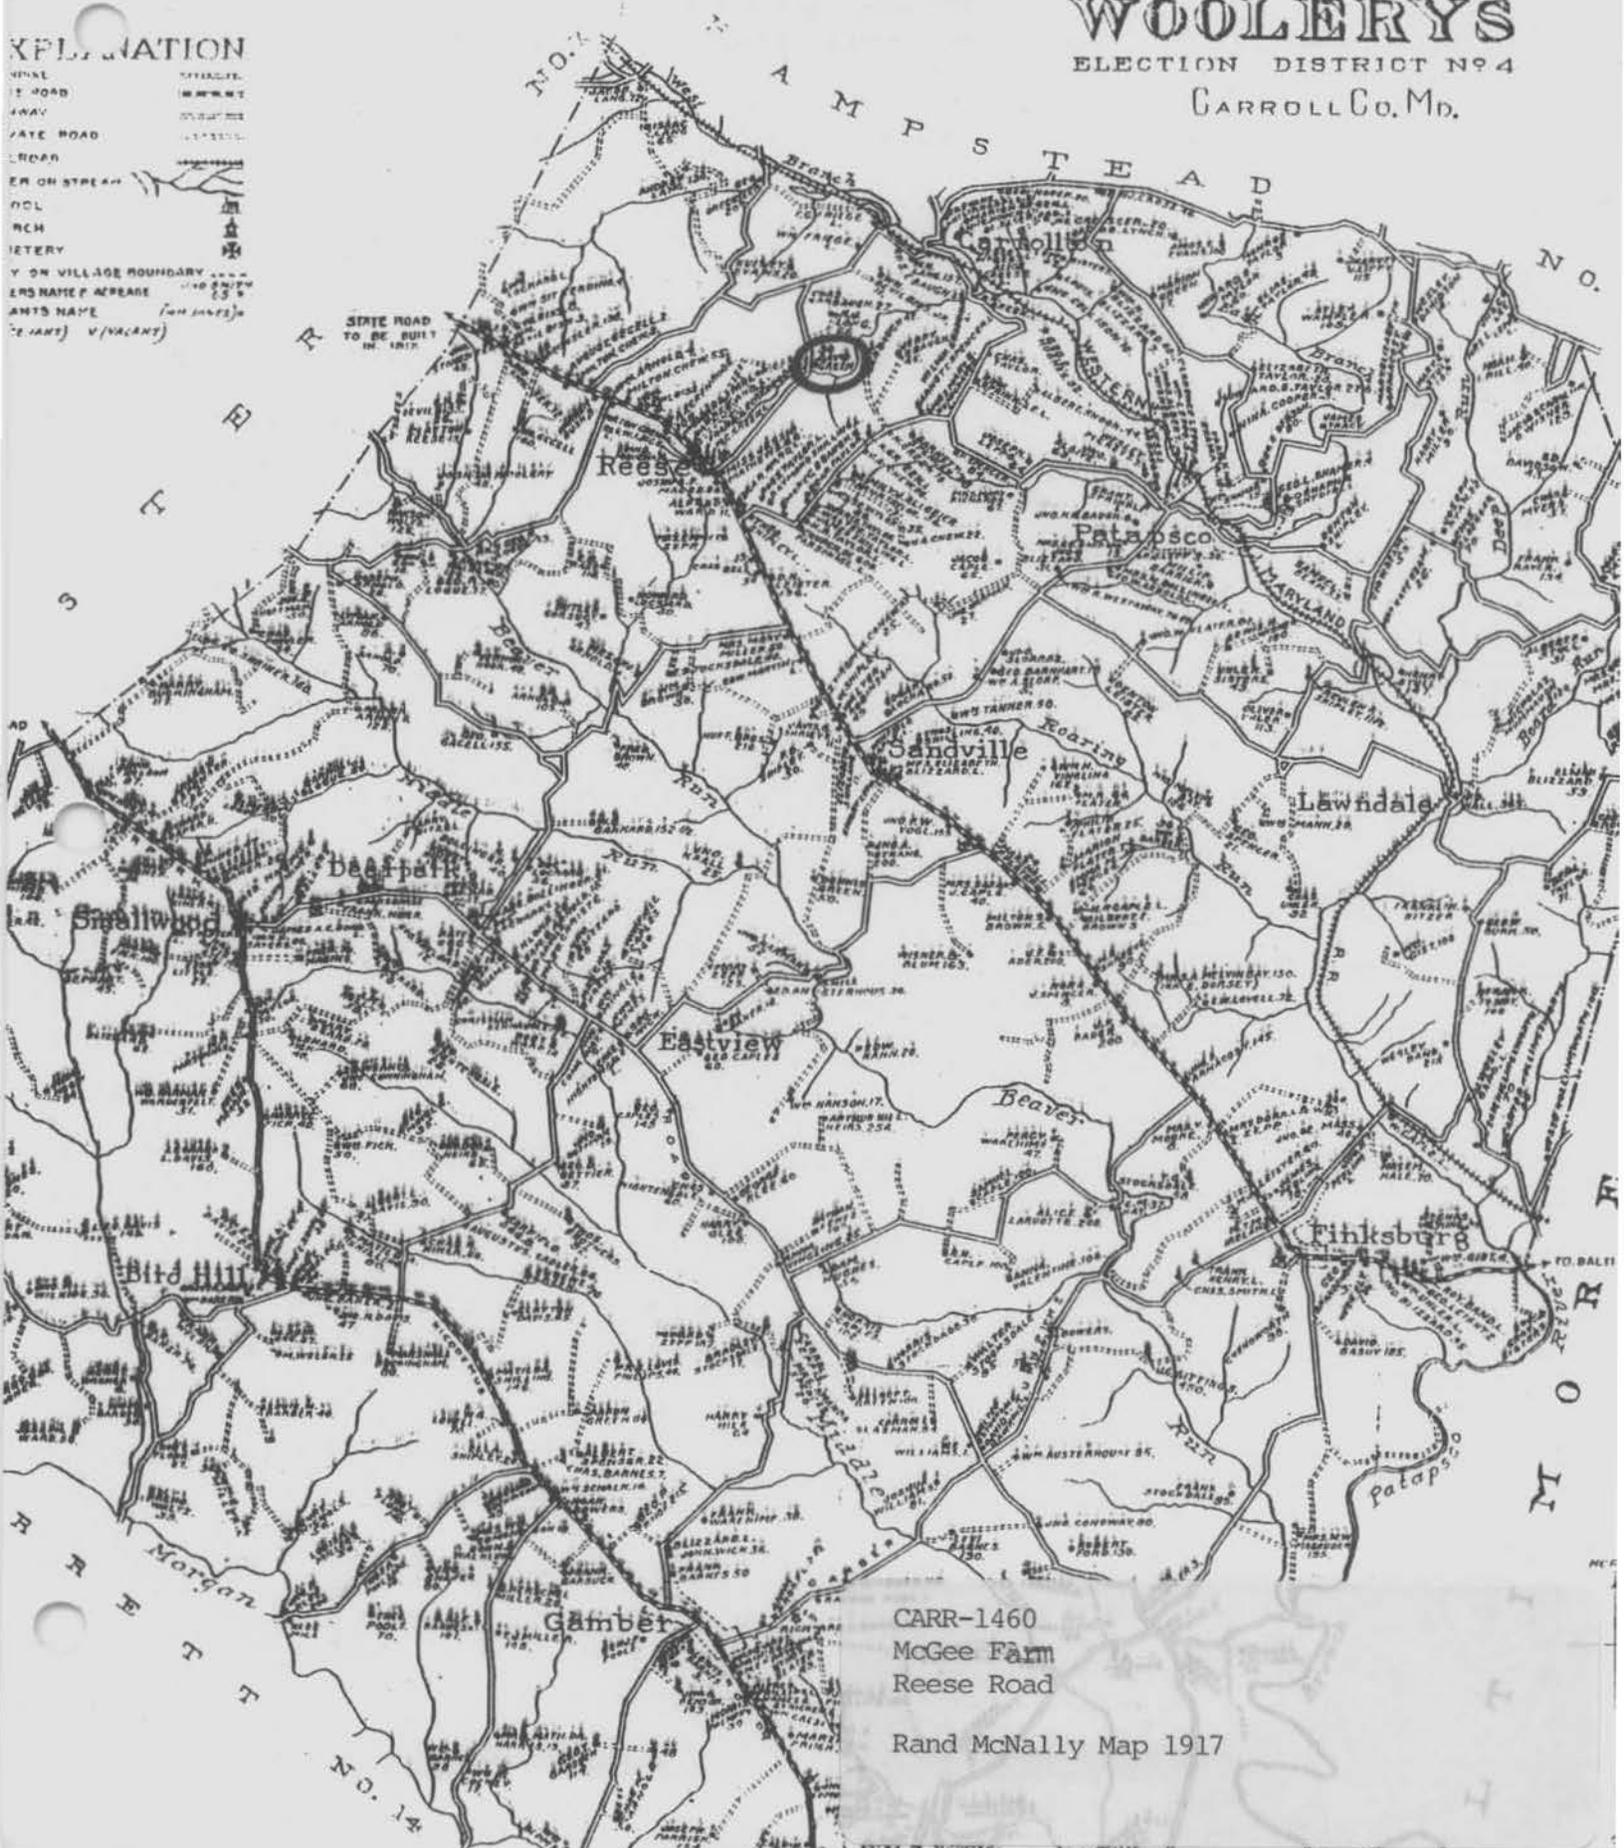

CARR-1460
McGee Farm
Reese Road

Rand McNally Map 1917

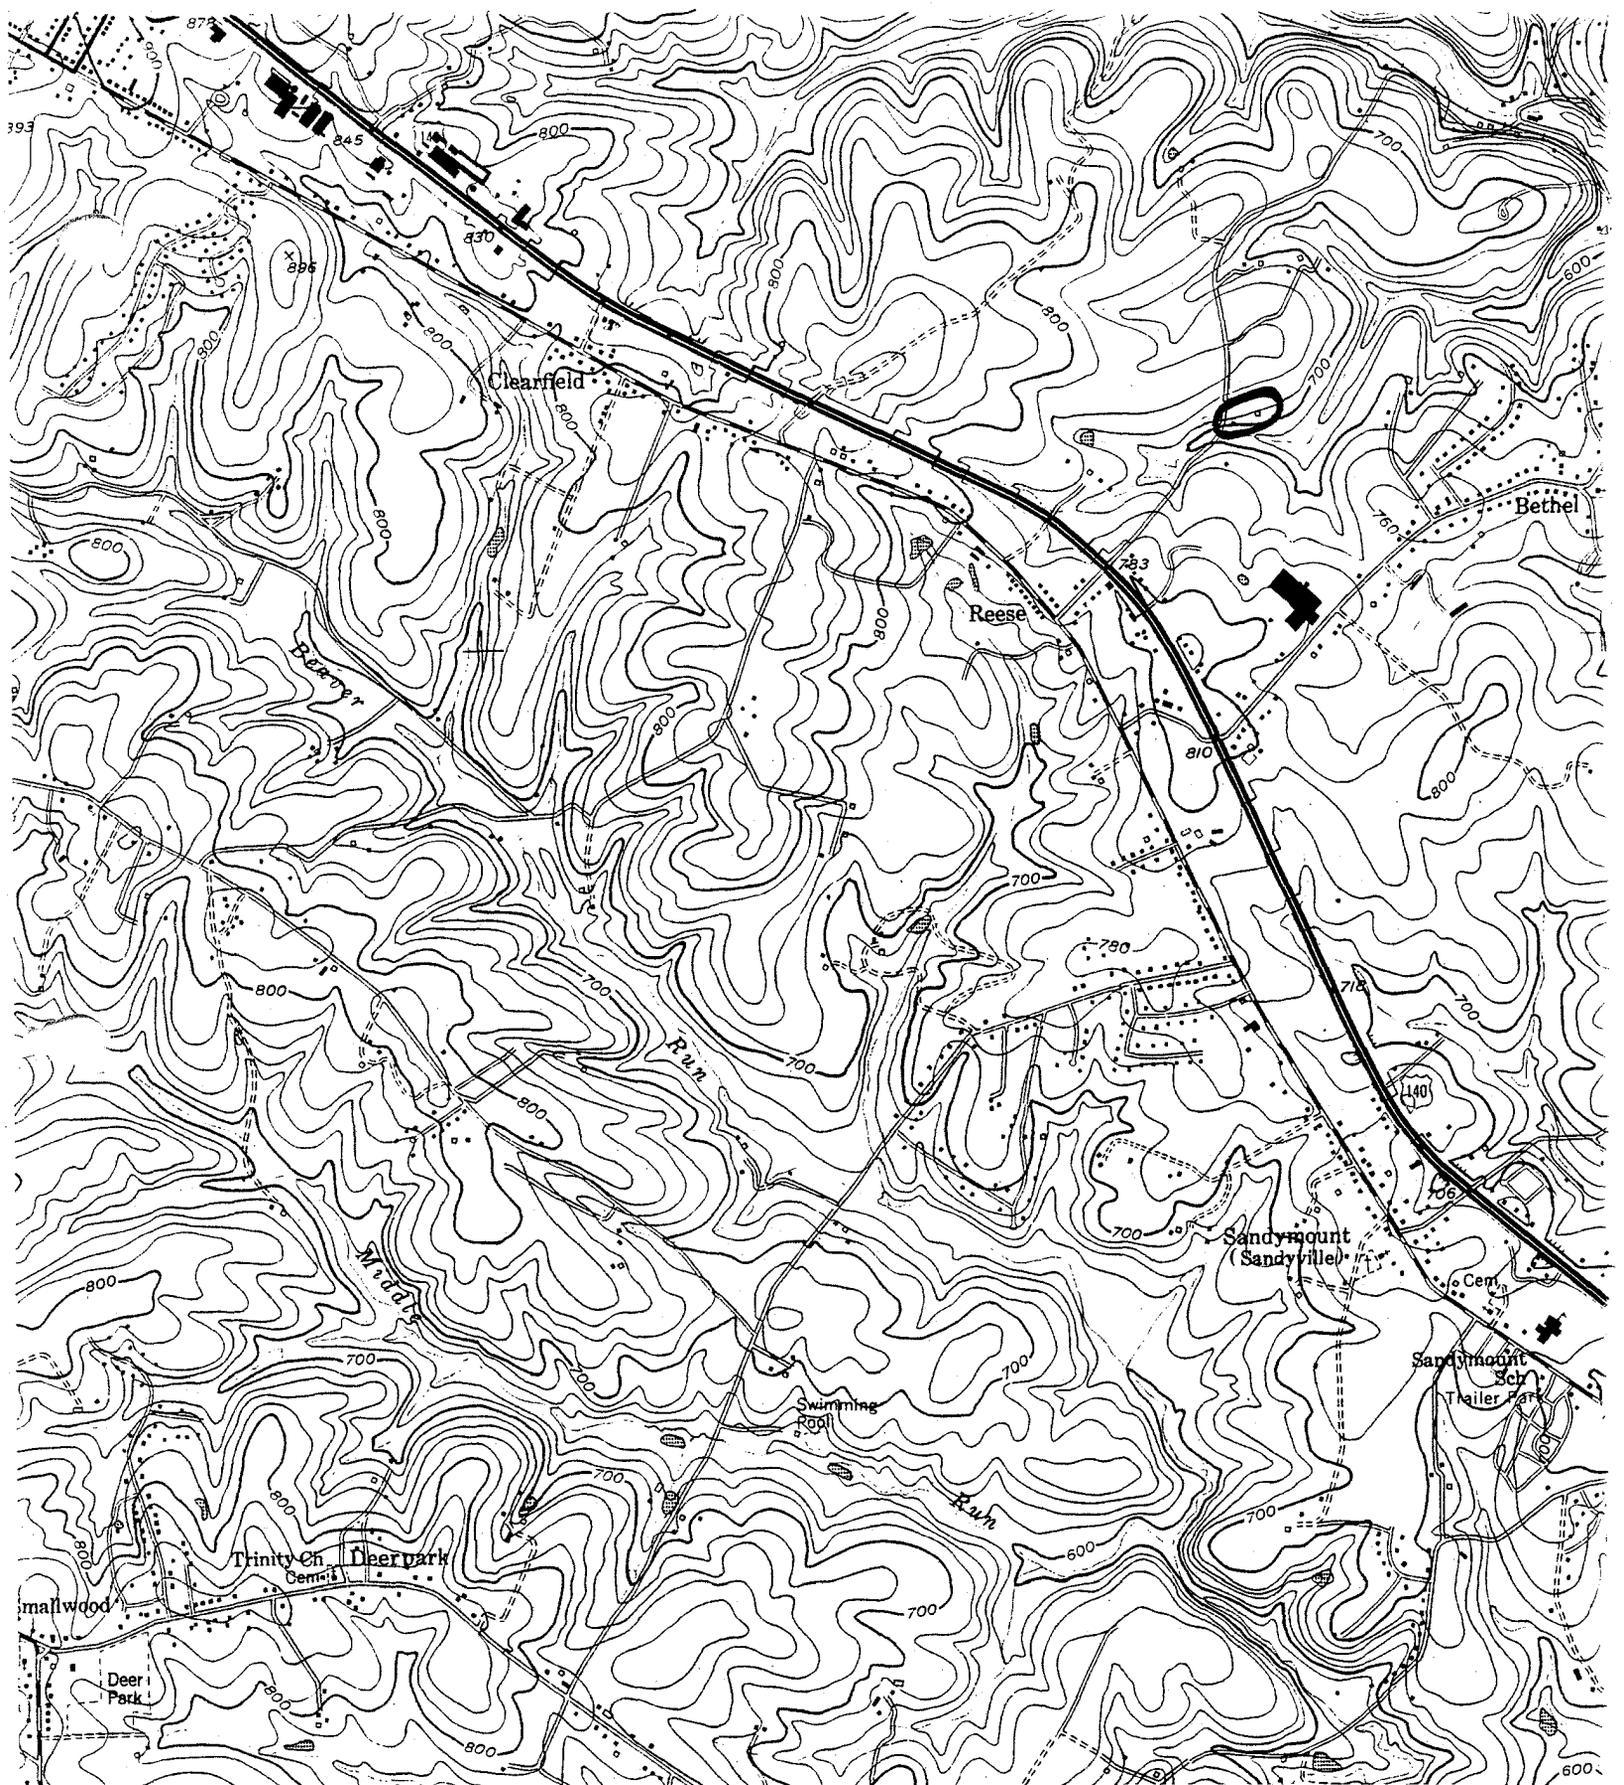

CARR-1460
McGee Farm
Reese Road

Westminster quad



McGee Farm
Reese Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: May 1995

Neg. Loc.: Maryland Historical Trust
house - w. & s. elevs.

72211 NINETEEN
51
55
1/2



McGee Farm
Reese Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: May 1995

Neg. Loc.: Maryland Historical Trust
Smokehouse - N. & W. elevs.

2/2