

CARR-1491

William T. DeVries Farm
Eldersburg (vicinity)

Summary:

Ludwick Little purchased this land in 1795 and 1796, and it remained in the Little family until the Baltimore City Circuit Court ordered it sold in 1864. The fact that the owner was not a Carroll County resident, and that no farm is indicated here on the 1862 Martenet Map of Carroll County suggests that it was a tenant farm, not owner occupied. It certainly must have been improved, though, since the 86-acre tract sold in May 1865 for \$4,450, or almost \$52 per acre. It was purchased by William T. DeVries of Baltimore County. DeVries apparently built this house and moved to the farm. The 1877 atlas clearly shows a building at this location. The house employs unusual features for Carroll County. It has been altered on at least one occasion, when the superb marbled slate mantels were added to the existing fireplaces. These are also unusual for Carroll County farm houses. The stair brackets are very similar to that found at the Jacob Leppo House in New Windsor (CARR-272), built c.1863. The design source of this feature is as yet unknown.

DeVries seems to have owned a great deal of land in the area. He sold the farm to Henry Newton DeVries, who may have been responsible for the alterations to the house, in 1890. By that time the farm had increased to 128 acres, and the sale price of \$6,500, if representative of the true value of the farm, meant the land was still worth about \$51 per acre. Henry DeVries sold the farm, now up to 227 acres, in 1932 to Stewart F. Hurline, who retained it until 1987. The land has now been subdivided and homes are being constructed on it. The house is currently being retained, but its ultimate disposition is in question.

Maryland Historical Trust State Historic Sites Inventory Form

MARYLAND INVENTORY OF
HISTORIC PROPERTIES

Survey No. CARR-1491

Magi No.

DOE yes no

1. Name (indicate preferred name)

historic William T. DeVries Farm

and/or common "Edgewood"

2. Location

street & number 800 Liberty Road ___ not for publication

city, town Eldersburg vicinity of congressional district

state Maryland county Carroll

3. Classification

Category	Ownership	Status	Present Use	
<input type="checkbox"/> district	<input type="checkbox"/> public	<input type="checkbox"/> occupied	<input type="checkbox"/> agriculture	<input type="checkbox"/> museum
<input checked="" type="checkbox"/> building(s)	<input checked="" type="checkbox"/> private	<input checked="" type="checkbox"/> unoccupied	<input type="checkbox"/> commercial	<input type="checkbox"/> park
<input type="checkbox"/> structure	<input type="checkbox"/> both	<input type="checkbox"/> work in progress	<input type="checkbox"/> educational	<input type="checkbox"/> private residence
<input type="checkbox"/> site	Public Acquisition	Accessible	<input type="checkbox"/> entertainment	<input type="checkbox"/> religious
<input type="checkbox"/> object	<input type="checkbox"/> in process	<input type="checkbox"/> yes: restricted	<input type="checkbox"/> government	<input type="checkbox"/> scientific
	<input type="checkbox"/> being considered	<input type="checkbox"/> yes: unrestricted	<input type="checkbox"/> industrial	<input type="checkbox"/> transportation
	<input checked="" type="checkbox"/> not applicable	<input checked="" type="checkbox"/> no	<input type="checkbox"/> military	<input type="checkbox"/> other:

4. Owner of Property (give names and mailing addresses of all owners)

name Warren J. Hook

street & number telephone no.:

city, town state and zip code

5. Location of Legal Description

courthouse, registry of deeds, etc. Courthouse Annex liber LWS 1405

street & number 55 North Court Street folio 639

city, town Westminster state MD

6. Representation in Existing Historical Surveys

title

date ___ federal ___ state ___ county ___ local

pository for survey records

city, town state

7. Description

Survey No. CARR-1491

Condition		Check one	Check one	
<input type="checkbox"/> excellent	<input type="checkbox"/> deteriorated	<input checked="" type="checkbox"/> unaltered	<input checked="" type="checkbox"/> original site	
<input checked="" type="checkbox"/> good	<input type="checkbox"/> ruins	<input type="checkbox"/> altered	<input type="checkbox"/> moved	date of move _____
<input type="checkbox"/> fair	<input type="checkbox"/> unexposed			

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

Summary:

The William T. DeVries Farm is located at 800 Liberty Road. The complex consists of a frame house, a frame poultry house, a small frame shed, and a medium frame shed. The house is a 2½-story, three-bay by one-bay frame structure, with a rubble stone foundation, weatherboards with corner boards, and a gable roof of standing-seam metal. The house faces southwest and has an ell on the northeast elevation. On the southeast elevation is a deteriorated porch deck three bays wide. There is no evidence that it was ever roofed. The first story has a center entrance with sidelights and a five-light transom. The door is flanked on either side by a 6/6 sash, with jib doors. There is a central gabled wall dormer with a 6/3 sash. The first story has a center-passage, single-pile plan with two rooms in the ell. The passage has a dog-leg stair on the southeast wall. The southeast room has a fireplace on the northwest wall with a marbleized slate mantel. On the northeast wall is a doorway to an enclosed stair passage that runs northwest-southeast. The center room northeast wall has a fireplace with a marbleized slate mantel. The northeast room has a large, simple wood mantel on the southwest wall with a winder stair in the west corner. The second story has the same floor plan as the first story. The stairs are open to the attic.

Contributing Resources: 4

The William T. DeVries Farm is located at 800 Liberty Road, on the northeast side of the road, about 1¼ miles northwest of Eldersburg in southeast Carroll County, Maryland. The complex consists of a frame house, a frame poultry house, a small frame shed, and a medium frame shed. The house sits on a slight rise. The land falls away gently on all sides except the northwest, which has a rather steep drop.

The house is a 2½-story, three-bay by one-bay frame structure, with a rubble stone foundation, weatherboards with corner boards, and a gable roof of standing-seam metal with a northwest-to-southeast ridge. The house faces southwest and has an ell on the northeast elevation. The ell has a gable roof of standing-seam metal with a northeast-to-southwest ridge. On the southeast elevation is a deteriorated porch deck three bays wide. It is supported by four stone walls that run northeast to southwest. There is no evidence that it was ever roofed. The first story has a center entrance with one light over two panels in the door. There are sidelights and a five-light transom. The door is flanked on either side by a 6/6 sash, with two one-panel jib doors below each sash, and with exterior blinds with one panel in the bottom of each. The house sill is exposed and is hewn. The second story has three 6/6 sash with blinds. There is a wood box cornice and a central gabled wall dormer with a 6/3 sash. The top sash is gabled. There is an interior brick chimney with a smoke

Description (continued)

Section 7 Page 2

hood on either side of the center bay.

The northwest elevation is built all in one plane. It is three bays, with a corner board between the north and the center bays. The first story has a typical 6/6 sash to the north, a closed-up window opening, a 6/6 sash, a closed-up window opening, and a 6/6 sash. The second story has, from north to west, two 6/6 sash, a corner board, three low closed-up openings, the top of the center one having a 6/6 sash, and a 6/6 sash in the west bay. A central gabled wall dormer covers part of the north and center bays. The dormer has a lancet shaped 2/2 sash. The corner board does not extend up into the dormer. The gable end of the main block has a four-light sash.

The northeast elevation is two bays, with a corner board between the pantry siding on the east and the ell siding to the north. The first story has no opening in the east or pantry bay. There is a four-panel door just north of the corner board and a typical 6/6 sash centered on the ell. The second story has a typical 6/6 sash in the center, and the gable end has a 6/3 sash. There is a one-story porch across the whole northeast elevation, set on three rubble stone walls running northeast to southwest. It has a shed roof of standing-seam metal, and two of its three boxed posts survive. There is an interior brick chimney between the northeast and center bays.

The southeast elevation of the ell is five bays. The first story has, from south to east, a four-panel door with a two-light transom, a typical 6/6 sash, a four-panel door where the corner board is, a typical 6/6 sash, and a projecting pantry with a typical 6/6 sash. The second story has a door with four lights over two panels, then evidence of a low window that has been infilled and is across from the center of the three infilled windows on the northwest elevation. Next comes a typical 6/6 sash, then a four-panel door that has a corner board above it, then a typical 6/6 sash which appears to have been moved two feet to the south. The pantry has a typical 6/6 sash.

The southwest elevation of the pantry has no opening on the first story, and has a four-panel door on the second story. The northeast elevation of the main block, on the first story, has a typical 6/6 sash, and a door with one light over two panels. The second story is identical to the first story. The ell is filled with a two-story porch that runs along the northeast side of the main block and the southeast side of the ell. It has four square posts on the first and second stories, and four horizontal rails between these posts on the second story only. The southeast elevation of the main block has a typical 6/6 sash on the first and second stories. The gable end has a four-light casement like that on the northwest.

The main block of the house had a crawl space only, originally, though it is now partly excavated and has $\frac{3}{4}$ -round joists and joists that are hewn on top and bottom. There

Description (continued)

Section 7 Page 3

is a cellar under the center ell room that appears original, and the foundation walls appear to be built at the same time as the main block, as several stones span both walls. The joists are identical to the main block. Under the northeastern-most room of the ell the cellar has $\frac{3}{4}$ -round log joists. There is no obvious break in the northwest wall between the center and northeast cellars.

The first story has a center-passage, single-pile plan with two rooms in the ell. The passage has a dog leg stair on the southeast wall, with an open stringer, a turned walnut newel, a moulded walnut handrail, turned balusters, and sawn brackets. The doors throughout the house have four panels. The passage is completely open beneath the staircase.

The southeast room has a fireplace on the northwest wall with a marbled slate mantel painted black with white veining. It has a semi-circular arch, and grooves cut in the spandrels and the center cartouche. This is not the original mantel, but is a later addition and alteration as the firebox has a plaster surround and then a veneer of brick on the outside of it, to which the mantel is attached.

The northwest room has a central fireplace on the southeast wall that is closed off with a marbled slate cover that matches the marbled slate mantel. This mantel has a semicircular arch very similar to that in the southeast room, but has a simpler cartouche. The mantel is painted a reddish-brown with white veining. East of the mantel is a typical door leading to a large closet. On the northeast wall is a doorway to an enclosed stair passage that runs northwest-southeast. The stair has a winder at the top and a small landing at the bottom, with a door on the southeast to the exterior. There is also a door on the northeast that leads to the center room.

The center room has a chairrail. The southwest wall has a typical door leading to a closet beneath the rear stairs. The northeast wall has a fireplace that is flush with the wall and projects out into the northeast room. It has a marbled slate mantel with three types of painting. It is semicircular arched, and has a marbled slate cover of reddish brown with white veining. The spandrels have black bands with a red and white pattern inside them. The simple cartouche is painted the same way, and the narrow shallow grooves have gold paint in them. East of the mantel is a typical four-panel door to the northeast room.

The northeast room has a large, simple wood mantel on the southwest wall, with new brick infill in the fireplace. There is a winder stair in the west corner that has a vertical-board door and a small closet with a board door under the stairs. The southeast side of the fireplace has a closet set high on the wall.

Description (continued)

Section 7 Page 4

The second story has the same floor plan as the first story. The stairs are open to the attic and contain the same details as on the first story. There is very low clearance on the landing.

The southeast chamber has a wood mantel on the northwest wall that has pilaster strips and a plain frieze. It was never a fireplace. In front of it is a radiator. To the north of it is a four-panel door leading to a closet. The closet extends behind at least one-third of the mantel. The northwest chamber is identical to the southeast chamber, with the same mantel, radiator, and closet all located on the southeast wall. The northeast wall has a typical door leading to the cross passage.

The cross passage has three horizontal rails around the stairs, and a door on the southeast that leads to the porch. There is a typical four-panel door on the northeast wall, set to the north, that leads to the center chamber. The northeast chamber is divided in two by a wall running northwest-southeast that appears to be a later alteration. The southwest half has a winder stair in the west corner, with an enclosed passage. This division appears to be original. The northwest wall has a radiator marked "PAT.FEB.23.04." There is also a claw-foot tub in the southwest half of the northeast chamber, and there was formerly a pedestal sink.

The second-story room above the pantry is accessible only from a door from the porch. It has circular-sawn lath with wire nails, and plaster.

The attic has plastered walls and ceiling. Some of the flooring appears to be reused lumber. There are attic rooms on the northwest and southeast that have vertical-board doors. There is a four-panel door stored in the attic that has both sides grained. The rails and stiles appear to imitate oak, while the fields appear to be grained to imitate a walnut burl. The center attic appears to have always been finished and has a small radiator on the northeast wall. The northeast attic formerly had a radiator on the northeast wall. The rafters are 2 x 4's, with a birdsmouth cut at the rafter foot that laps over a false plate. The rafters in the northwest attic room are of larger dimension. This attic room also was apparently finished from the beginning.

Just northeast of the northeast porch is a well that now has a concrete pad around it and a small wooden housing on the top for pump equipment.

About 2 feet northwest of the well is a poultry house with a rubble stone foundation, beaded-edge-and-center vertical-board siding, and a gable roof of asphalt shingles with a northeast to southwest ridge. The southeast elevation has a window opening and a small door opening below it. The southwest elevation has a four-panel door. The northwest

8. Significance

Period	Areas of Significance—Check and justify below			
<input type="checkbox"/> prehistoric	<input type="checkbox"/> archeology-prehistoric	<input type="checkbox"/> community planning	<input type="checkbox"/> landscape architecture	<input type="checkbox"/> religion
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> archeology-historic	<input type="checkbox"/> conservation	<input type="checkbox"/> law	<input type="checkbox"/> science
<input type="checkbox"/> 1500-1599	<input type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> literature	<input type="checkbox"/> sculpture
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> architecture	<input type="checkbox"/> education	<input type="checkbox"/> military	<input type="checkbox"/> social/ humanitarian
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> art	<input type="checkbox"/> engineering	<input type="checkbox"/> music	<input type="checkbox"/> theater
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> commerce	<input type="checkbox"/> exploration/settlement	<input type="checkbox"/> philosophy	<input type="checkbox"/> transportation
<input type="checkbox"/> 1900-	<input type="checkbox"/> communications	<input type="checkbox"/> industry	<input type="checkbox"/> politics/government	<input type="checkbox"/> other (specify)
		<input type="checkbox"/> invention		

Specific dates	Builder/Architect
check: Applicable Criteria: <input type="checkbox"/> A <input type="checkbox"/> B <input checked="" type="checkbox"/> C <input type="checkbox"/> D and/or	
Applicable Exception: <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G	
Level of Significance: <input type="checkbox"/> national <input type="checkbox"/> state <input checked="" type="checkbox"/> local	

Prepare both a summary paragraph of significance and a general statement of history and support.

Geographic Organization: Piedmont
 Chronological/Development Period: Agriculture-Industrial Transition A.D. 1815-1870;
 Industrial/Urban Dominance A.D. 1870-1930
 Historic Period Themes: Agriculture, Architecture
 Resource Types: Small family farm, Rural vernacular

Ludwick Little purchased this land in 1795 and 1796, and it remained in the Little family until the Baltimore City Circuit Court ordered it sold in 1864. The fact that the owner was not a Carroll County resident, and that no farm is indicated here on the 1862 Martenet Map of Carroll County suggests that it was a tenant farm, not owner occupied. It certainly must have been improved, though, since the 86-acre tract sold in May 1865 for \$4,450, or almost \$52 per acre. It was purchased by William T. DeVries of Baltimore County. DeVries apparently built this house and moved to the farm. The 1877 atlas clearly shows a building at this location. The house employs unusual features for Carroll County. It has been altered on at least one occasion, when the superb marbleized slate mantels were added to the existing fireplaces. These are also unusual for Carroll County farm houses. The stair brackets are very similar to that found at the Jacob Leppo House in New Windsor (CARR-272), built c.1863. The design source of this feature is as yet unknown.

DeVries seems to have owned a great deal of land in the area. He sold the farm to Henry Newton DeVries, who may have been responsible for the alterations to the house, in 1890. By that time the farm had increased to 128 acres, and the sale price of \$6,500, if representative of the true value of the farm, meant the land was still worth about \$51 per acre. Henry DeVries sold the farm, now up to 227 acres, in 1932 to Stewart F. Hurline, who retained it until 1987. The land has now been subdivided and homes are being constructed on it. The house is currently being retained, but its ultimate disposition is in question.

9. Major Bibliographical References

Survey No. CARR-1491

Land Records
1862, 1877, 1917 maps

10. Geographical Data

Acreage of nominated property 127 acres

Quadrangle name Finksburg

Quadrangle scale 1:24000

UTM References do NOT complete UTM references

A	<input type="text"/>	<input type="text"/>	<input type="text"/>
	Zone	Easting	Northing

B	<input type="text"/>	<input type="text"/>	<input type="text"/>
	Zone	Easting	Northing

C	<input type="text"/>	<input type="text"/>	<input type="text"/>
---	----------------------	----------------------	----------------------

D	<input type="text"/>	<input type="text"/>	<input type="text"/>
---	----------------------	----------------------	----------------------

E	<input type="text"/>	<input type="text"/>	<input type="text"/>
---	----------------------	----------------------	----------------------

F	<input type="text"/>	<input type="text"/>	<input type="text"/>
---	----------------------	----------------------	----------------------

G	<input type="text"/>	<input type="text"/>	<input type="text"/>
---	----------------------	----------------------	----------------------

H	<input type="text"/>	<input type="text"/>	<input type="text"/>
---	----------------------	----------------------	----------------------

Verbal boundary description and justification

List all states and counties for properties overlapping state or county boundaries

state	code	county	code
-------	------	--------	------

state	code	county	code
-------	------	--------	------

11. Form Prepared By

name/title Kenneth M. Short, Historic Planner

organization Carroll County Planning

date January 24, 1996

street & number 225 North Center Street

telephone (410) 857-2145

city or town Westminster


state MD

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to: Maryland Historical Trust
Shaw House
21 State Circle
Annapolis, Maryland 21401
(301) 269-2438

MARYLAND HISTORICAL TRUST
DHCP/DHCD
100 COMMUNITY PLACE
CROWNSVILLE, MD 21032-2023
514-7600

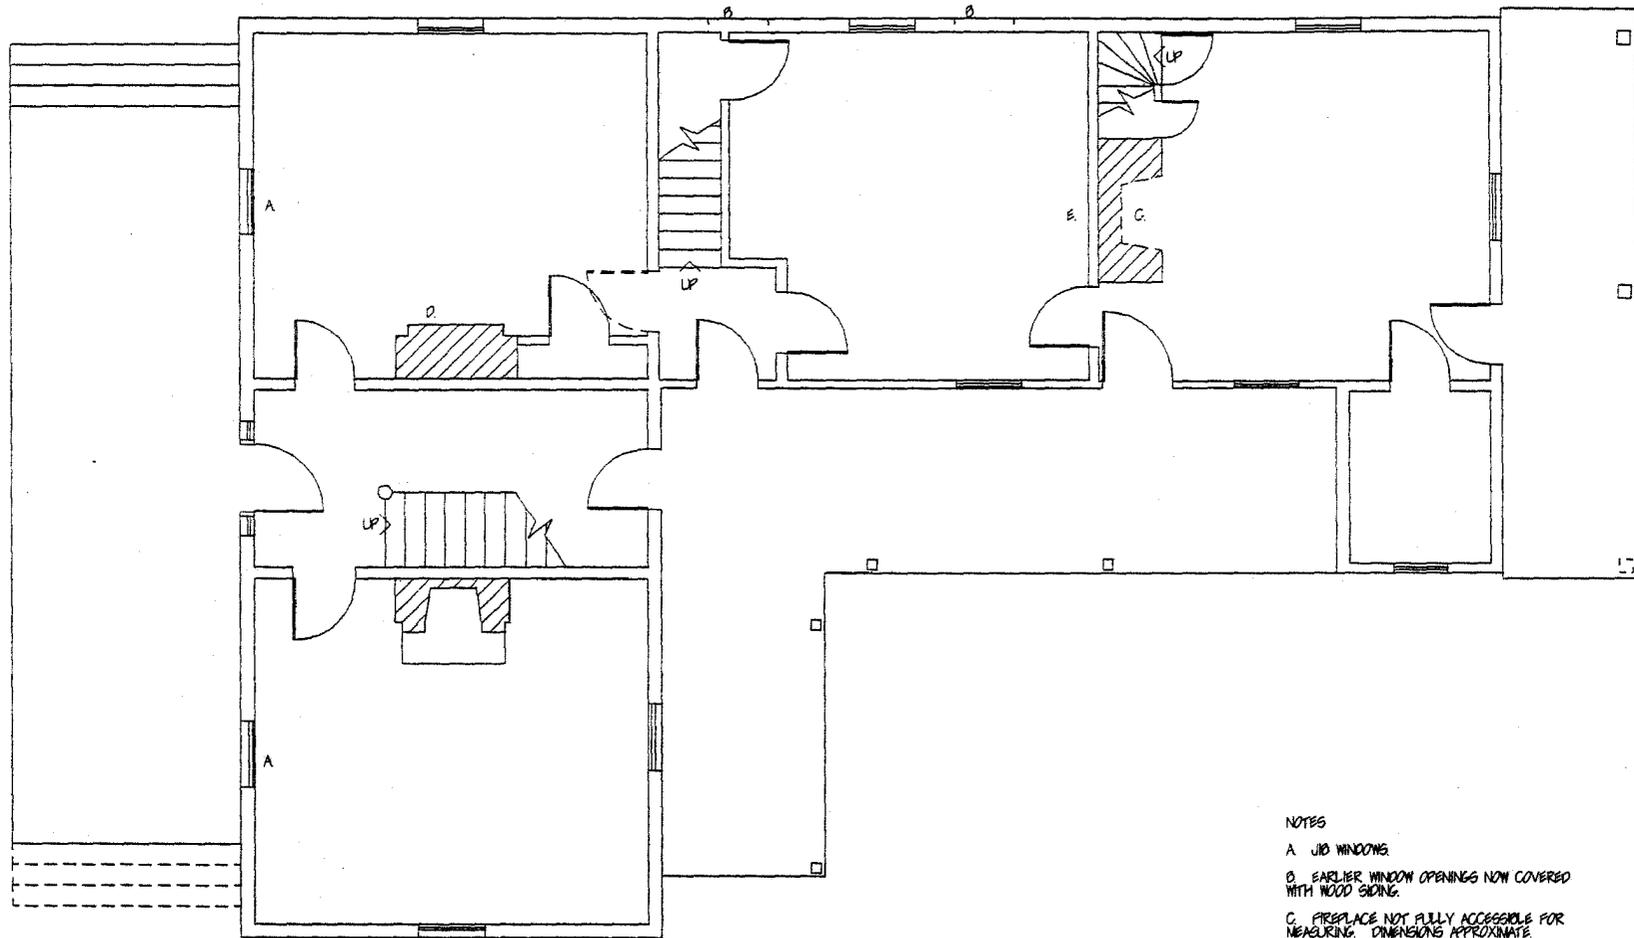

NOTES

- A JIB WINDOWS
- B EARLIER WINDOW OPENINGS NOW COVERED WITH WOOD SIDING
- C FIREPLACE NOT FULLY ACCESSIBLE FOR MEASURING. DIMENSIONS APPROXIMATE
- D FIREPLACE OPENING COVERED BY HATCHED SLATE COVER
- E HATCHED SLATE MANTEL AND COVER HERE NOT SHOWN. NO FUNCTIONAL FIREPLACE.

CARR-
1491


WILLIAM T. DEVRIES FARM
800 LIBERTY ROAD

MEASURED BY KEN SHORT AND JEANNE JONER


FIRST FLOOR PLAN

DRAWN BY KEN SHORT

SEPTEMBER 1995

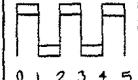


800 Liberty Rd
Stair Bracket

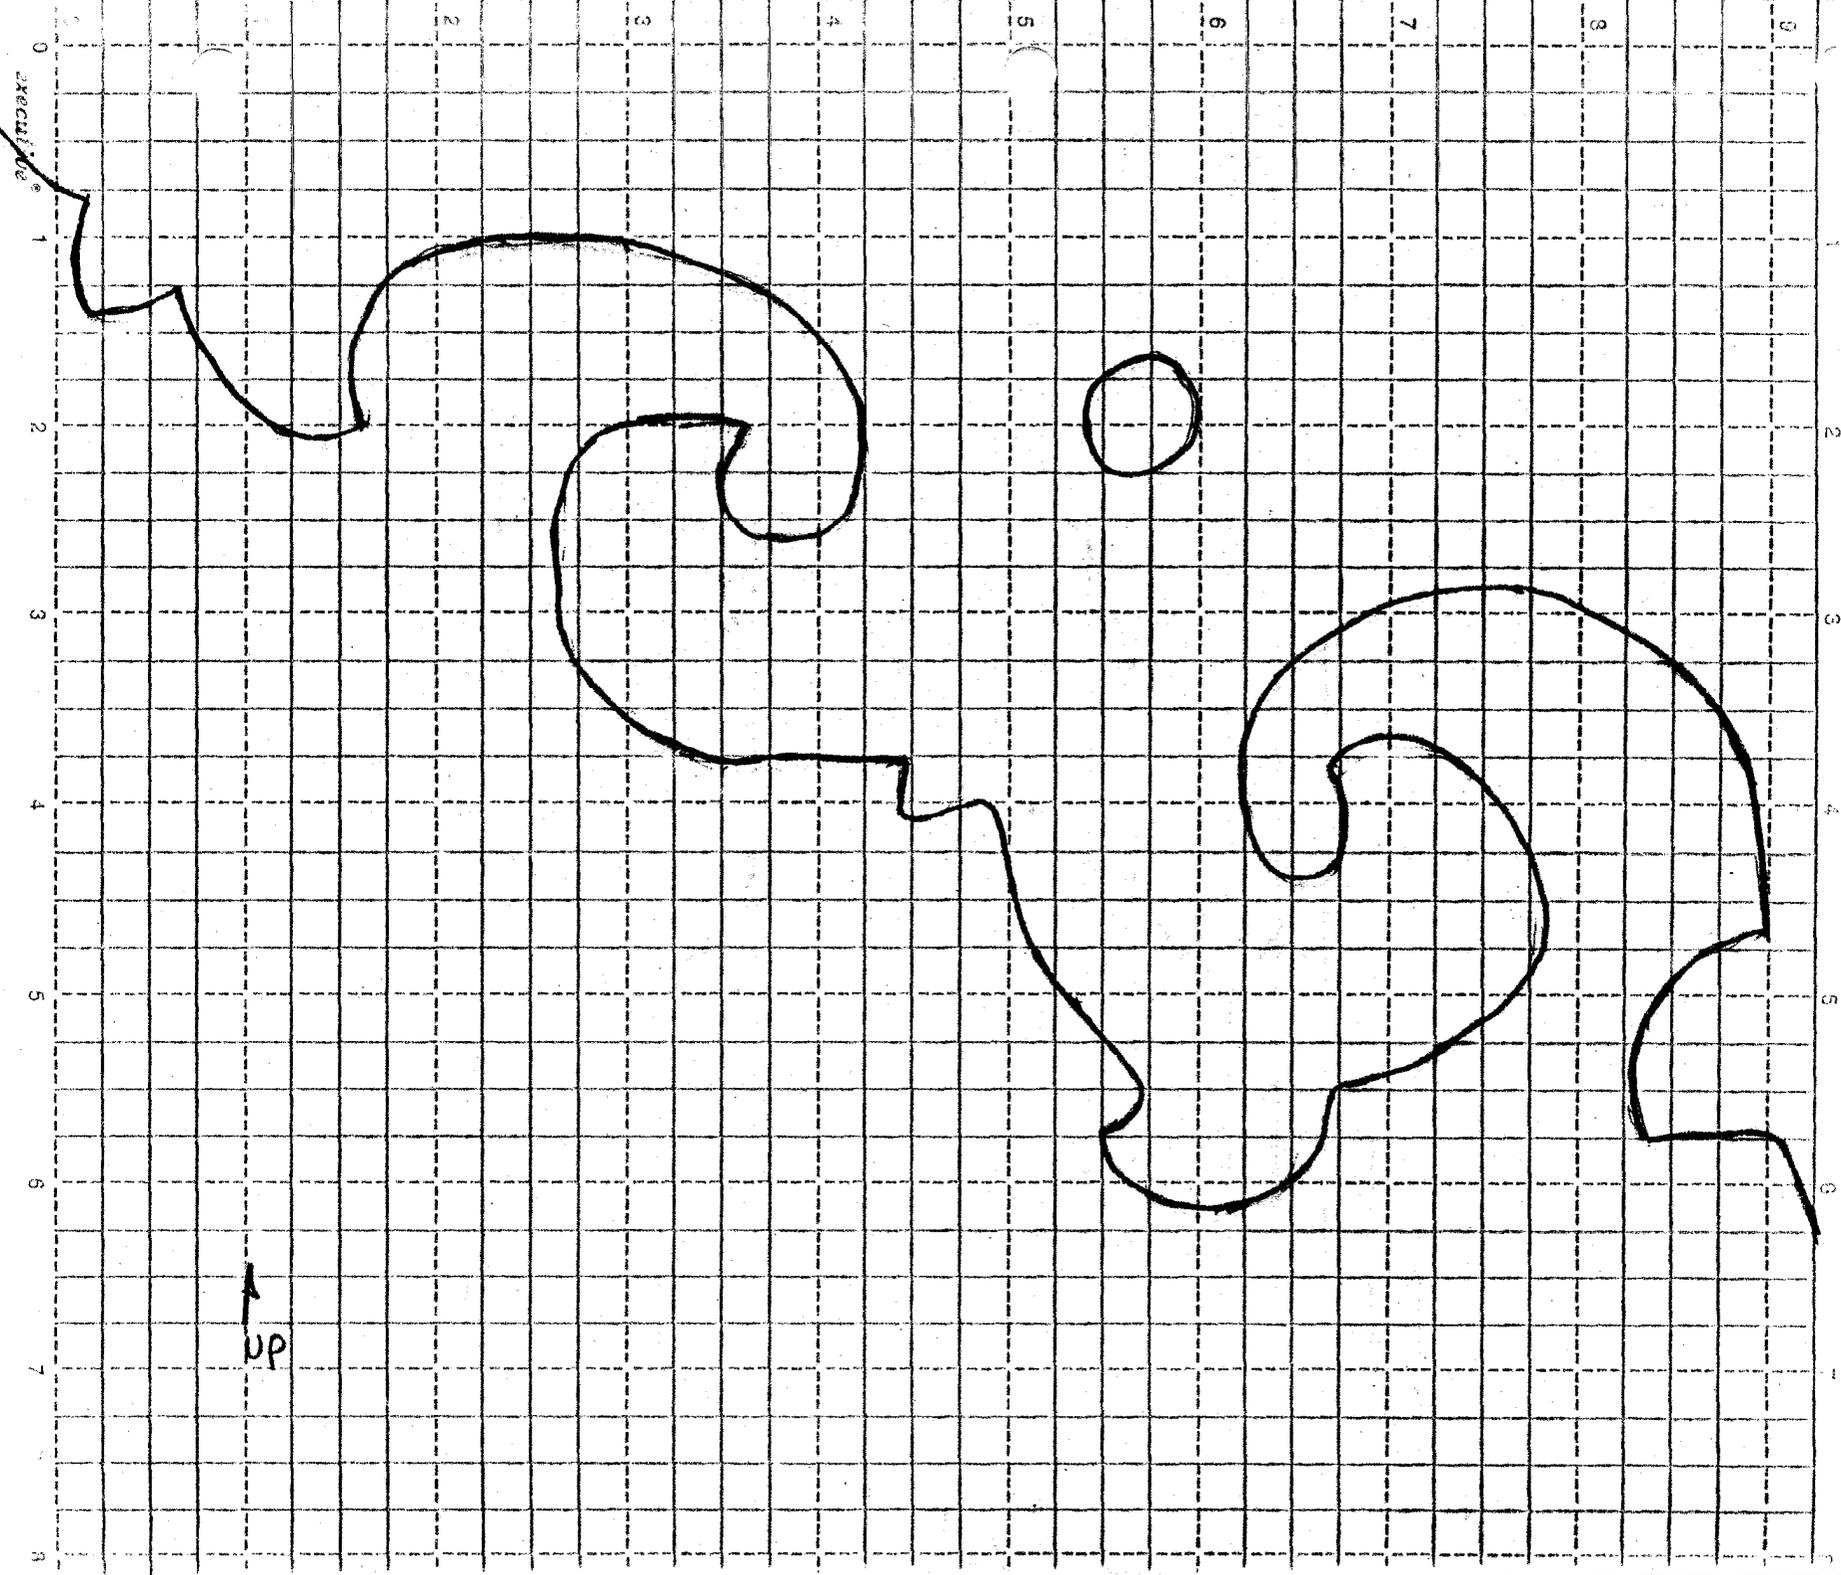

800 Liberty Rd
Stair Apron

CARR-1491

PREPARED BY: KMS/JST
DATE: 21 Sept '95

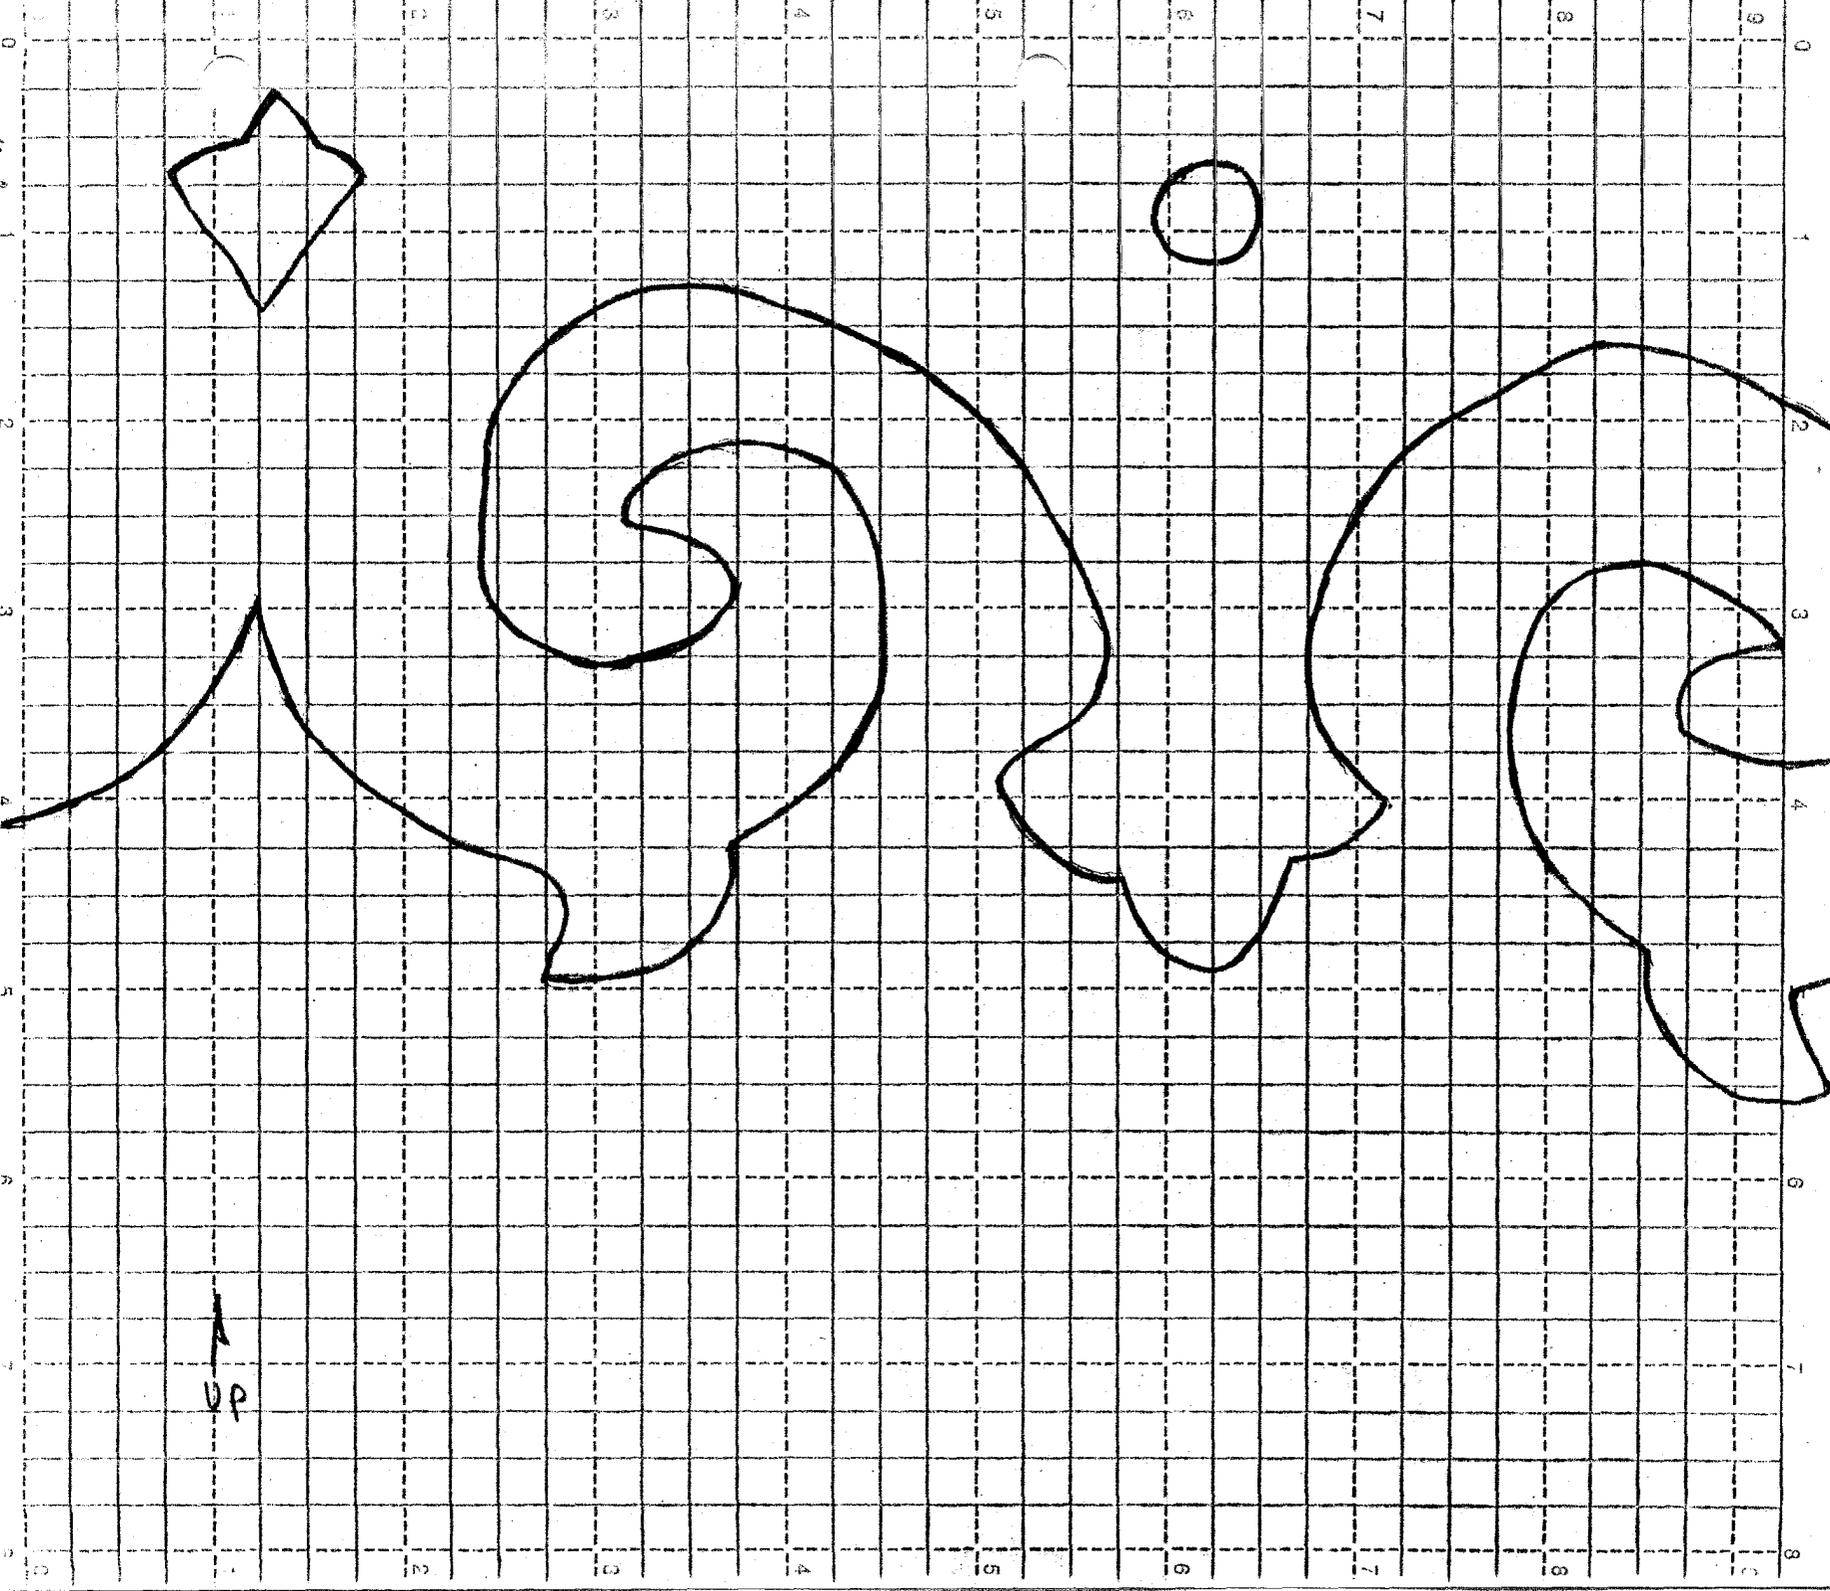

CARR-1491
William T. DeVries Farm
800 Liberty Road

CHAIN OF TITLE

GRANTOR	HOME COUNTY	GRANTEE	HOME COUNTY	DATE	LIBER	FOLIO	TRANS-ACTION	COMMENTS
Warren J. Hook, personal rep. of Harriet H. Hook	Prince George's County	Warren J. Hook	?	10-26-1992	LWS 1405	639	Deed fee simple	227+ acre - 87+ acre - 2+ acre ½ interest \$0
Stewart F. Hurline & Harriet H. Hook, personal reps. & trustees	?	Harriet H. Hook	?	6-9-1987	LWS 1024	418	Deed fee simple	\$0, 227+ acres - 87+ acres - 2+ acres
Stewart F. & Virginia B. Hurline (wife)	Carroll	Stewart F. & Virginia B. Hurline (wife)	Carroll	8-6-1974	CCC 576	352	Deed fee simple	\$10.00, 227 - 87
Charles P. Geiman	Carroll	Stewart F. & Virginia B. Hurline (wife)	?	9-1-1945	EAS 187	357	Deed fee simple	\$1.00, 227 acres - 87 acres
Stewart F. & Virginia B. Hurline (wife)	Carroll	Charles P. Geiman	Carroll	9-1-1945	EAS 187	356	Deed fee simple	\$1.00, 227 acres - 87 acres
Henry Newton DeVries, widower	Carroll	Stewart F. Hurline	Baltimore County	4-29-1932	EMM 157	221	Deed fee simple	\$10.00, 227 acres (1) 128 acres - 7 acres (life estate) (2) 7 acres (see 1) (3) 1 acre (4) 102 acres

CARR-1491
William T. DeVries Farm
800 Liberty Road

CHAIN OF TITLE


GRANTOR	HOME COUNTY	GRANTEE	HOME COUNTY	DATE	LIBER	FOLIO	TRANS-ACTION	COMMENTS
William T. & Anna J. DeVries (wife)	Carroll	Henry Newton DeVries		3-7-1890	WNM 71	21	Deed fee simple	\$6,500, 128 acres Good Neighborhood, Addition to Perserverance, Everett's Progress Enlarged minus 7 acres held as life estate by grantors, on west side of this land - adjoins J. Oliver Wadlow's Orchard enclosed by paling fence also used for small fruits [no previous reference] (1)

CARR-1491
 William T. DeVries Farm
 800 Liberty Road

CHAIN OF TITLE

GRANTOR	HOME COUNTY	GRANTEE	HOME COUNTY	DATE	LIBER	FOLIO	TRANS-ACTION	COMMENTS
William Pinckney Whyte & William A. Fisher	Baltimore County	William T. DeVries	Baltimore County	8-8-1865	WAMcK 32	303	Deed	Baltimore City Circuit Court 9-9-1864, Samuel E. Little v. William Stewart Little, et al, sold 5-10-1865, \$4,450, 86 acres, lot 1 of plat - in village of Freedom, Good Neighborhood, Addition to Perserverance, Everett's Progress Enlarged
Philip Lavelly		Ludwick Little		1-12-1795	<u>Balto. Co.</u> WG 22	323		
Absolom Shipley		Ludwick Little		3-4-1796	<u>Balto. Co.</u> WG UU	532		


KS/e:12-20-95:1491titl.ks

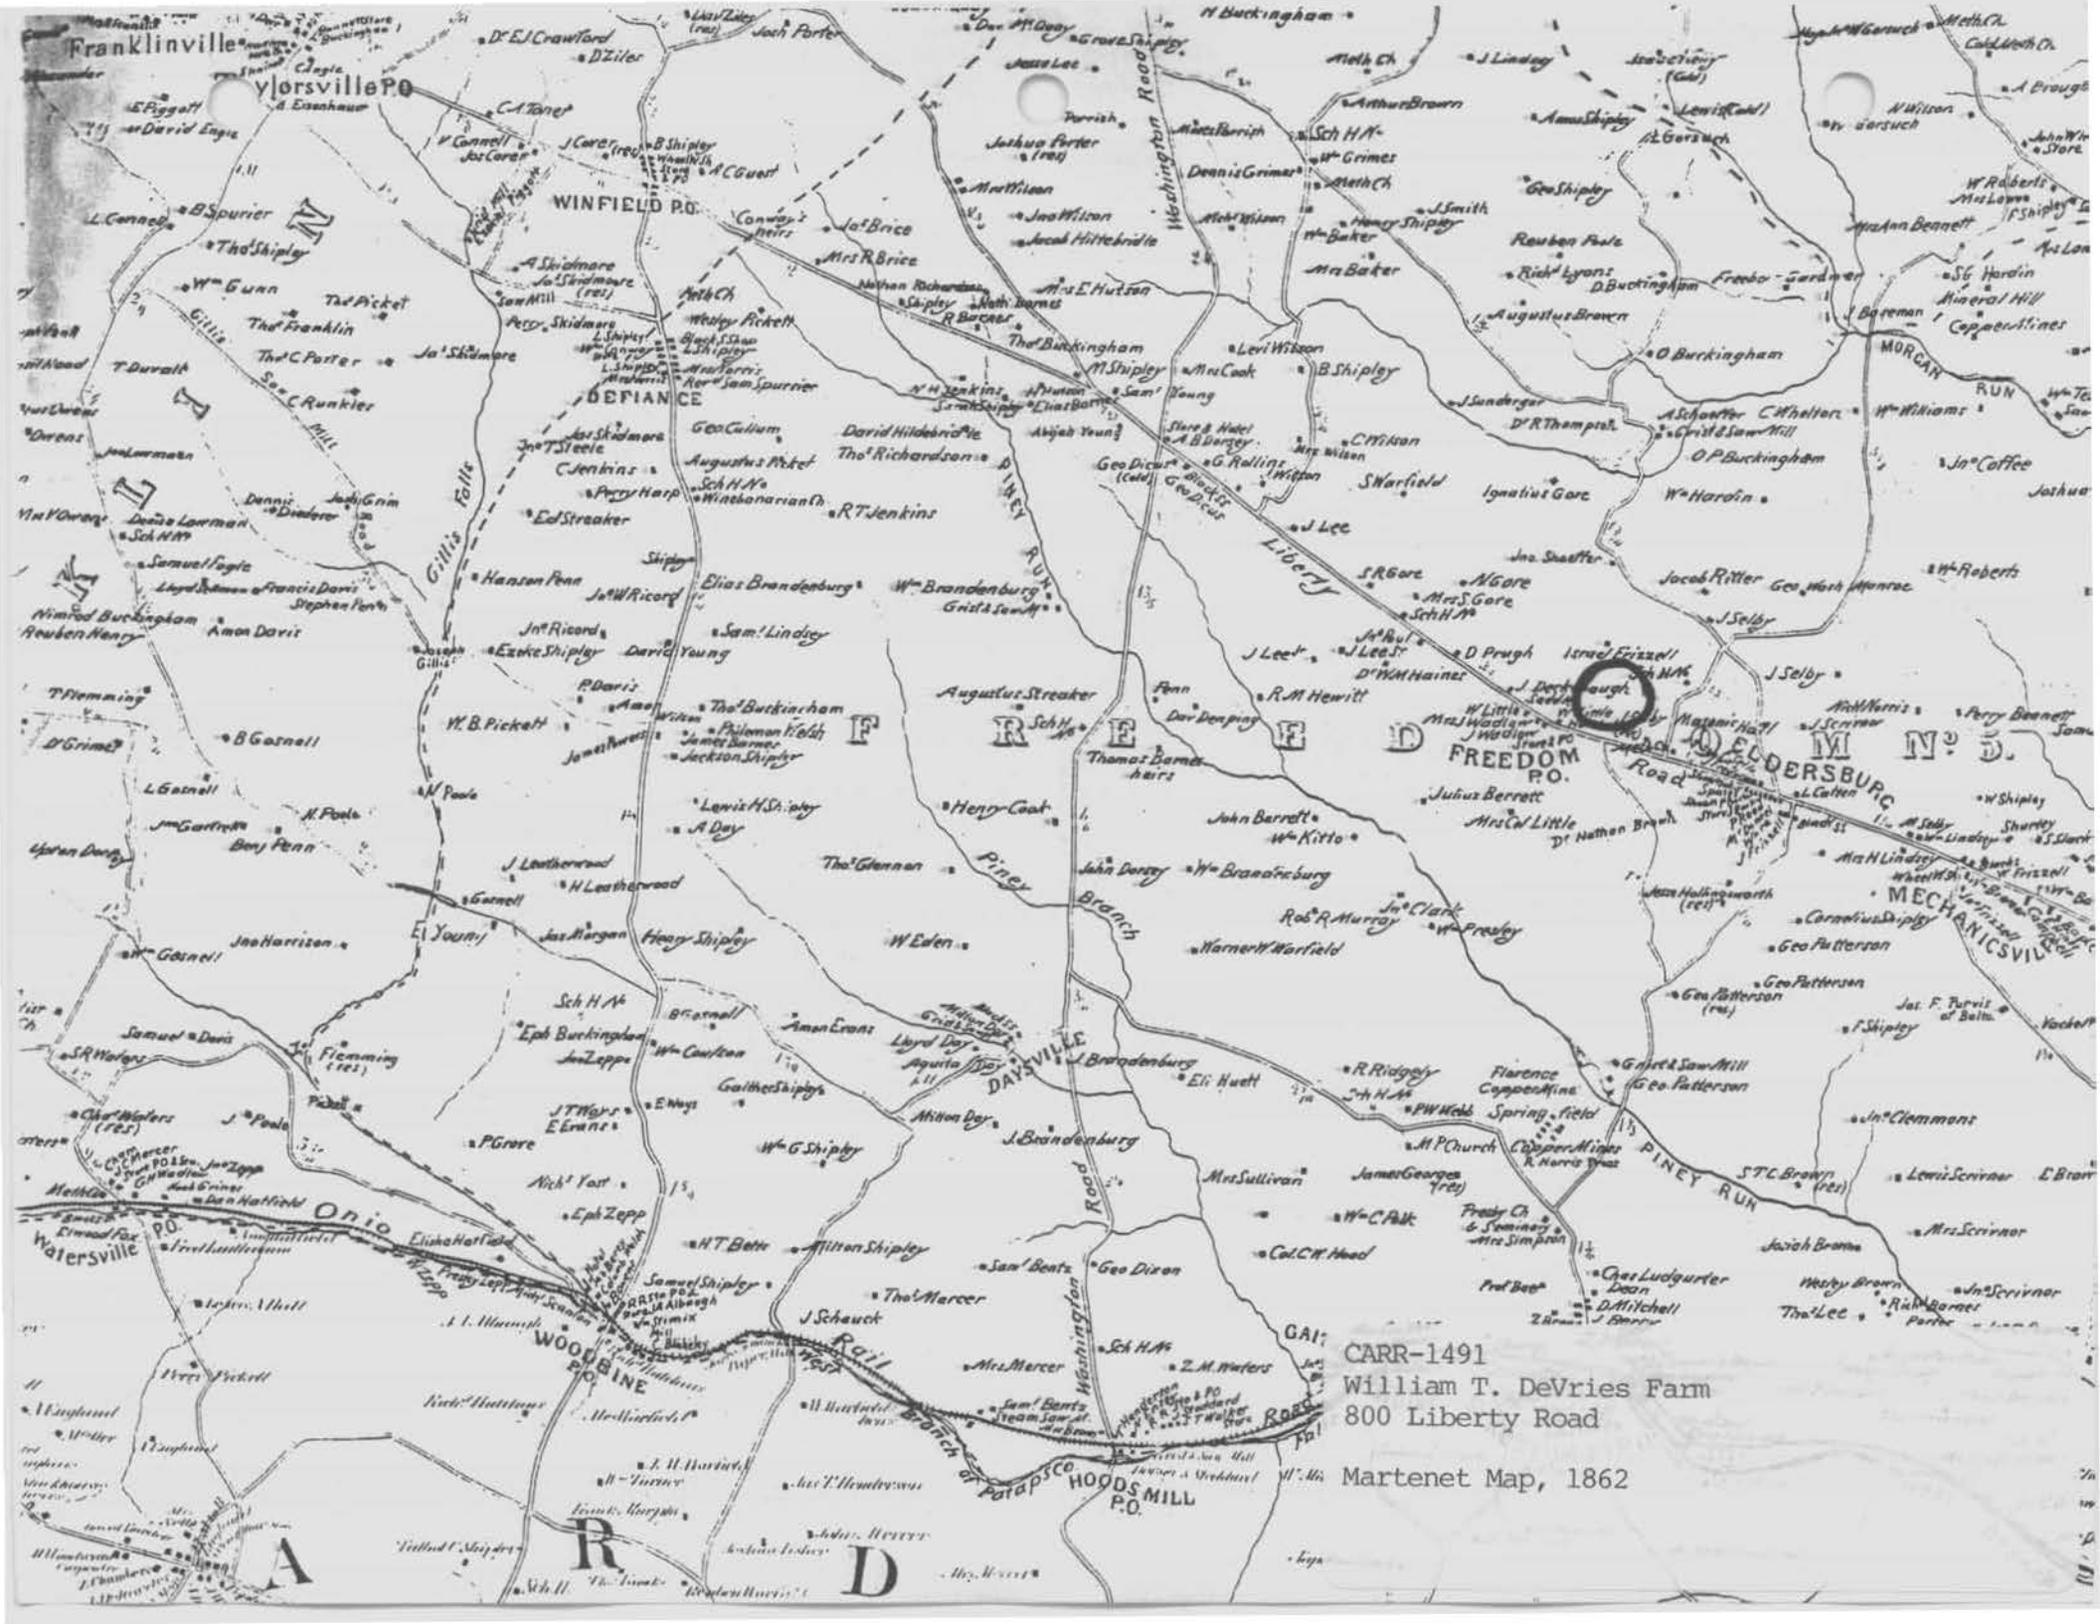

CARR-1491
William T. DeVries Farm
800 Liberty Road
Martenet Map, 1862

FREEDOM


Big DISTRICT N^o 5
Scale 1/4 inches to the Inch
Morgans

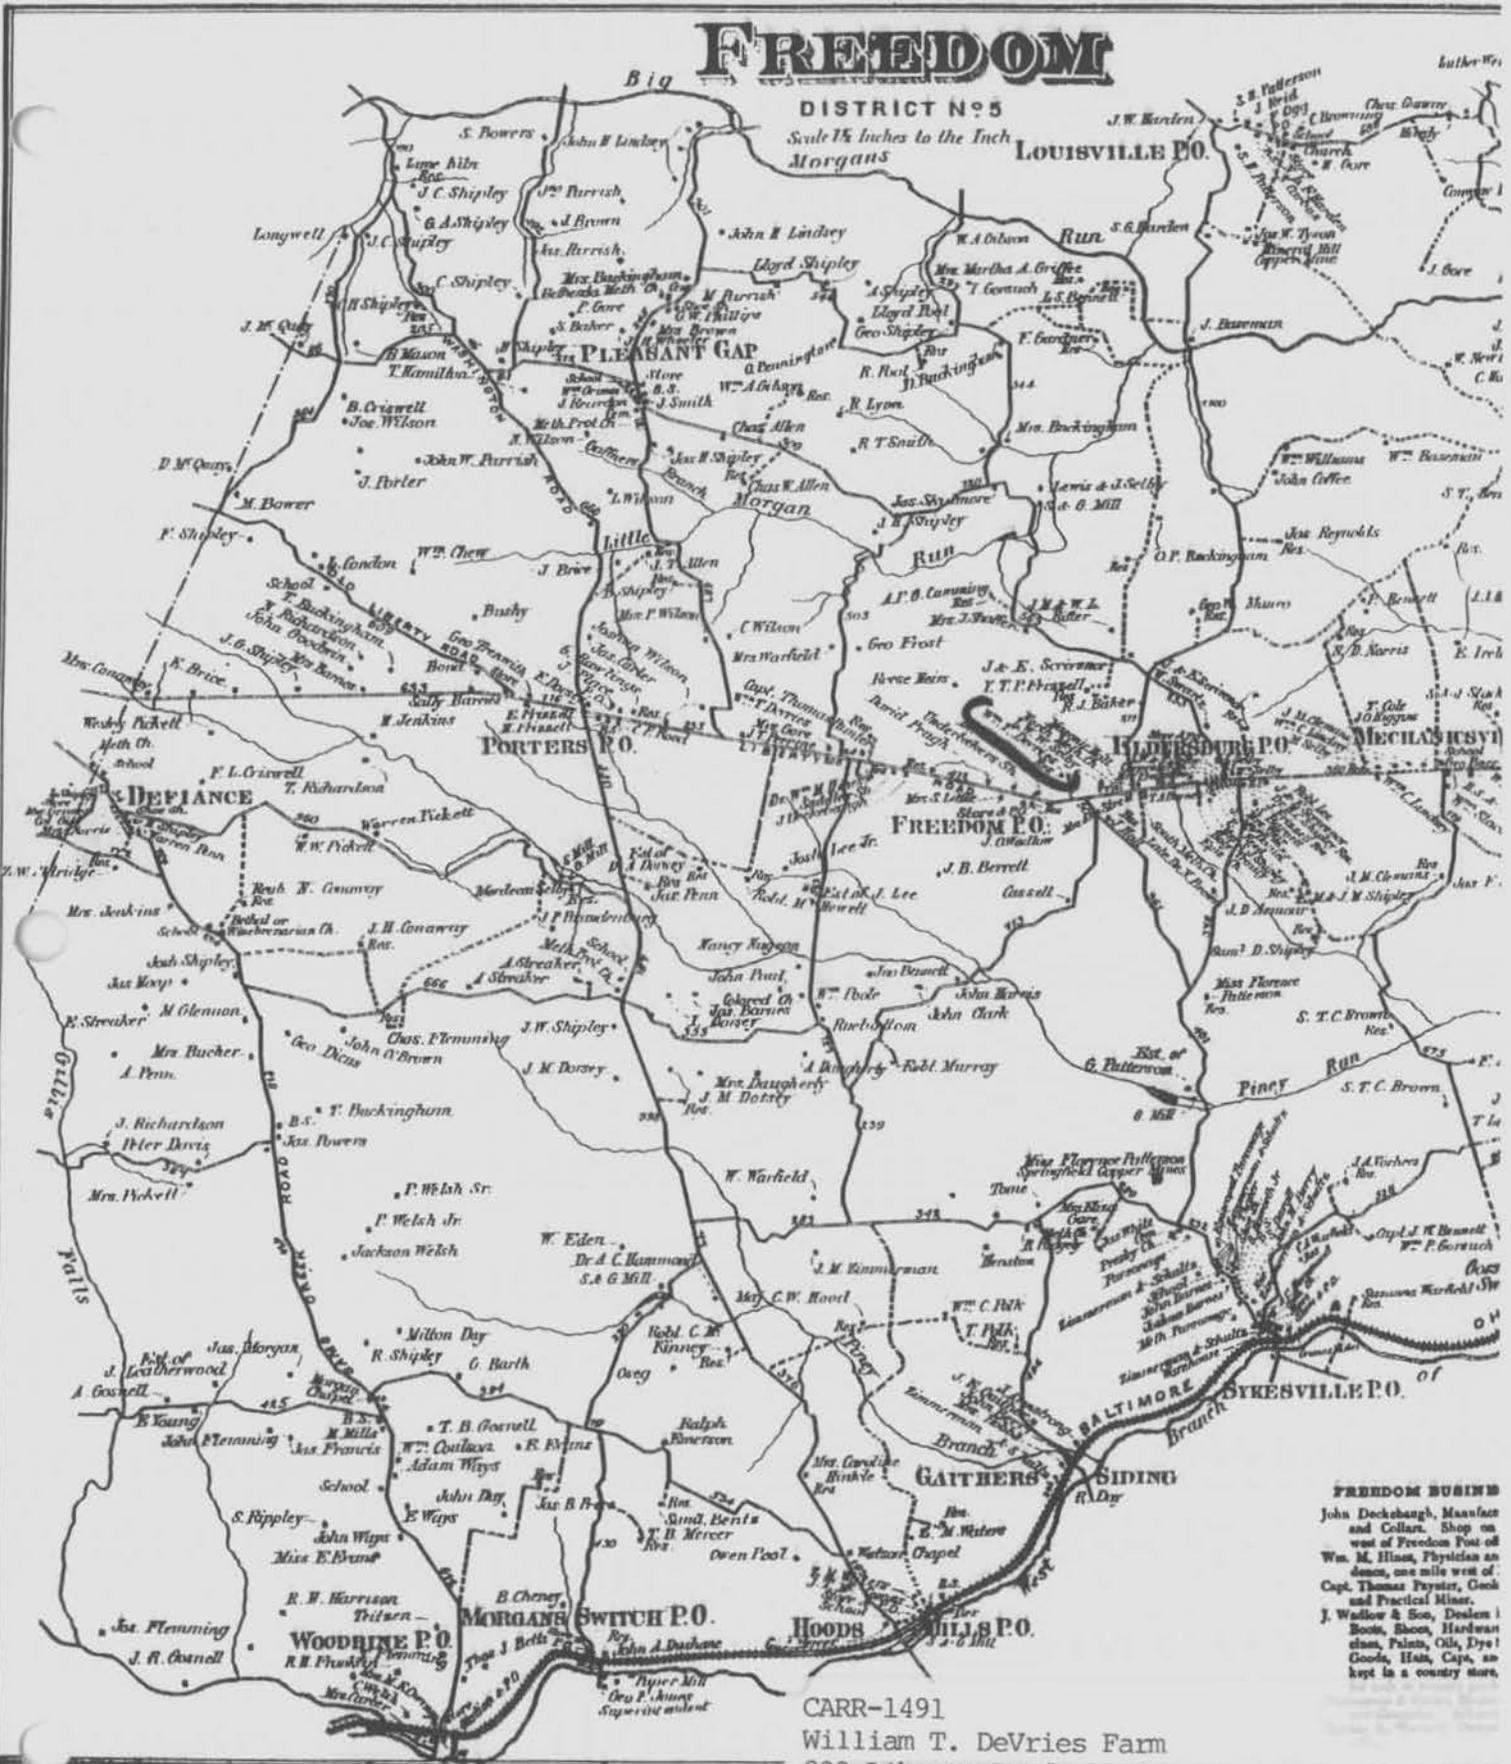

FREEDOM BUSINESS
John Deckbaugh, Manufacturer and Collar Shop on west of Freedom Post office
Wm. M. Hines, Physician and Surgeon, one mile west of
Capt. Thomas Fryzier, Cook and Practical Miner.
J. Wadlow & Son, Dealers in Boots, Shoes, Hardware, Glass, Paints, Oils, Dye, Goods, Hats, Caps, as kept in a country store.


CARR-1491
William T. DeVries Farm
800 Liberty Road

Lake, Griffin & Stevenson Atlas, 1877

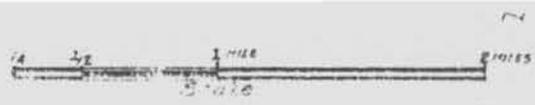


EXPLANATION

- STATE HIGHWAY
- ROAD
- RAILROAD
- SCHOOL
- CHURCH
- CEMETERY
- CITY OR VILLAGE BOUNDARY
- WATER MAIN
- WATER MAIN BREAK
- WATER MAIN
- WATER MAIN

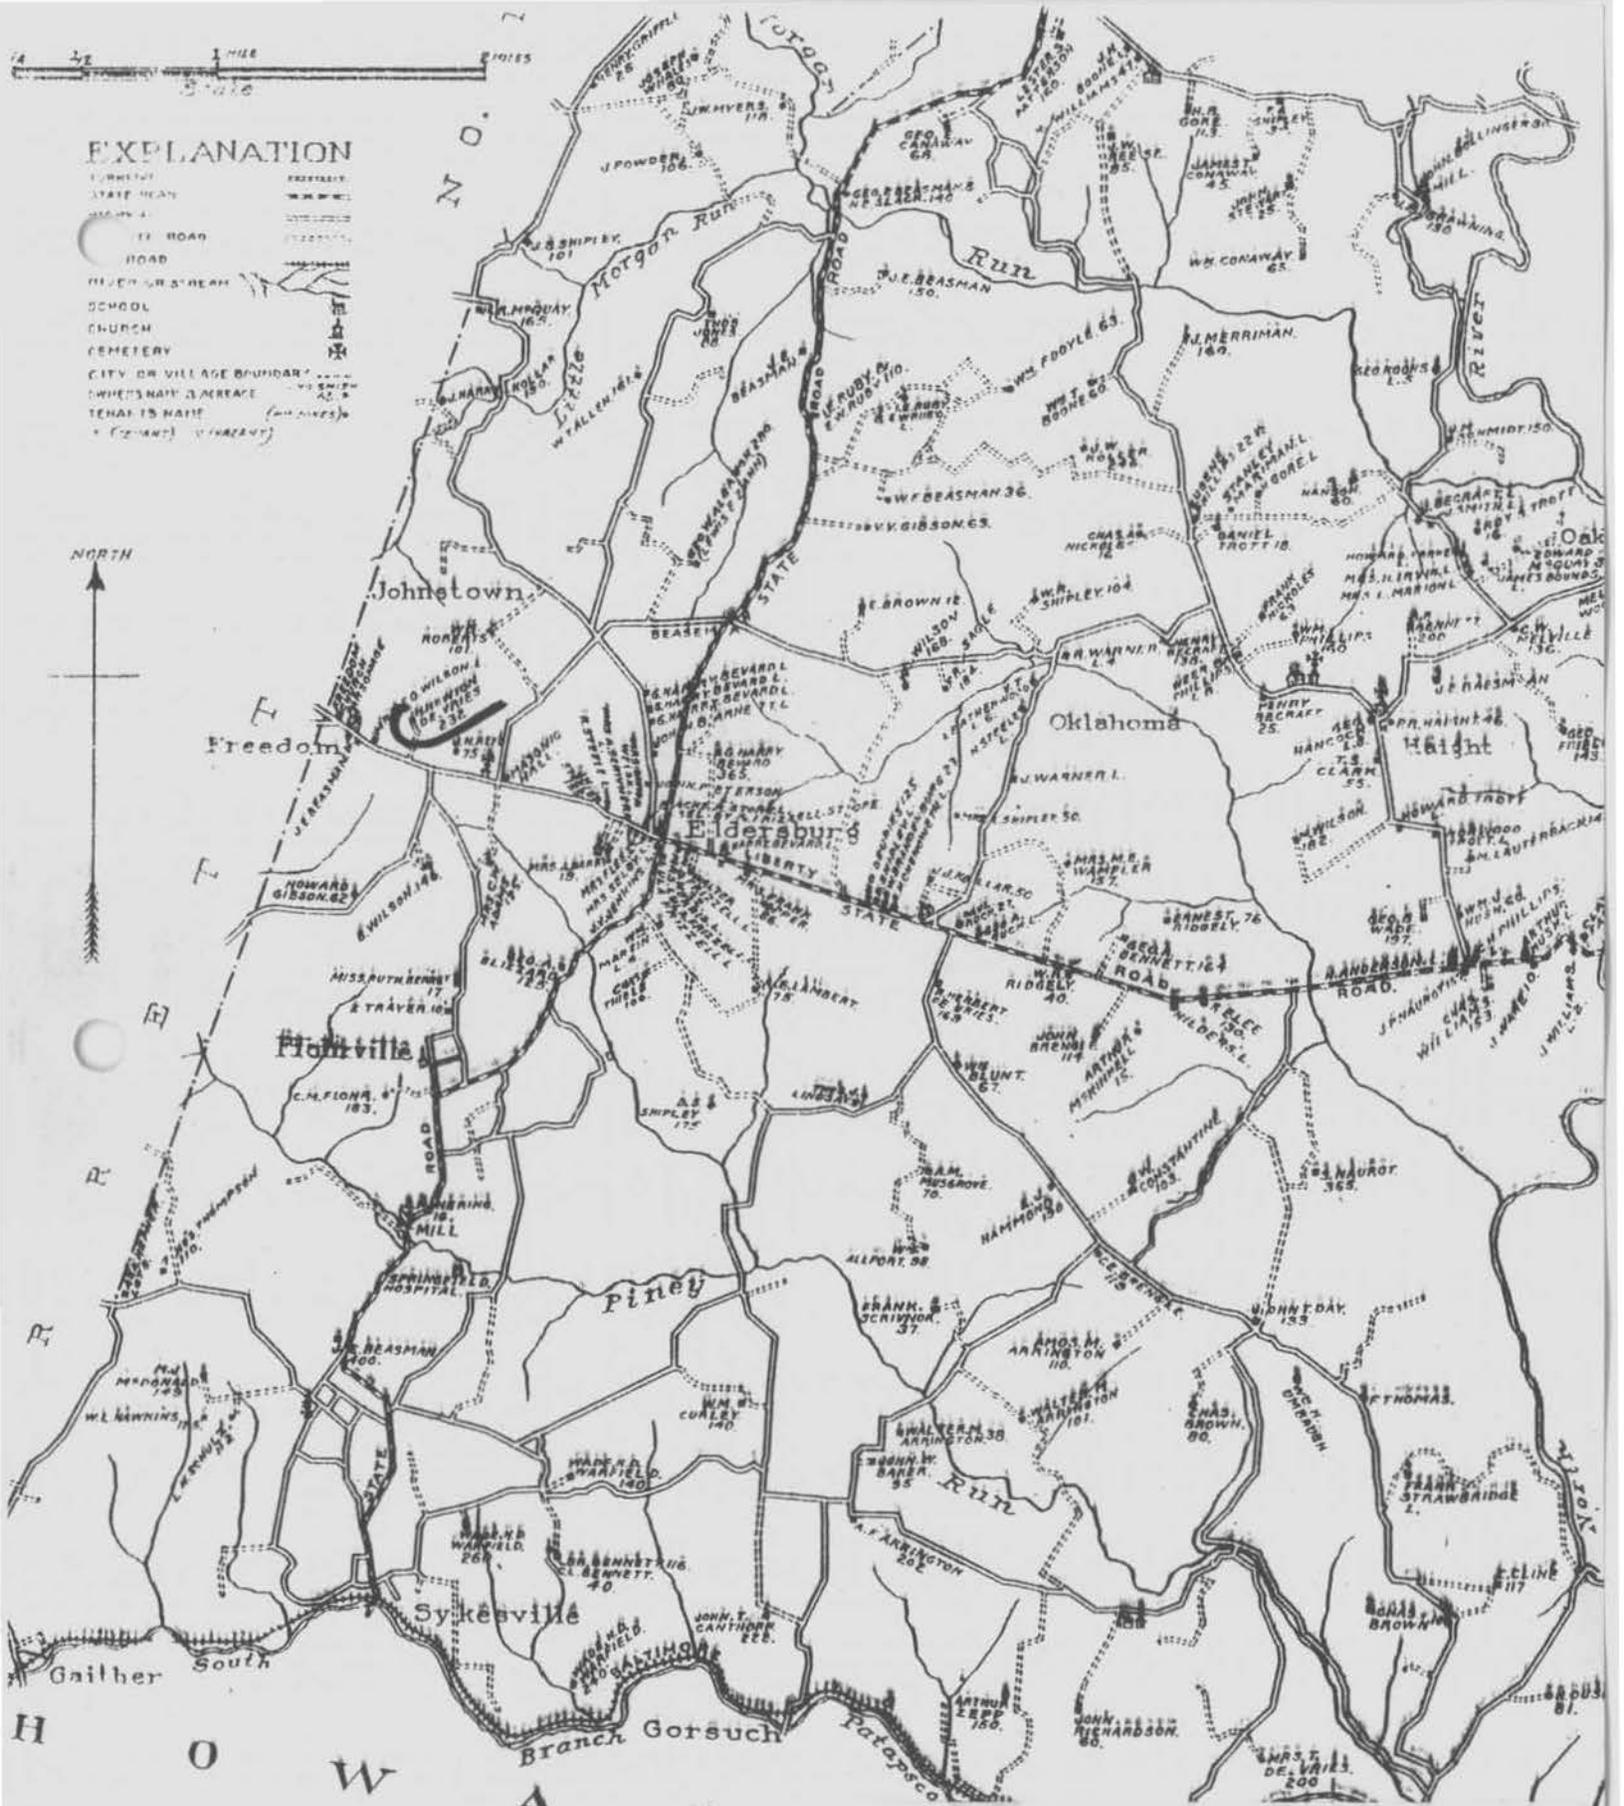

CARR-1491
 William T. DeVries Farm
 800 Liberty Road

Rand McNally Map, 1917

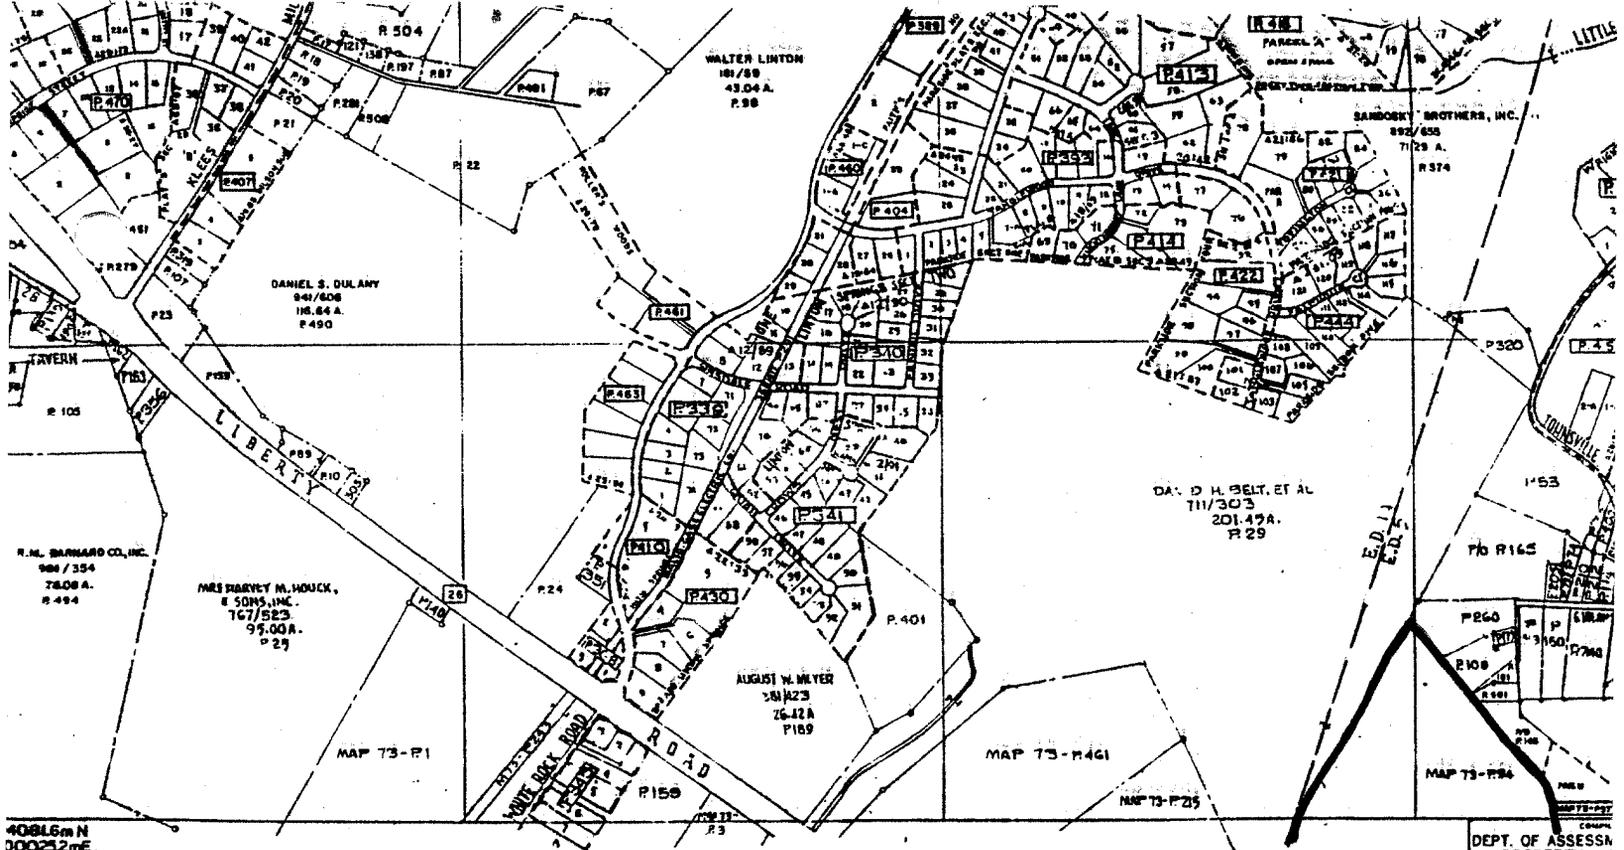

40816m N
000252m E

COPYRIGHT MAP DIVISION - 1967
MD DEPT OF ASSESS & TAX

803


806

809

DEPT. OF ASSESSMENT
PROPERTY M
THE INFORMATION SHOWN
ON THIS MAP IS FOR
GENERAL INFORMATION
AND SHOULD NOT BE
USED FOR
LEGAL PURPOSES
REVISED TO: MAY

0


(73)

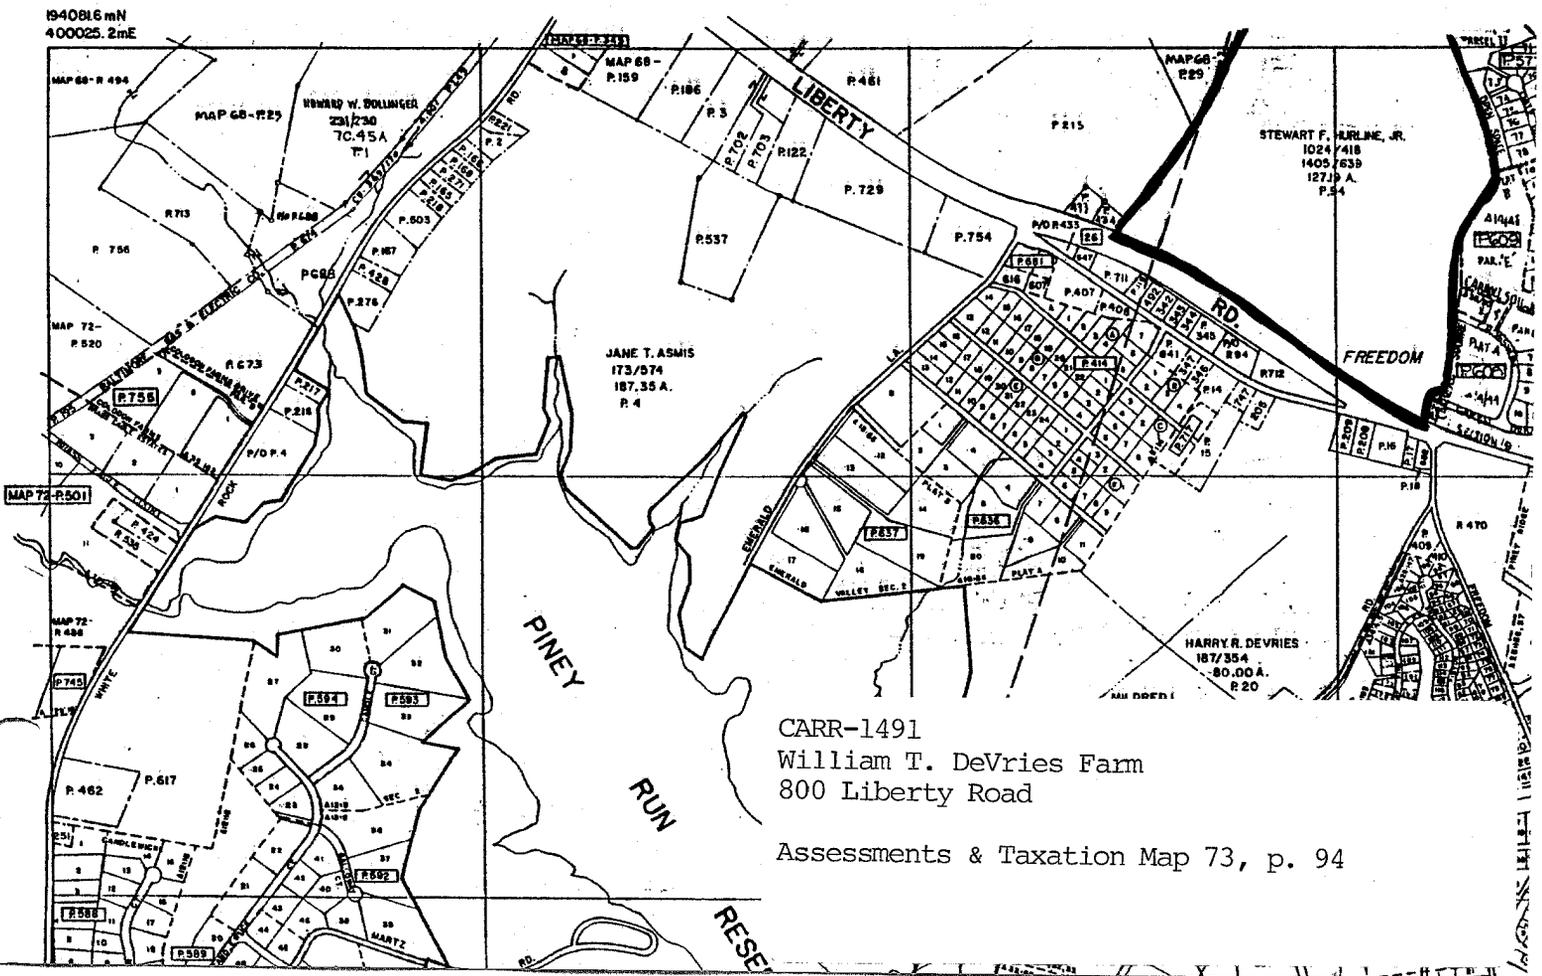

1940816m N
400025.2m E

CARR-1491
William T. DeVries Farm
800 Liberty Road

Assessments & Taxation Map 73, p. 94

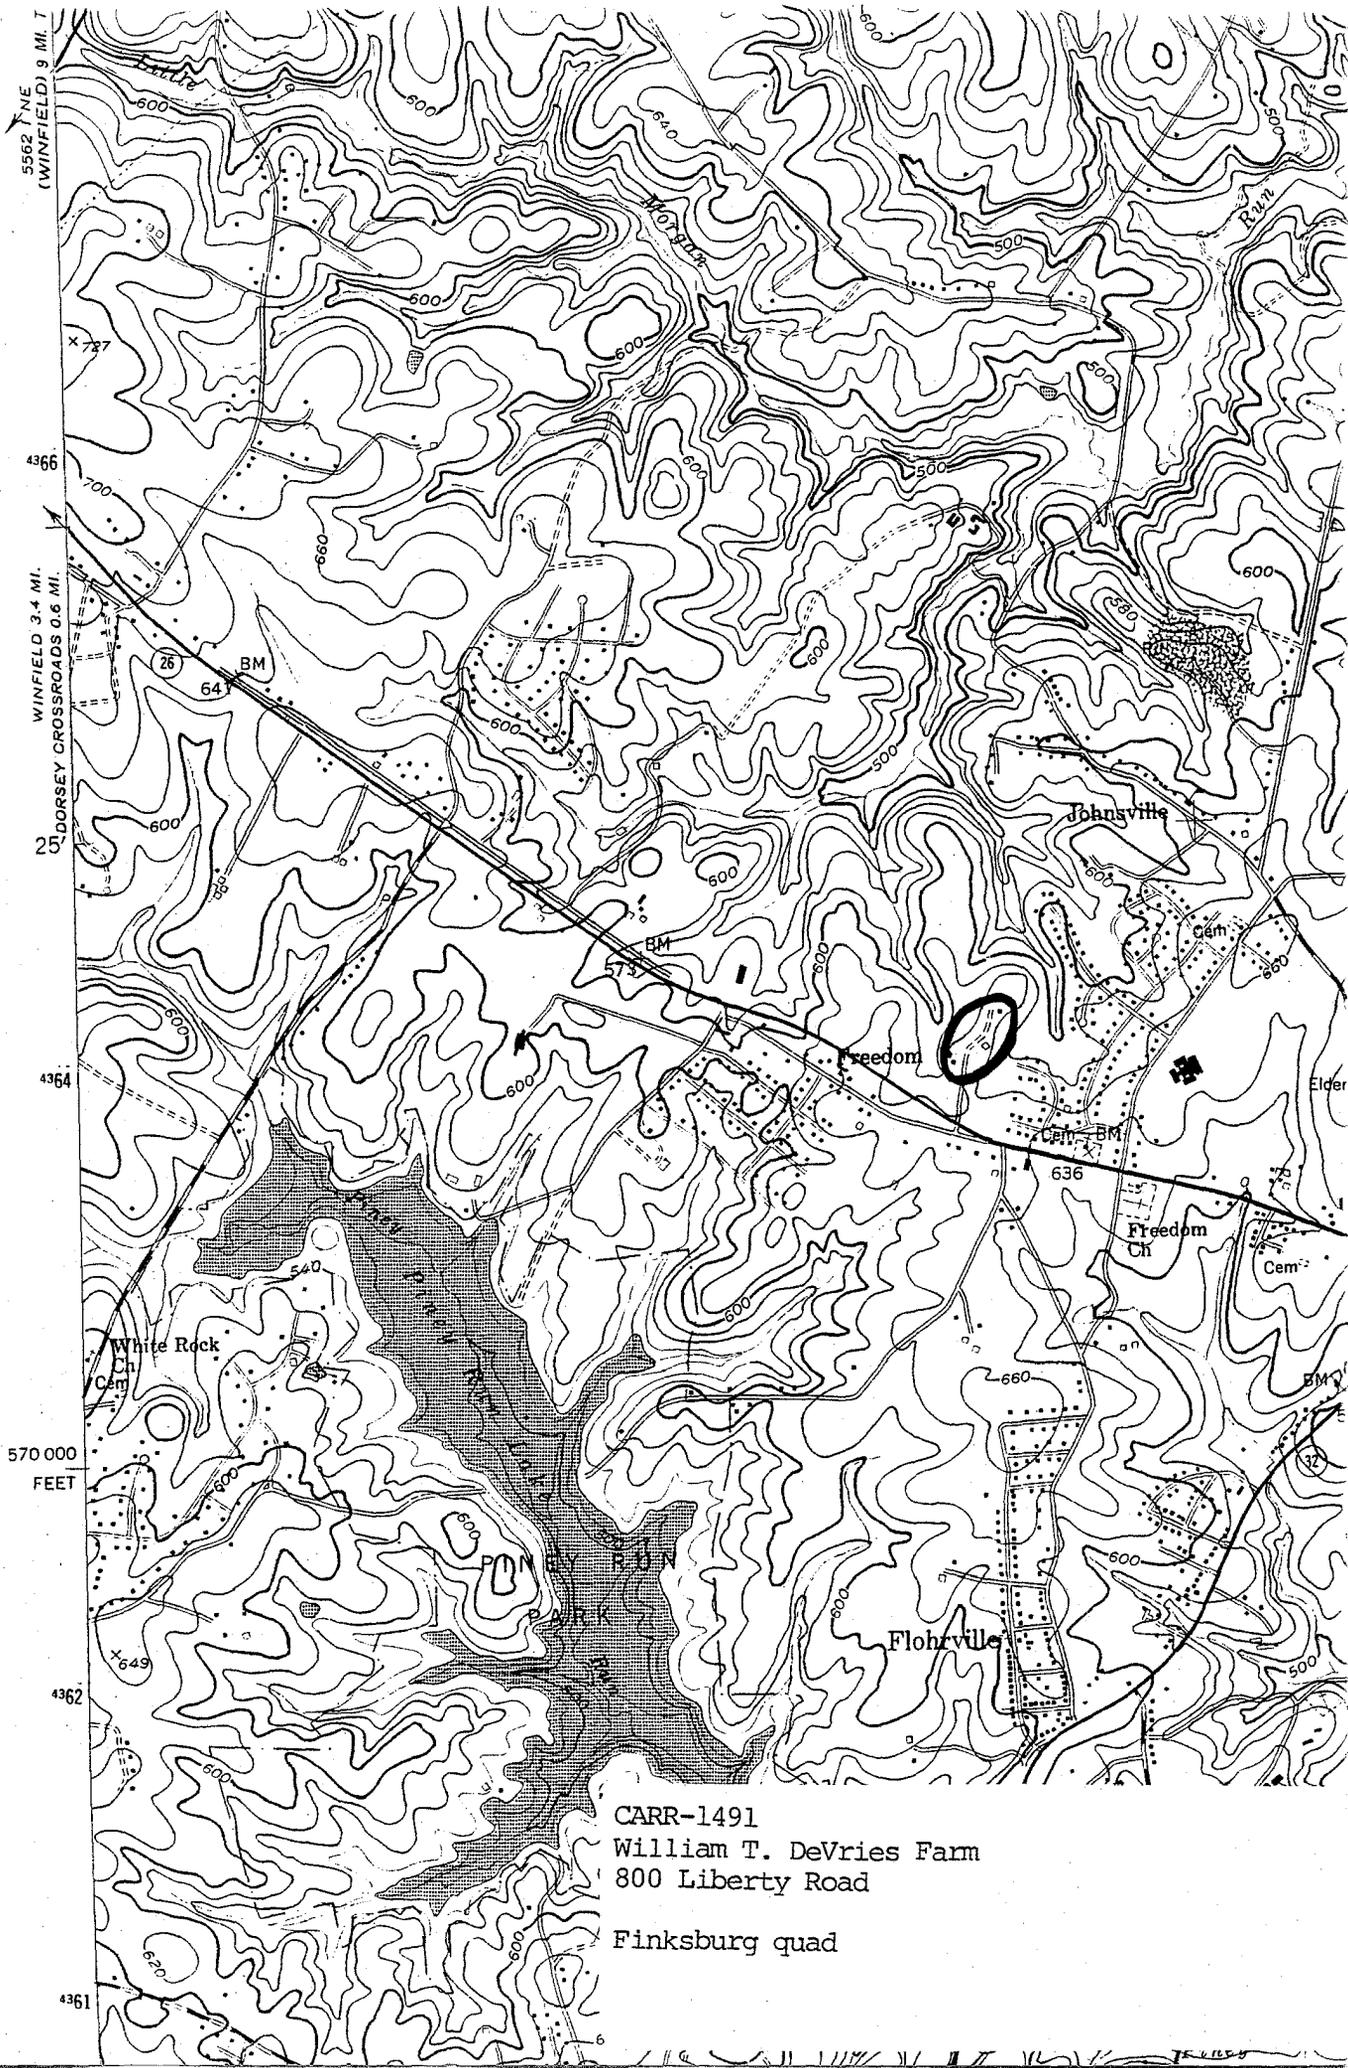

5562 T NE
(WINFIELD) 9 MI. T

WINFIELD 3.4 MI.
CLIPBORSEY CROSSROADS 0.6 MI.

570 000
FEET

CARR-1491
William T. DeVries Farm
800 Liberty Road
Finksburg quad



William T. DeVries Farm

800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: Sept. 1995

Neg. loc.: Maryland Historical Trust

SW 1/4 NW elevs.

1/10



William T. DeVries Farm

800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: Sept. 1995

Neg. loc.: Maryland Historical Trust

SE & NE elevs.

2/10



William T. DeVries Farm
800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: September 1995

Neg. Loc.: Maryland Historical Trust
Stairway

3/10



CARR-1491

William T. DeVries Farm

800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: September 1995

Neg. Loc.: Maryland Historical Trust

Stair brackets

9/10



William T. DeVries Farm
800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: September 1995

Neg. Loc.: Maryland Historical Trust
SE room mantel

5/10



CARR-1491

William T. DeVries Farm

800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: Sept. 1995

Neg. loc.: Maryland Historical Trust

SE room jib window

6/10

72 0111 N N 42 2 19 06



William T. DeVries Farm

CARR-1491

800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short


Date: Sept. 1995

Neg. Loc.: Maryland Historical Trust

NW room mantel

7/10

720111 NN M2217 02

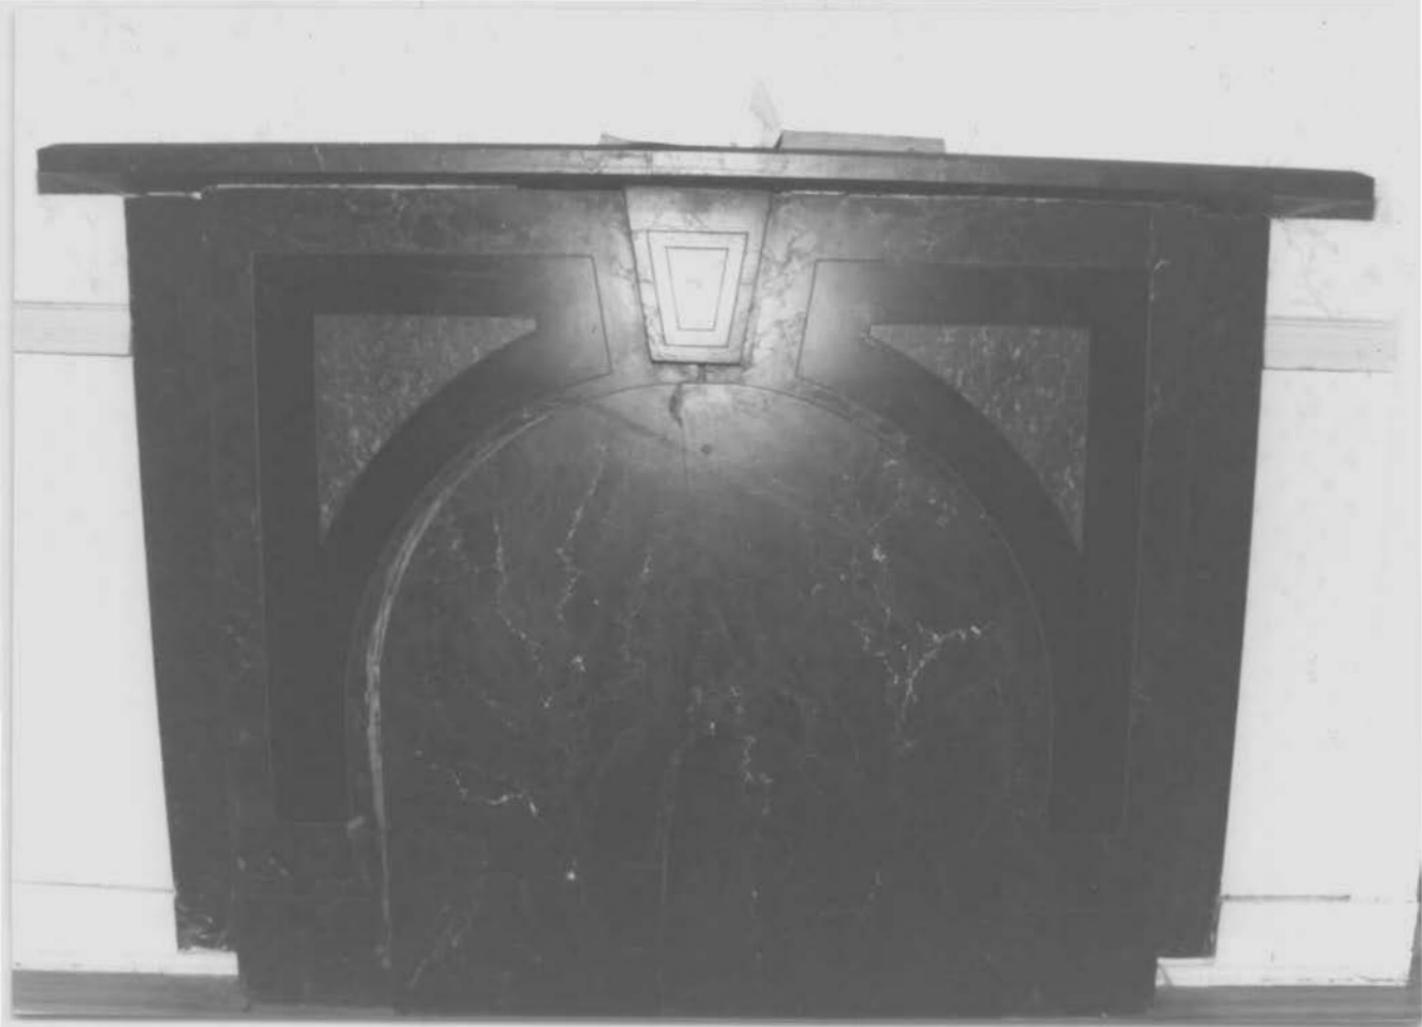

CARR-1491

William T. DeVries Farm

800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: Sept. 1995

Neg. Loc.: Maryland Historical Trust
center room mantel

8/10

720111 N N N-22 1803



CAPR-1491

William T. DeVries Farm

800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: Sept. 1995

Neg Loc.: Maryland Historical Trust

grained door in attic

9/10



CARR-1491

William T. DeVries Farm
800 Liberty Rd.

Carroll County, Maryland

Photo: Kenneth M. Short

Date: Sept. 1995

Neg. Loc.: Maryland Historical Trust
outbuildings - SE elevs.

10/10