

7. Description

Survey No. CARR-1503

Condition

excellent deteriorated
 good ruins
 fair unexposed

Check one

unaltered
 altered

Check one

original site
 moved date of move _____

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

The Shindler House is a two-and-a-half story farmhouse with English barn, and two modern storage structures. The complex forms a No Courtyard Layout.

House (1860-1900)

The 2-1/2 story, three bay by two bay, clapboard house is covered in vinyl siding with a metal gable roof and cornice returns. An interior brick chimney is located on the west gable end and the roof ridge line is parallel to the road. A pedimented roof entry porch is located on the main [north] facade and a first floor bay window has been constructed on the west elevation. The fenestration pattern is irregular with one-over-one wood, double-hung windows on all first story elevations; six-over-six windows on the second story all elevations, a small diamond shaped 4 lite window on the center bay of the upper level, north facade. The windows on the upper level, gable ends are unusual with a group of three four-over-one sash.

A 2 story, shed roof addition is affixed to the south elevation. Three bays by two bays the addition has an enclosed shed affixed to its west elevation and a partially enclosed first floor porch traversing the east elevation of the main block and addition.

Barn (1870-1900)

The 2-1/2 story frame on fieldstone foundation English barn is located to the west of the main house. Two bays by two bays with a metal gable roof perpendicular to the road. Wood ventilator windows are located on the east and west elevations. Diamond shaped with a saw tooth dentil border and a ring in the center, the ventilators are unusual for the project area

Contributing Resources: 2

8. Significance

Survey No. CARR-1503

Period	Areas of Significance - Check and justify below			
<input type="checkbox"/> prehistoric	<input type="checkbox"/> archeology-prehistoric	<input type="checkbox"/> community planning	<input type="checkbox"/> landscape architecture	<input type="checkbox"/> religion
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> archeology-historic	<input type="checkbox"/> conservation	<input type="checkbox"/> law	<input type="checkbox"/> science
<input type="checkbox"/> 1500-1599	<input type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> literature	<input type="checkbox"/> sculpture
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> architecture	<input type="checkbox"/> education	<input type="checkbox"/> military	<input type="checkbox"/> social/
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> art	<input type="checkbox"/> engineering	<input type="checkbox"/> music	<input type="checkbox"/> humanitarian
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> commerce	<input type="checkbox"/> exploration/settlement	<input type="checkbox"/> philosophy	<input type="checkbox"/> theater
<input type="checkbox"/> 1900-	<input type="checkbox"/> communications	<input type="checkbox"/> industry	<input type="checkbox"/> politics/government	<input type="checkbox"/> transportation
		<input type="checkbox"/> invention		<input type="checkbox"/> other(specify)

Specific dates 1860-1900

Builder/Architect

Applicable Criteria: A B C D
and/or

Applicable Exception: A B C D E F G

Level of Significance: national state local

Prepare both a summary paragraph of significance and a general statement of history and support.

The Shindler House is a typical rural vernacular, "I" House plan farmhouse. It has been modernized throughout the years by Victorian additions and twentieth century modifications. Except for the small English barn all original outbuildings have been demolished.

The house is probably part of the Herbock property listed on the 1862 Martenet Atlas. It also appears on the Lake, Griffing and Stevenson Atlas with the owner's name blurred.

Evaluation:

The property is not eligible under Criterion A; no significant events historically or agriculturally have been determined to be associated with the property. The property is not eligible under Criterion B; no persons significant in local, state or national history have been determined to have been associated with the property. The property is not eligible under Criterion C; the property is not a significant example of its type, design or manner of construction. There are more significant and intact examples within the project area.

MARYLAND HISTORICAL TRUST

Eligibility recommended _____
Comments _____

Eligibility not recommended _____

Reviewer, OPS: *[Signature]*
Reviewer, NR Program: *[Signature]*

Date: *4/16/98*
Date: *u/l*

[Handwritten mark]

Major Bibliographical References

Dornbusch, Charles H. and J.K. Heyl

1965 *Pennsylvania German Barns*, Vol. 31 Pennsylvania Folklore Society. Allentown, Pa.

Getty, Joe

1987 *Carroll's Heritage*, Essays on the Architecture of a Piedmont Maryland County. The County Commissioners of Carroll County and the Historical Society of County Co., Westminster, MD

Glassie, Henry

1968 *Patterns in the Material Folk Culture of the Eastern United States*. Philadelphia: University of Pennsylvania Press.

Lake, Griffing and Stevenson

1877 *An Illustrated Atlas of Carroll County, Maryland*. Lake, Griffing and Stevenson, Philadelphia.

Lee, Carol

1982 *Legacy of the Land*. 250 Years of Agriculture in Carroll County Maryland. The Carroll County Commissioners. Westminster, Maryland.

Lord, Arthur

1975 *Pre-Revolutionary Agriculture of Lancaster County, Pennsylvania*. Journal of the Lancaster County Historical Society Vol. 79, No. 1.

Martenet, Simon J.

1861 *Martenet's Map of Carroll County, Maryland*. Simon J. Martenet, Baltimore.

Noble, Allen G.

1984 *Wood, Brick and Stone: The North American Settlement Landscapes - Volumes One and Two*. Amherst, MA: University of Massachusetts Press.

Pillsbury, Richard

1977 *Patterns in the Folk and Vernacular House Forms of the Pennsylvania Cultural Region*. Pioneer America, Vol. 9.

Rand Mc Nally

1916 *Manchester, Election District No.6, Carroll Co., Md.*

Tracey, Dr. Arthur G.,

1937 *Land Grants of Carroll County -- Some Things We Learn from Them*. The Times, May 28th.

Maryland Historic Preservation Plan Historic Contexts:


Geographic Organization: Piedmont

Chronological/Development Periods: Agricultural-Industrial - AD 1815-1870
Industrial/Urban Dominance 1870-1930

Historic Period Themes: Architecture

Resource Types: Farmstead


NO COURTYARD
CARR-1503

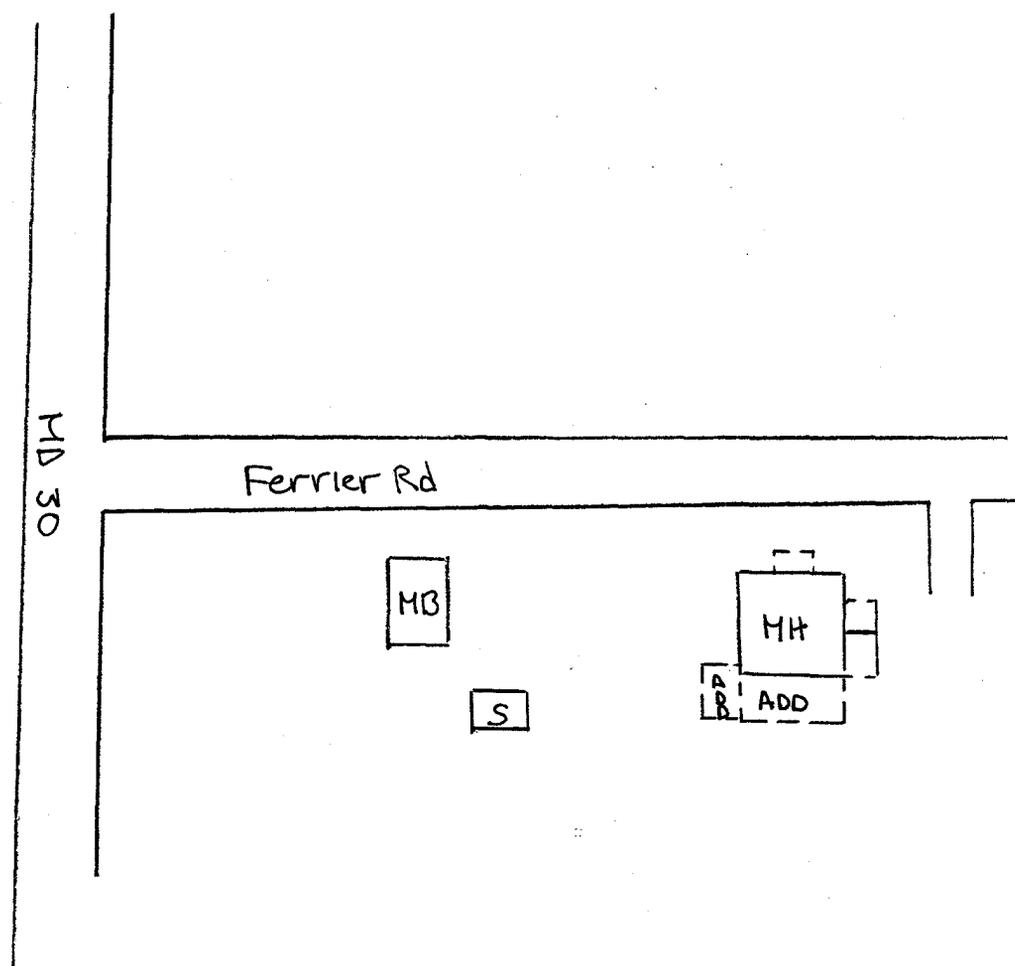

CARR-1503
John Herboch Farm
Manchester vicinity
Carroll County
Manchester Quad

SITE PLAN ABBREVIATIONS

ADD	-	Addition
CC	-	Corn Crib
CH	-	Carriage House
CKH	-	Chicken House
CS	-	Cow Stalls
G	-	Garage
GR	-	Generator Room
HP	-	Hog Pens
MB	-	Main Barn
MH	-	Main House
MR	-	Milk Room
OB	-	Outbuilding
OH	-	Outhouse
PH	-	Pump House
RC	-	Root Cellar
S	-	Shed
SB	-	Secondary Barn
SH	-	Summer House
SK	-	Summer Kitchen
SPH	-	Spring House
ST	-	Stables
TH	-	Tenant House
W	-	Well

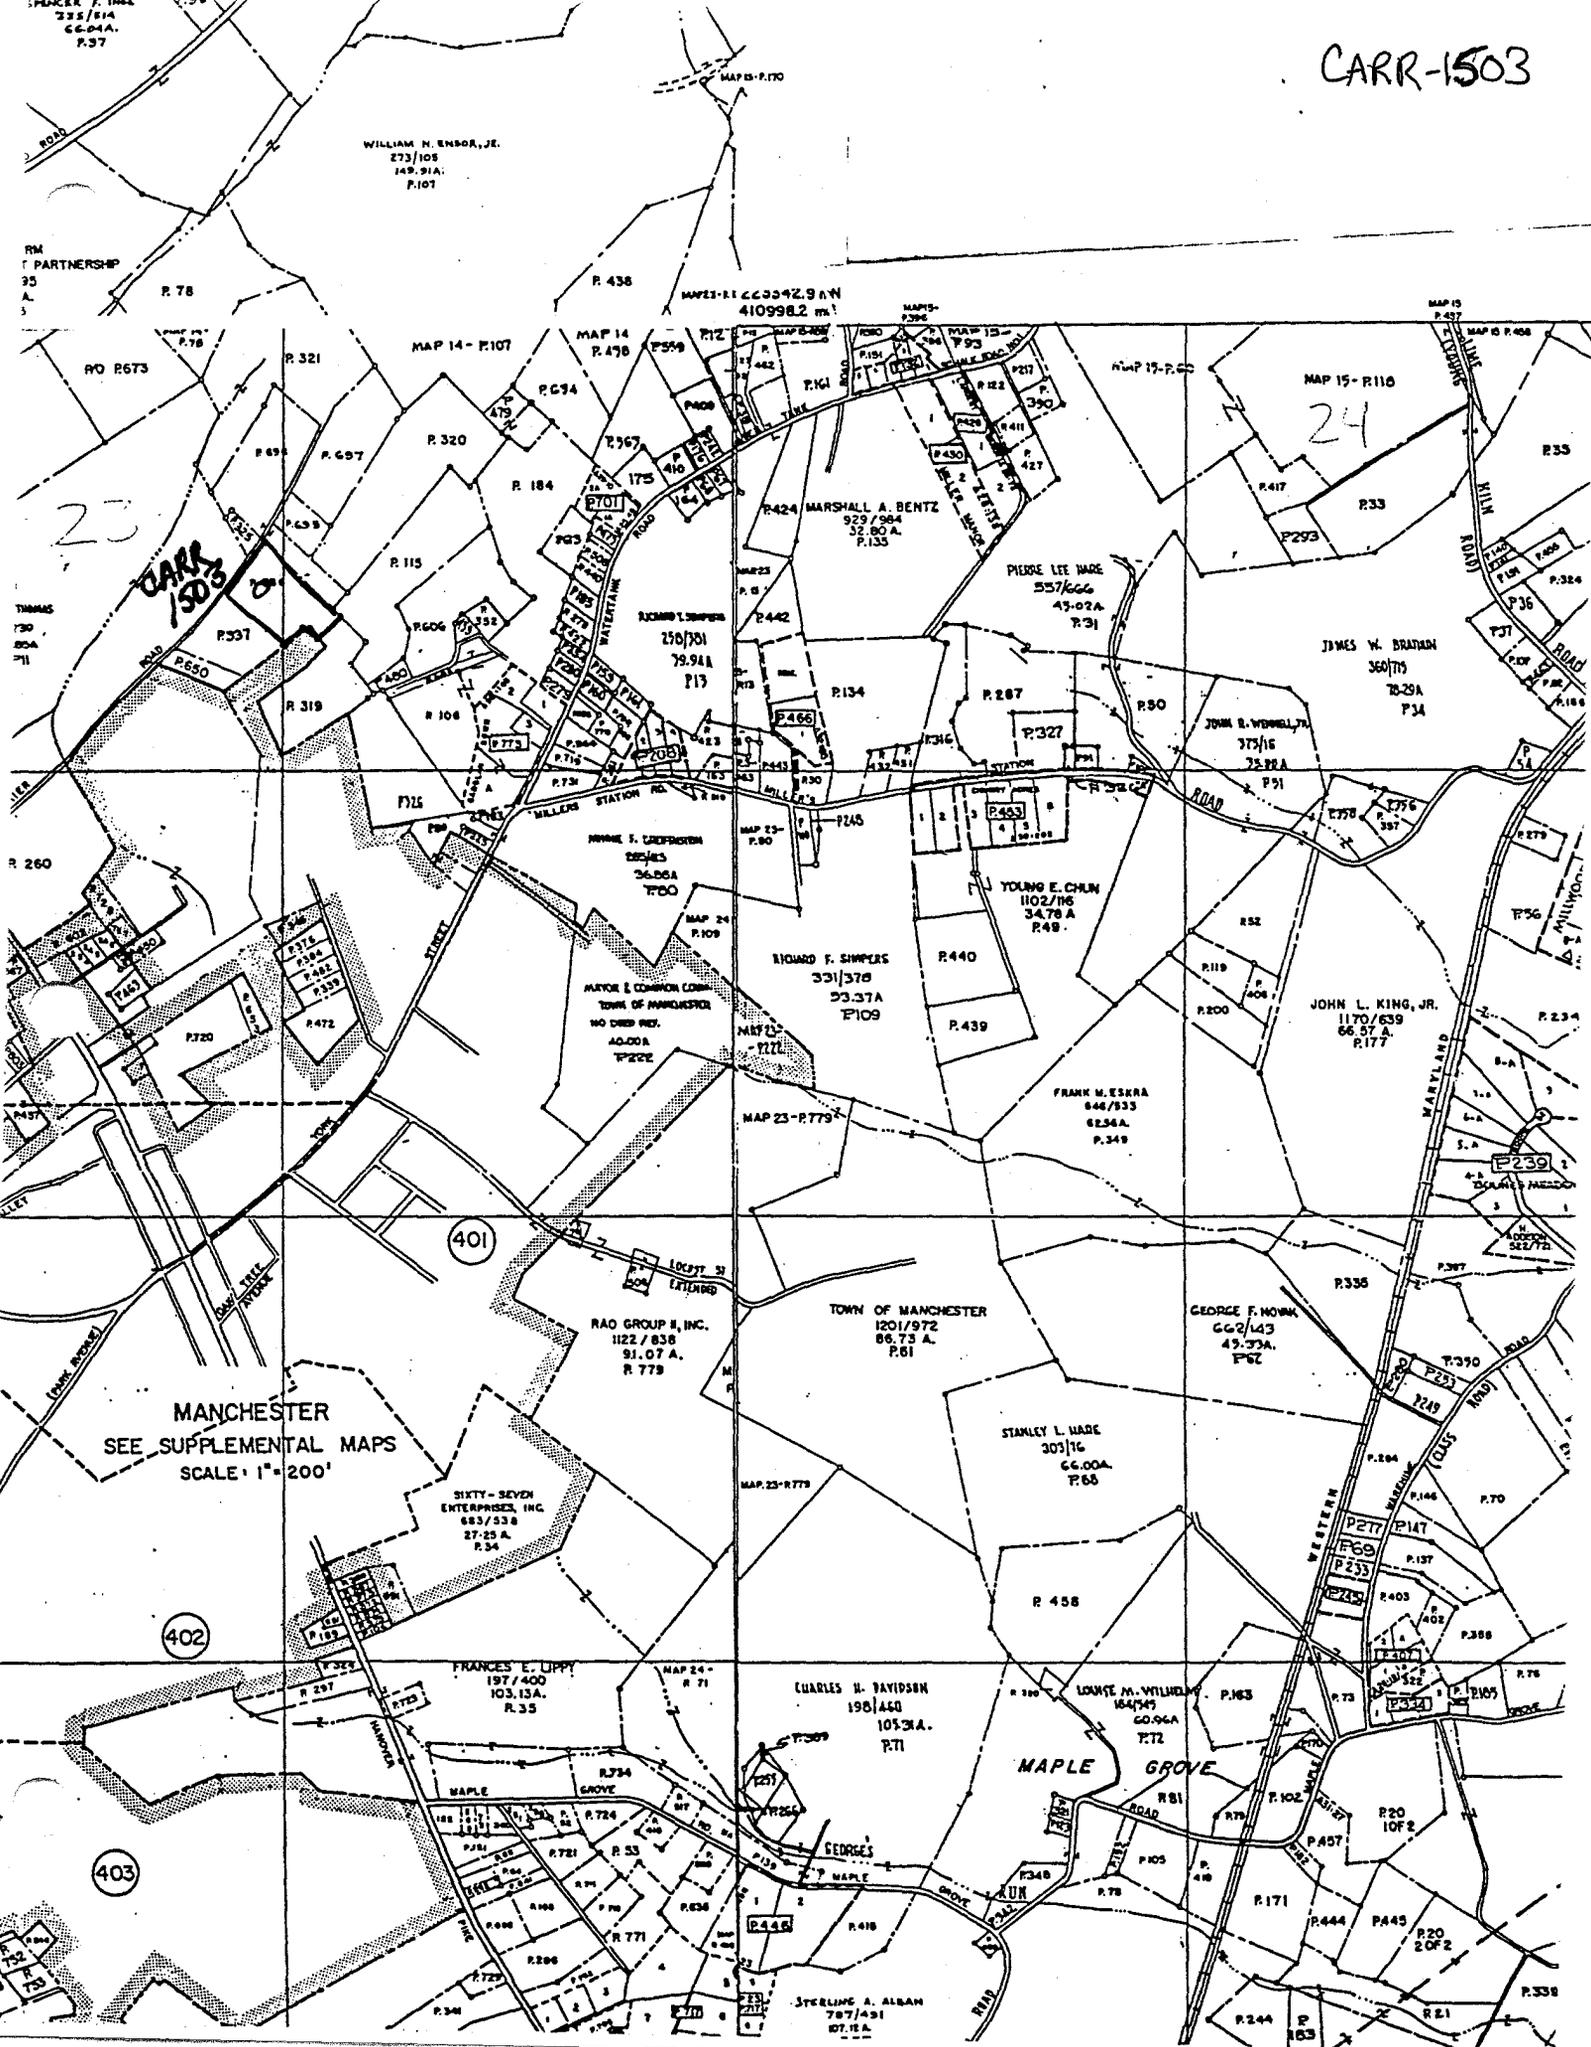

WILLIAM N. EMBOR, JR.
273/105
149.91A.
P.107

MAPS-11 66342.9 A N
410998.2 m²

24

23

CARR 1503

MANCHESTER
SEE SUPPLEMENTAL MAPS
SCALE: 1" = 200'

RAO GROUP II, INC.
1122/838
91.07 A.
R. 778

TOWN OF MANCHESTER
1201/972
86.73 A.
P.61

GEORGE F. HOWK
662/443
45.37A.
P.62

STANLEY L. WARE
303/16
66.00A.
P.65

FRANCES L. LIPPY
197/400
103.15A.
R. 35

CHARLES H. DAVIDSON
198/460
105.3A.
P.71

MAPLE GROVE

STERLING A. ALBAN
787/251
87.16A.

402

403

401

RM PARTNERSHIP
35 A.
P. 5

THOMAS
730
304
711

R. 260

MAP 15

MAP 14

MAP 13

MAP 12

MAP 11

MAP 10

MAP 9

MAP 8

MAP 7

MAP 6

MAP 5

MAP 4

MAP 3

MAP 2

MAP 1

MAP 0

MAP -1

MAP -2

MAP -3

MAP -4

MAP -5

MAP -6

MAP -7

MAP -8

MAP -9

MAP -10

MAP -11

MAP -12

MAP -13

MAP -14

MAP -15

MAP -16

MAP -17

MAP -18

MAP -19

MAP -20

MAP -21

MAP -22

MAP -23

MAP -24

MAP -25

MAP -26

MAP -27

MAP -28

MAP -29

MAP -30

MAP -31

MAP -32

MAP -33

MAP -34

MAP -35

MAP -36

MAP -37

MAP -38

MAP -39

MAP -40

MAP -41

MAP -42

MAP -43

MAP -44

MAP -45

MAP -46

MAP -47

MAP -48

MAP -49

MAP -50

MAP -51

MAP -52

MAP -53

MAP -54

MAP -55

MAP -56

MAP -57

MAP -58

MAP -59

MAP -60

MAP -61

MAP -62

MAP -63

MAP -64

MAP -65

MAP -66

MAP -67

MAP -68

MAP -69

MAP -70

MAP -71

MAP -72

MAP -73

MAP -74

MAP -75

MAP -76

MAP -77

MAP -78

MAP -79

MAP -80

MAP -81

MAP -82

MAP -83

MAP -84

MAP -85

MAP -86

MAP -87

MAP -88

MAP -89

MAP -90

MAP -91

MAP -92

MAP -93

MAP -94

MAP -95

MAP -96

MAP -97

MAP -98

MAP -99

MAP -100

MAP -101

MAP -102

MAP -103

MAP -104

MAP -105

MAP -106

MAP -107

MAP -108

MAP -109

MAP -110

MAP -111

MAP -112

MAP -113

MAP -114

MAP -115

MAP -116

MAP -117

MAP -118

MAP -119

MAP -120

MAP -121

MAP -122

MAP -123

MAP -124

MAP -125

MAP -126

MAP -127

MAP -128

MAP -129

MAP -130

MAP -131

MAP -132

MAP -133

MAP -134

MAP -135

MAP -136

MAP -137

MAP -138

MAP -139

MAP -140

MAP -141

MAP -142

MAP -143

MAP -144

MAP -145

MAP -146

MAP -147

MAP -148

MAP -149

MAP -150

MAP -151

MAP -152

MAP -153

MAP -154

MAP -155

MAP -156

MAP -157

MAP -158

MAP -159

MAP -160

MAP -161

MAP -162

MAP -163

MAP -164

MAP -165

MAP -166

MAP -167

MAP -168

MAP -169

MAP -170

MAP -171

MAP -172

MAP -173

MAP -174

MAP -175

MAP -176

MAP -177

MAP -178

MAP -179

MAP -180

MAP -181

MAP -182

MAP -183

MAP -184

MAP -185

MAP -186

MAP -187

MAP -188

MAP -189

MAP -190

MAP -191

MAP -192

MAP -193

MAP -194

MAP -195

MAP -196

MAP -197

MAP -198

MAP -199

MAP -200

MAP -201

MAP -202

MAP -203

MAP -204

MAP -205

MAP -206

MAP -207

MAP -208

MAP -209

MAP -210

MAP -211

MAP -212

MAP -213

MAP -214

MAP -215

MAP -216

MAP -217

MAP -218

MAP -219

MAP -220

MAP -221

MAP -222

MAP -223

MAP -224

MAP -225

MAP -226

MAP -227

MAP -228

MAP -229

MAP -230

MAP -231

MAP -232

MAP -233

MAP -234

MAP -235

MAP -236

MAP -237

MAP -238

MAP -239

MAP -240

MAP -241

MAP -242

MAP -243

MAP -244




MAP -245

MAP -246

MAP -247

MAP -248

MAP

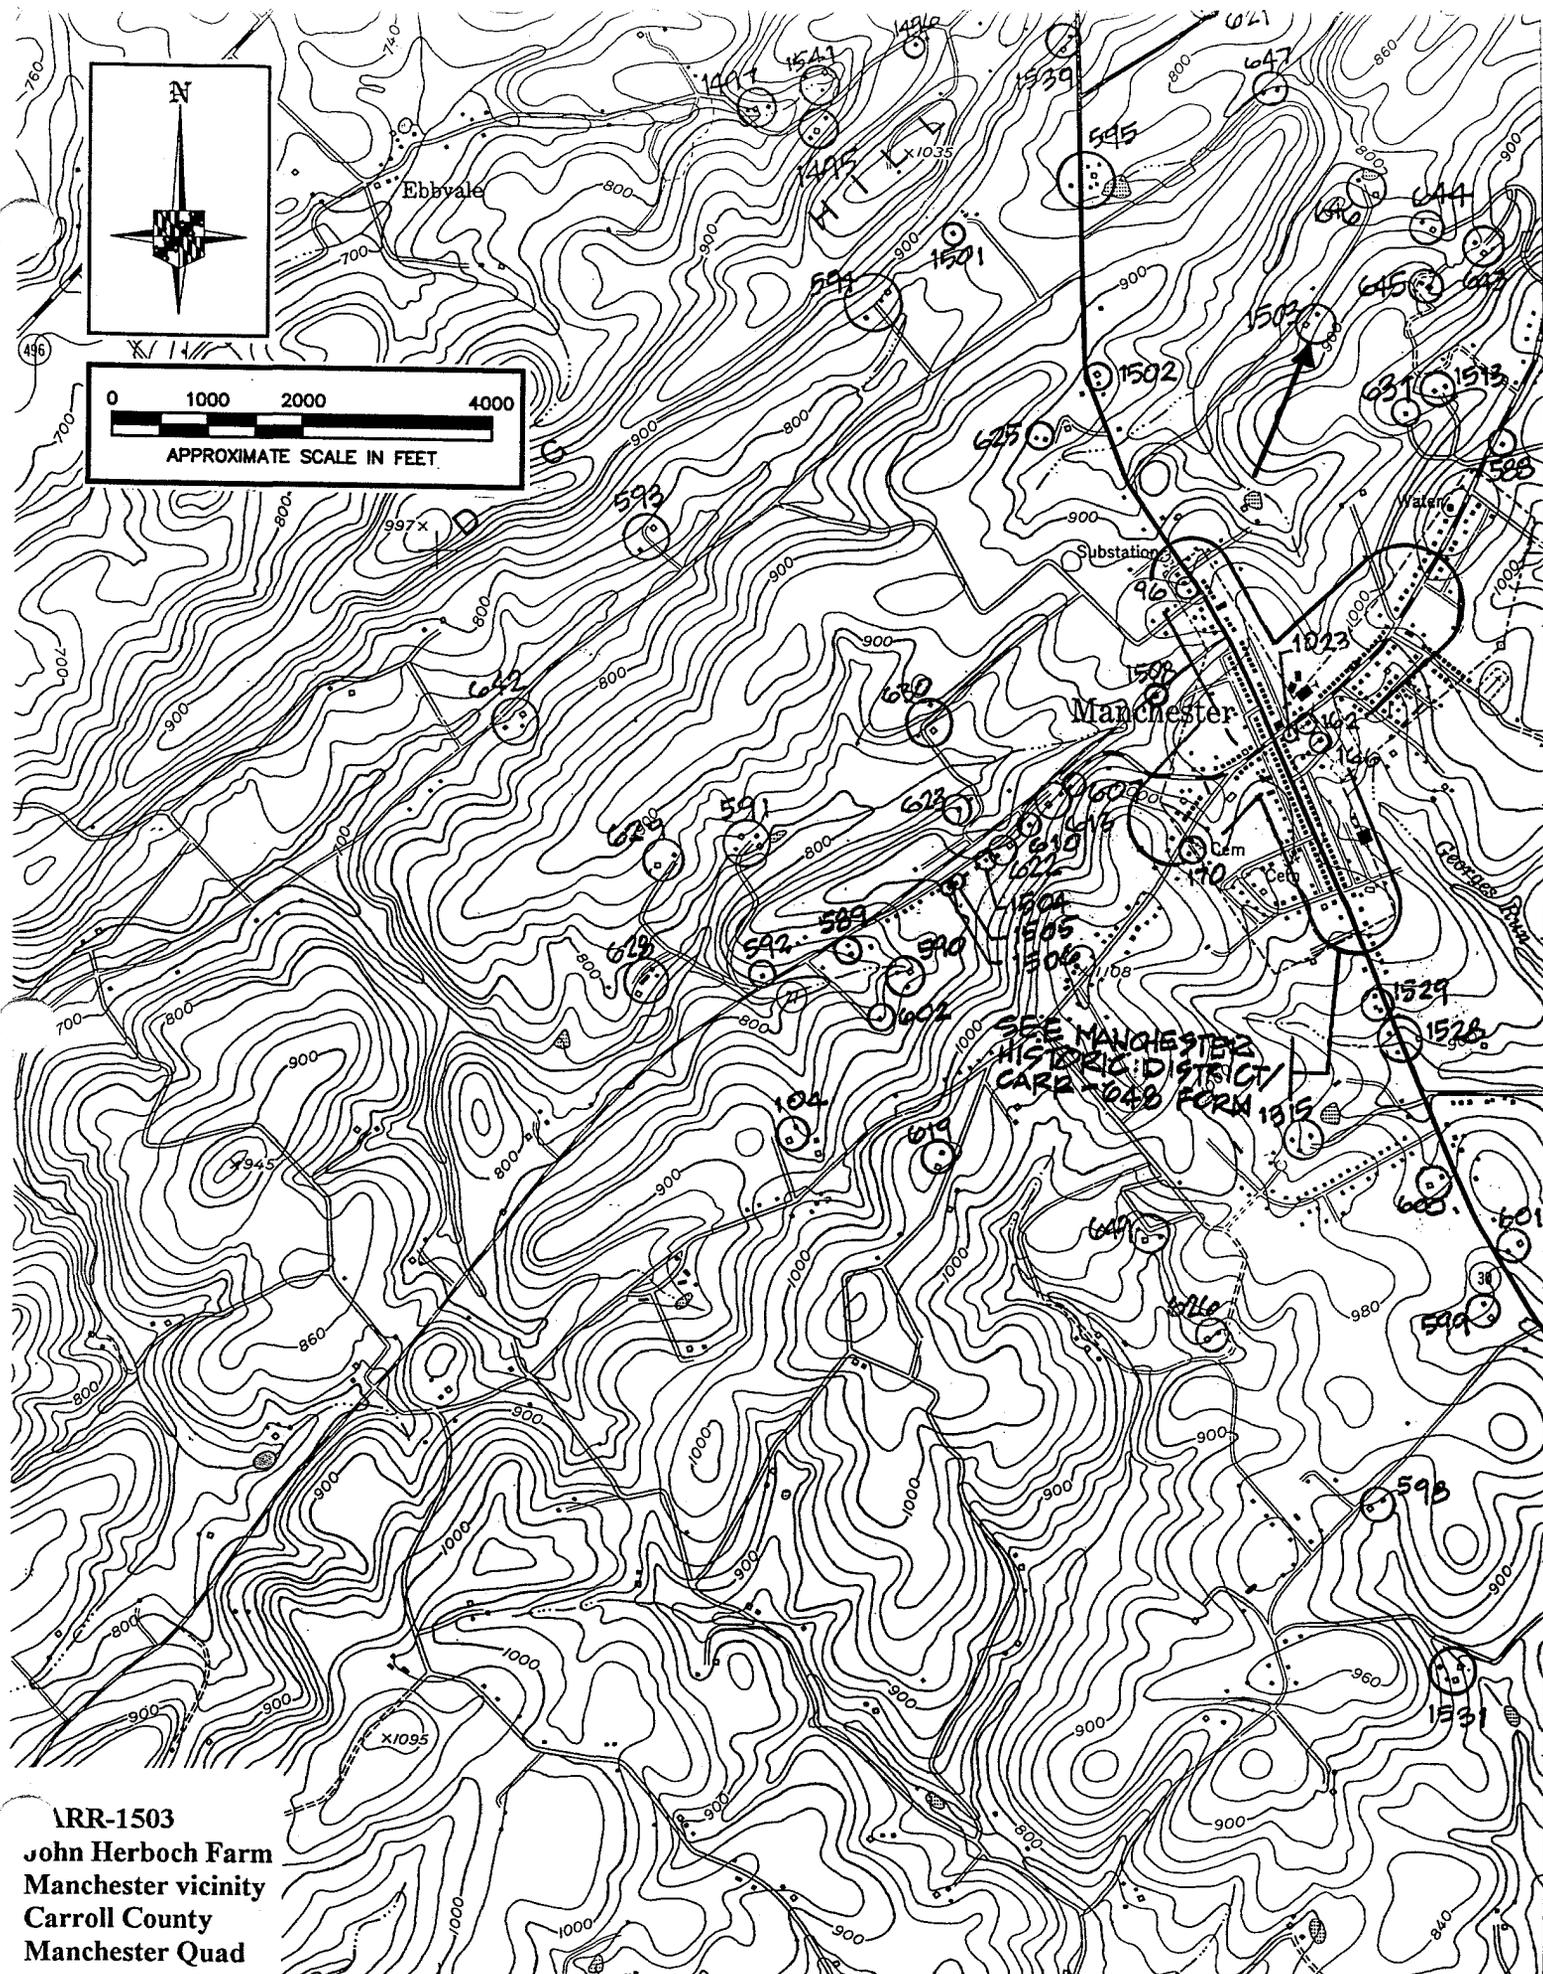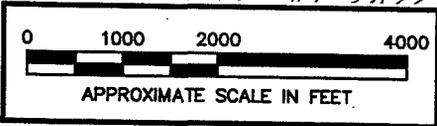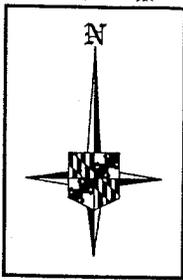

SEE MANCHESTER
HISTORIC DISTRICT/
CARD 1048 FORM 1915

ARR-1503
John Herboch Farm
Manchester vicinity
Carroll County
Manchester Quad

STMINSTER 5.2 MI.

1335 55' 1336 2 240 000 FEET (PA.) 1

INTERIOR-GEOLOGICAL SURVEY, RESTON, VIRGINIA-1988

338000m f

76°5'



1. CARR : 1503
2. Carroll County
3. Madeline Scheerer
4. June 1996
5. Maryland SHPO
6. Shindler House
3118 Fenwick Rd.
main/corner - NW elev.
- 7 1/3.



1. CARR: 1503
2. Carroll County
3. Madeline Scherer
4. June 1996
5. Maryland SHPO
6. Shindler House
3118 Fernin Road
main - North elev
7. 2/3



1. CARR: 1503
2. Carroll County
3. Madeline Scheerer
4. June 1996
5. Maryland SHPO
6. Shindler House
3118 Fenier Road
Barn - east elev.
7. 3/3