

K-108

Worth's Folly
Near Worton
c. 1780's

Worth's Folly was a 1000 acre tract first patented to John Worth in 1687. In the late 18th Century on part of that tract, a substantial brick house was constructed. In form it had a three bay two story main block with a 1 1/2 story kitchen wing. As built, the house faced south and had a quarter round water table, but no belt course in the Flemish bond brick work. The two basement windows had three-centered arches and the first story windows had row-lock arches. The windows of the first floor had 9/6 sash with those on the second story having 6/6 – a very common proportion in Kent County houses of the late 18th Century.

The north facade was laid in common bond and was similar to the south facade, except that there were only two windows on the second story, quite like its neighbor Dunkan's Folly and like Trulock as well.

Originally the plan consisted of a hall and parlor. A full wall of paneling contained the hall stair with closet beneath, the fireplace and another closet on the opposite side.

An interesting deviation from the normal second floor plan occurs here and at Dunkan's Folly across the road. There is a passage leading to an attic stair located in the center of the building. The usual location would be in the corner above the first stair. The location of the attic stair is the determining factor in not having a central window on the north side of the house. There were two small chambers on the south side of the passage,

divided from each other by vertical beaded board walls. A third chamber, above the parlor, was partitioned by a brick wall. In the eastern most chamber there was a small arched fireplace. All second floor joists were originally exposed and beaded, but the first floor was ceiled.

Early in the 20th Century, a framed second story was added over the one story kitchen wing. A straight run stair was added in the kitchen wing for access to the new room, as well as the old parlor chamber. Subsequent alterations were made in the 1970's and 1995.

K-108
Terra View
Lynch
Private

Late 18th Century

Terra View represents common Kent farmhouse type of the late 18th century. A paneled fireplace wall and Flemish bond facade typify the fine craftsmanship found in even modest dwellings of the period. An unusual element of this structure is its floor plan with a short hallway leading to an enclosed central attic stairway.

INVENTORY FORM FOR STATE HISTORIC SITES SURVEY

1 NAME

HISTORIC

AND/OR COMMON

Terra View

2 LOCATION

STREET & NUMBER

Worton Lynch Road

CITY, TOWN

Lynch

CONGRESSIONAL DISTRICT

First

STATE

Maryland

COUNTY

Kent

3 CLASSIFICATION

CATEGORY

DISTRICT

BUILDING(S)

STRUCTURE

SITE

OBJECT

OWNERSHIP

PUBLIC

PRIVATE

BOTH

PUBLIC ACQUISITION

IN PROCESS

BEING CONSIDERED

STATUS

OCCUPIED

UNOCCUPIED

WORK IN PROGRESS

ACCESSIBLE

YES: RESTRICTED

YES: UNRESTRICTED

NO

PRESENT USE

AGRICULTURE

COMMERCIAL

EDUCATIONAL

ENTERTAINMENT

GOVERNMENT

INDUSTRIAL

MILITARY

MUSEUM

PARK

PRIVATE RESIDENCE

RELIGIOUS

SCIENTIFIC

TRANSPORTATION

OTHER:

4 OWNER OF PROPERTY

NAME

Mrs. & Mr. George Debman

Telephone #: (301) 778-1288

STREET & NUMBER

Terra View Farm

CITY, TOWN

Worton

STATE, zip code

Maryland 21678

5 LOCATION OF LEGAL DESCRIPTION

COURTHOUSE,
REGISTRY OF DEEDS, ETC.

Kent County Courthouse

Liber #: E4P44

Folio #: 23A

STREET & NUMBER

CITY, TOWN

Chestertown

STATE

Maryland 21620

6 REPRESENTATION IN EXISTING SURVEYS

TITLE

DATE

FEDERAL STATE COUNTY LOCAL

DEPOSITORY FOR
SURVEY RECORDS

CITY, TOWN

STATE

7 DESCRIPTION

CONDITION		CHECK ONE	CHECK ONE
<input checked="" type="checkbox"/> EXCELLENT	<input type="checkbox"/> DETERIORATED	<input type="checkbox"/> UNALTERED	<input checked="" type="checkbox"/> ORIGINAL SITE
<input type="checkbox"/> GOOD	<input type="checkbox"/> RUINS	<input checked="" type="checkbox"/> ALTERED	<input type="checkbox"/> MOVED DATE _____
<input type="checkbox"/> FAIR	<input type="checkbox"/> UNEXPOSED		

DESCRIBE THE PRESENT AND ORIGINAL (IF KNOWN) PHYSICAL APPEARANCE

Terra View is a three bay, rectangular brick building with the same floor plan as Duncan's Folly, the next farm house west. Terra View (a recent name) is two stories high and stands on a low brick basement which is emphasized by a water table with a quarter round and stepped upper course: The brick wall on the east facade

is laid in Flemish bond with 1/8" beaded mortar joints; it is evenly fenestrated with a central entrance door with transom, two flanking 9/6 sash windows on the first floor and three 6/6 sash windows on the second floor. This was originally the main facade and looks over Muddy Branch Creek.

Other facades are laid in Liverpool bond brick. Window and door openings have row arches and basement windows have three-centered arches. The present front facade of the house has a central entrance without transom but no window above the door, for in that bay is an enclosed interior stair to the attic. The chimney is enclosed in the gable wall, but that on the north projects about 4".

Windows, all with 6/6 sash, are held in plain frames with a quarter round backband molding. The wooden sills project slightly. Modern louvered shutters, painted black are used at windows and doors. The box cornice is a modern replacement as are the brick entrance steps. On the present rear facade is a hip roofed, frame sun porch.

Against the gable is an early addition, which is as wide as the house, constructed of brick. It was originally one and one-half stories in height and an outline of the roof is visible on the brick gable inside the house. The frame second floor is a 20th century addition. A modern brick kitchen beside the old wing was constructed in 1970.

Originally, the main house was a hall and parlor type with corner stairs leading from the first to the second floors, and one enclosed stair located above the present main entry in a narrow hall and leading to the attic. One stair in the original parlor was removed and a modern straight run stair built outside the main house when the roof of the addition was raised. The other stairs remain. That in the hall is a part of a wall with fireplace and good raised and beveled panels with quarter round edges. Closets flank the fireplace which is slightly recessed. The fireplace, however, has been rebuilt and a mantle shelf added. Ceiling beams presently exposed in this room were not intended to be seen and are only roughly edged. However, those in the hall chamber are carefully planed and have beaded edges, a practice favored in the 18th century.

The house, although altered, is well maintained. Nearby is a group of very attractive modern gambrel roofed barns. The house is painted white, the barns grey.

8 SIGNIFICANCE

K-108

PERIOD	AREAS OF SIGNIFICANCE -- CHECK AND JUSTIFY BELOW			
<input type="checkbox"/> PREHISTORIC	<input type="checkbox"/> ARCHEOLOGY-PREHISTORIC	<input type="checkbox"/> COMMUNITY PLANNING	<input type="checkbox"/> LANDSCAPE ARCHITECTURE	<input type="checkbox"/> RELIGION
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> ARCHEOLOGY-HISTORIC	<input type="checkbox"/> CONSERVATION	<input type="checkbox"/> LAW	<input type="checkbox"/> SCIENCE
<input type="checkbox"/> 1500-1599	<input type="checkbox"/> AGRICULTURE	<input type="checkbox"/> ECONOMICS	<input type="checkbox"/> LITERATURE	<input type="checkbox"/> SCULPTURE
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> ARCHITECTURE	<input type="checkbox"/> EDUCATION	<input type="checkbox"/> MILITARY	<input type="checkbox"/> SOCIAL/HUMANITARIAN
<input checked="" type="checkbox"/> 1700-1799	<input type="checkbox"/> ART	<input type="checkbox"/> ENGINEERING	<input type="checkbox"/> MUSIC	<input type="checkbox"/> THEATER
<input type="checkbox"/> 1800-1899	<input type="checkbox"/> COMMERCE	<input type="checkbox"/> EXPLORATION/SETTLEMENT	<input type="checkbox"/> PHILOSOPHY	<input type="checkbox"/> TRANSPORTATION
<input type="checkbox"/> 1900-	<input type="checkbox"/> COMMUNICATIONS	<input type="checkbox"/> INDUSTRY	<input type="checkbox"/> POLITICS/GOVERNMENT	<input type="checkbox"/> OTHER (SPECIFY)
		<input type="checkbox"/> INVENTION		

SPECIFIC DATES

BUILDER/ARCHITECT

STATEMENT OF SIGNIFICANCE

Terra View is significant for its architecture. In form and detailing it represents a common type of Kent County farm house of late 18th century. Its paneled fireplace wall and brick detailing are well done and good representatives of finish detailing of this period. The unusual element of this structure is its floor plan with the short hallway which leads from the hall stairs to an enclosed, central attic stair. In nearby "Duncan's Folly" (K-107) the attic stair has been removed, although the plan was originally identical.

9 MAJOR BIBLIOGRAPHICAL REFERENCES

CONTINUE ON SEPARATE SHEET IF NECESSARY

10 GEOGRAPHICAL DATA

ACREAGE OF NOMINATED PROPERTY _____

VERBAL BOUNDARY DESCRIPTION

LIST ALL STATES AND COUNTIES FOR PROPERTIES OVERLAPPING STATE OR COUNTY BOUNDARIES

STATE COUNTY

STATE COUNTY

11 FORM PREPARED BY

NAME / TITLE

Marsha L. Fritz, Consultant

ORGANIZATION

Kent County Historical Society

DATE

August, 1977

STREET & NUMBER

Church Alley

TELEPHONE

CITY OR TOWN

Chestertown

STATE

Maryland 21620

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature, to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 Supplement.

The Survey and Inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

RETURN TO: Maryland Historical Trust
The Shaw House, 21 State Circle
Annapolis, Maryland 21401
(301) 267-1438

1. STATE Maryland
 COUNTY Kent
 TOWN Lynch VICINITY
 STREET NO. Worton-Lynch Rd at corner with Rt 561

ORIGINAL OWNER
 ORIGINAL USE dwelling
 PRESENT OWNER Jesse Metcalf II
 PRESENT USE dwelling
 WALL CONSTRUCTION Brick
 NO. OF STORIES 2

HISTORIC AMERICAN BUILDINGS SURVEY
 INVENTORY K-1088

2. NAME Caromat or ~~Duncan's Folly~~
Terra View
 DATE OR PERIOD 18th Cent.
 STYLE Colonial
 ARCHITECT
 BUILDER

3. FOR LIBRARY OF CONGRESS USE

4. NOTABLE FEATURES, HISTORICAL SIGNIFICANCE AND DESCRIPTION OPEN TO PUBLIC NO

2 story
 Duncan's Folly is a 3 bay long, 2 story brick house with ~~2 story~~ wing, ~~partly~~ half brick + half frame. There is a mided ~~material~~ above the basement window which are supported by ~~segmental~~ arches. The brick is laid - Flemish bond on the south & east sides. The window of the 1st floor have $\frac{9}{16}$ sash and are supported by flat arches, vertical headers, ~~and~~ the windows of the 2nd story have $\frac{9}{16}$ sash; both have black shutters ~~against~~ the white paint of the walls. There are 2 windows on the north facade, 2nd floor. The wood box ~~cornice~~ has small moldings. There are 2 small casements on each gable flanking the chimney with one enclosed within the gables. The east gable of the wing retains the outline of the 1 or 1 1/2 story ~~original~~ ~~apex~~. This is 2 bays long and there are also small windows in the gable & both sections have "A" roofs.

5. PHYSICAL CONDITION OF STRUCTURE Endangered NO Interior Exterior good

6. LOCATION MAP (Plan Optional)

7. PHOTOGRAPH


8. PUBLISHED SOURCES (Author, Title, Pages) INTERVIEWS, RECORDS, PHOTOS, ETC.


9. NAME, ADDRESS AND TITLE OF RECORDER
Michael Bourne
 DATE OF RECORD Oct 1, 1968

SUPPLEMENTAL INFORMATION AND PHOTOGRAPHS MAY BE ADDED ON SHEET OF SAME SIZE
 Deed - EMP 23/404
 132 acres

Duncan's Folly is a three bay long, two story brick house with a two story wing half brick and half frame. There is a molded water-table above the basement windows which are supported by segmental arches. The brick is laid in Flenish bond on the south and east sides. The windows of the first floor have 9/6 sashes and are supported by flat arches of vertical headers. The windows of the second story have 6/6 sash; both have black shutters against the white paint of the walls. There are only two windows on the north facade, second floor. The wood box cornice has small moldings. There are two small casements on each gable flanking the chimney, which are enclosed within the gables. The last gable of the wing retains the outline of the one or one and one half story original appearance. This is two bays long and there are also small windows in the gable. Both sections have "A" roofs.

K-108
Worth's Folly
26275 Worton Lynch Road, Worton
Betterton Quadrangle

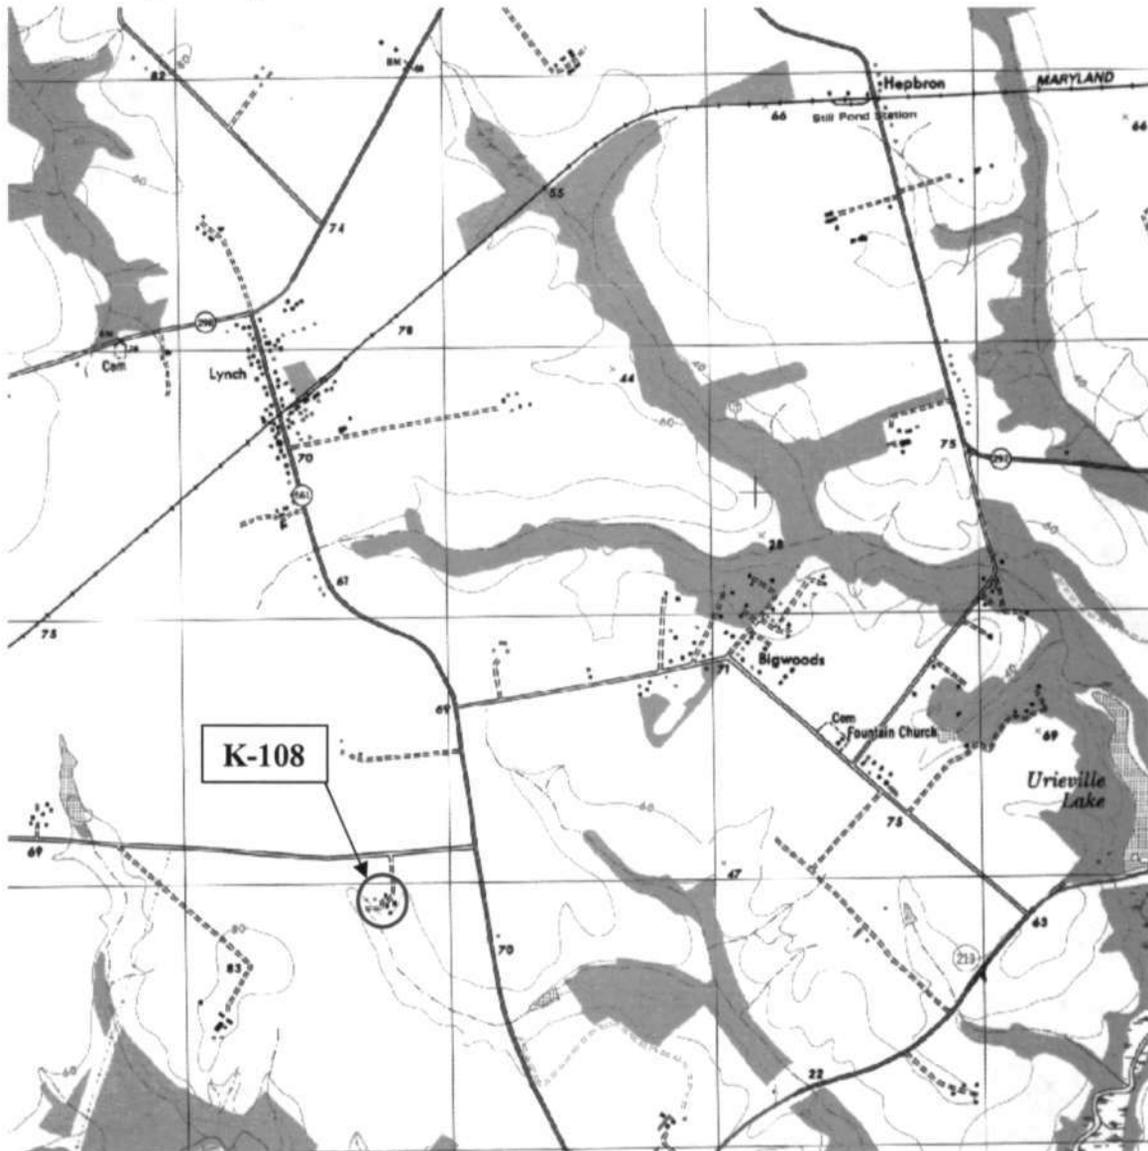

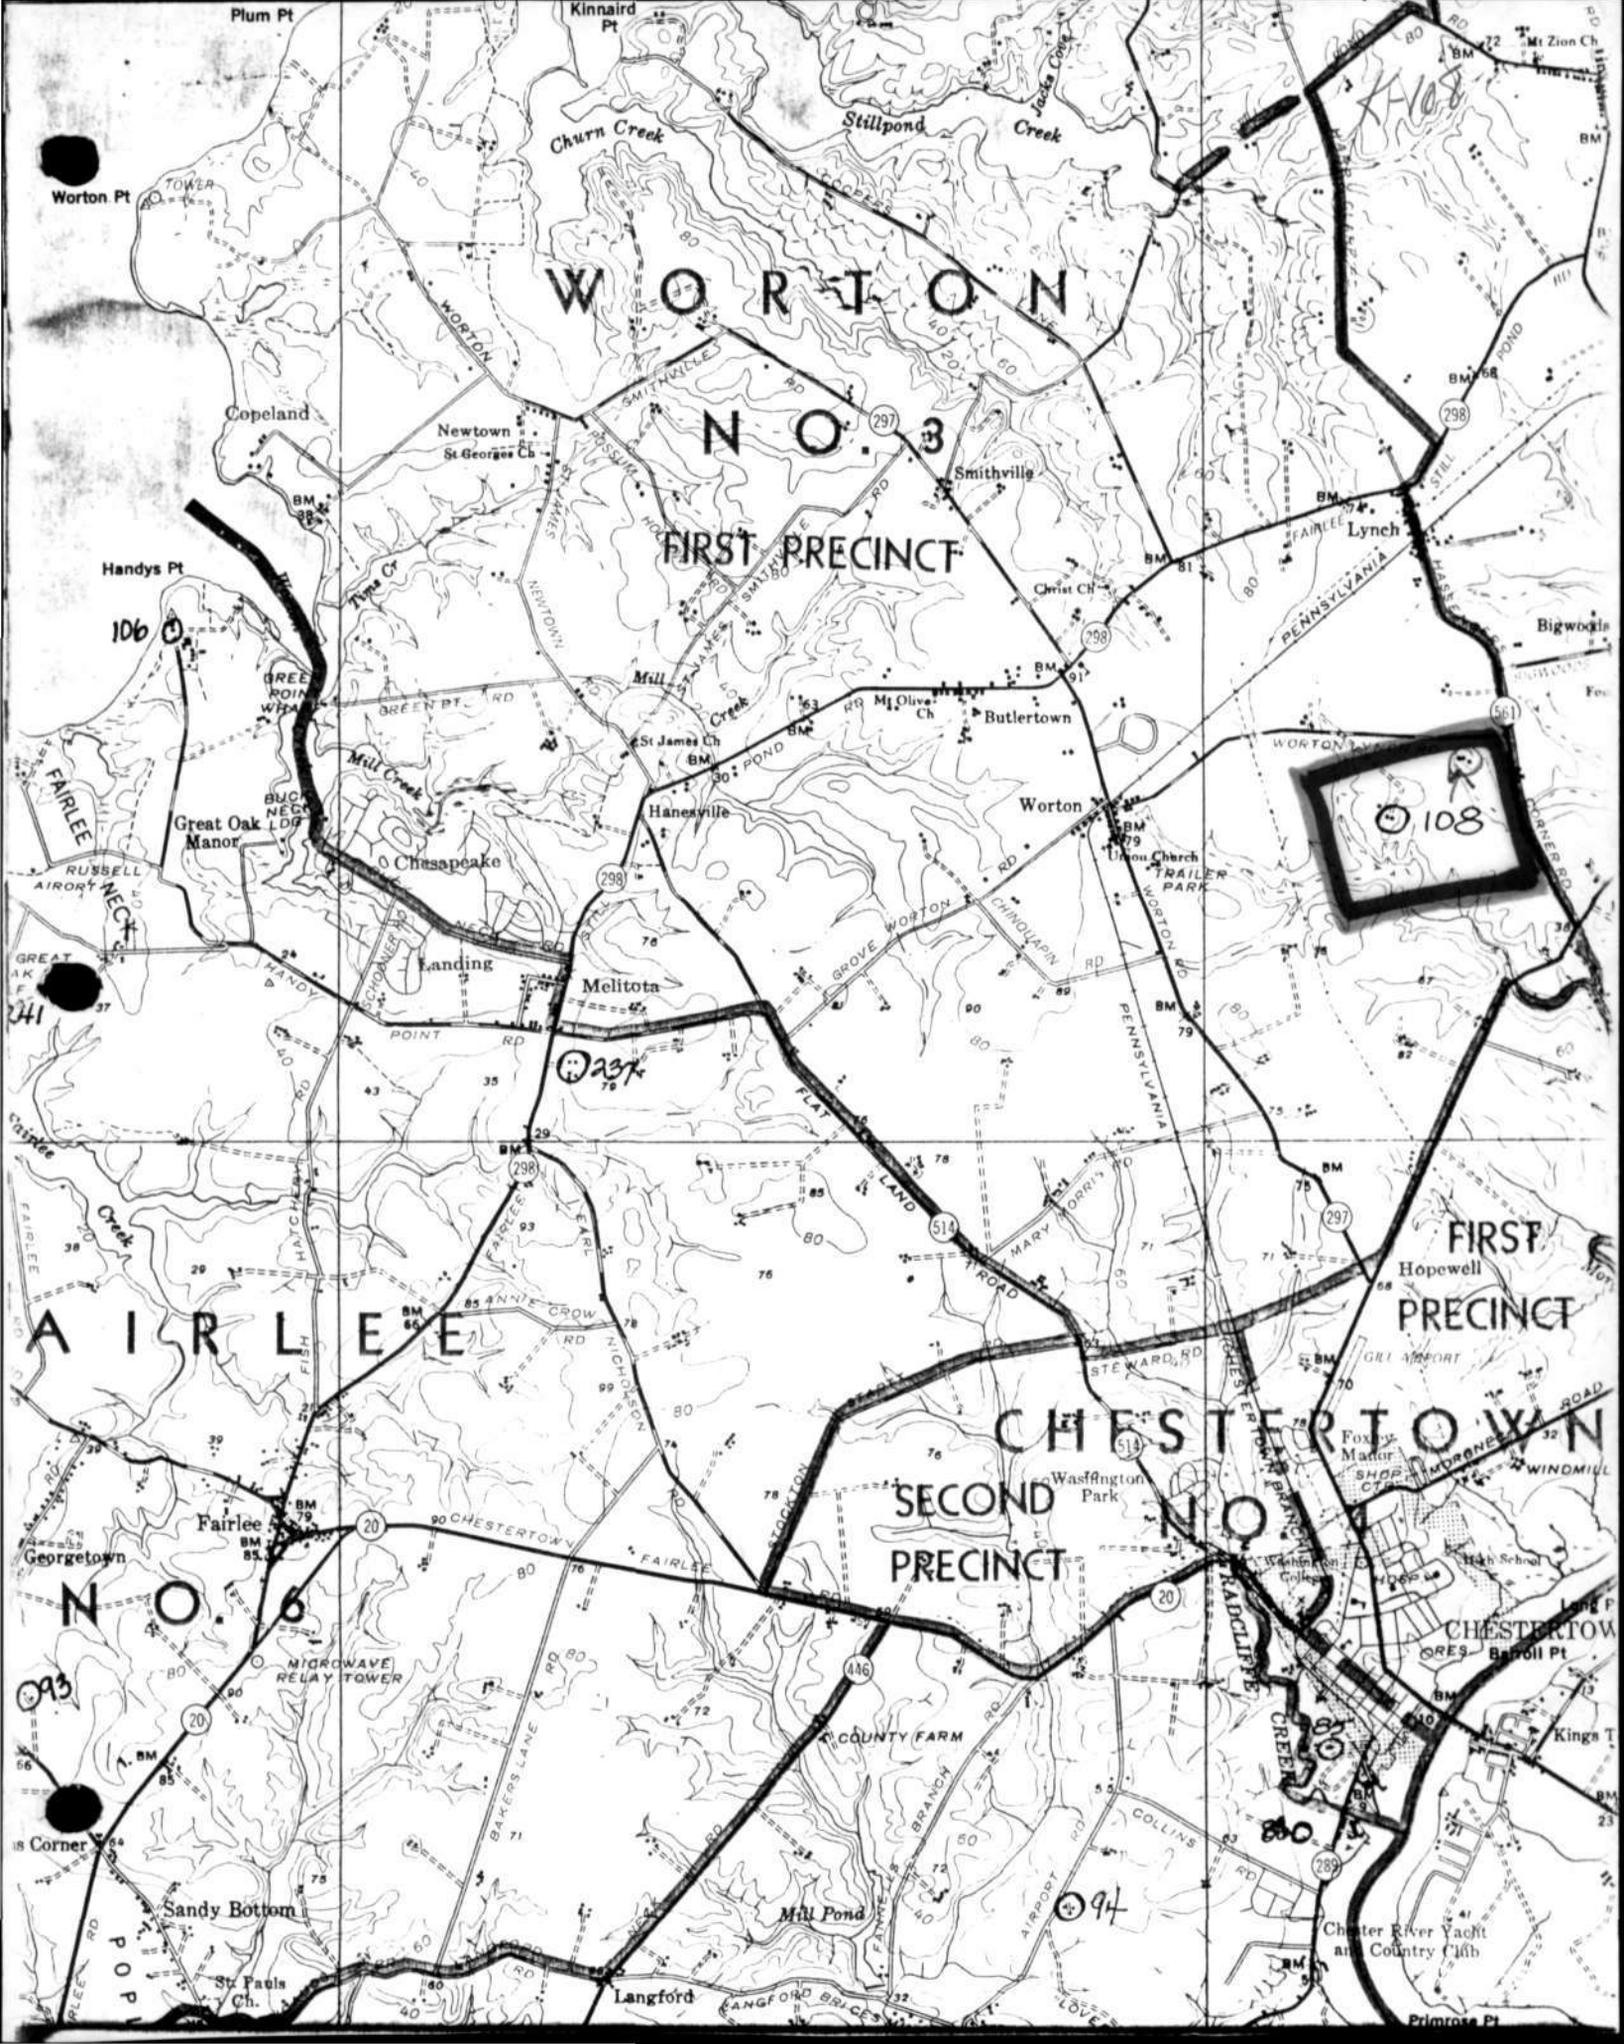

W O R T O N

N O . 3

FIRST PRECINCT

108

106

237

94

A I R L E E

N O . 6

SECOND PRECINCT

C H E S T E R T O W N

FIRST PRECINCT

C H E S T E R T O W N

Worton Pt
TOWER
Handys Pt
Copeland
Newtown
St Georges Ch
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo

Great Oak Manor
Chesapeake
Landing
Melitota
Fairlee
Georgetown
Fairlee
MIGROWAVE RELAY TOWER
Sandy Bottom
St Pauls Ch

Churn Creek
Stillpond
Creek
Jacks Cove
Mill Creek
St James Ch
Hanesville
Worton
Chesapeake
Landing
Melitota
Fairlee
Georgetown
Fairlee
MIGROWAVE RELAY TOWER
Sandy Bottom
St Pauls Ch

Worton
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo

Worton
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo

Worton
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo

Worton
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo

Worton
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo

Worton
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo

Worton
Smithville
Christ Ch
Butlertown
Worton
Union Church
TRAILER PARK
Fairlee
Lynch
Bigwoka
Feo



Jura View K-108

Worton, Md

C. Engstrom #77

Front facade



TERRA VIEW

MHT-K 108

WORTON-LYNCH RD

WORTON, MD.

FIRST FLOOR - EAST ROOM END

C. ENGSTROM AUG. 1977