

WORKMAN FARM
Worton, Maryland
(ca 1825)

K-223

Although appearing to be a small simple two part farmhouse from the exterior, the Workman Farm house contains some of the best late Federal woodwork in the county. The mantle in the hall is particularly beautiful, both in its overall proportions and in the execution of its details. Virtually all of the woodwork and doors in the frame section remain, as does some hardware and the exterior shutters and hardware. The brick kitchen wing, although its interior has been extensively remodeled, is an early and compatible addition to the earlier three bay, two story frame section.

The smoke house is an example of a once-common construction system: squared logs or "planks" dovetailed together at the corners. It retains its original strap hinges, an early wrought iron hasp and portions of a wooden box lock.

MARYLAND HISTORICAL TRUST K - 223

INVENTORY FORM FOR STATE HISTORIC SITES SURVEY

1 NAME

HISTORIC WORKMAN FARM

AND/OR COMMON

2 LOCATION

STREET & NUMBER

East side of Route 29[?], 1/2 mile south of
junction with Route 298

CITY, TOWN

Worton

VICINITY OF

1st

CONGRESSIONAL DISTRICT

Kent

STATE

Maryland

COUNTY

3 CLASSIFICATION

CATEGORY	OWNERSHIP	STATUS	PRESENT USE	
<input type="checkbox"/> DISTRICT	<input checked="" type="checkbox"/> PUBLIC	<input checked="" type="checkbox"/> OCCUPIED	<input type="checkbox"/> AGRICULTURE	<input type="checkbox"/> MUSEUM
<input checked="" type="checkbox"/> BUILDING(S)	<input type="checkbox"/> PRIVATE	<input type="checkbox"/> UNOCCUPIED	<input type="checkbox"/> COMMERCIAL	<input type="checkbox"/> PARK
<input type="checkbox"/> STRUCTURE	<input type="checkbox"/> BOTH	<input type="checkbox"/> WORK IN PROGRESS	<input type="checkbox"/> EDUCATIONAL	<input checked="" type="checkbox"/> PRIVATE RESIDENCE
<input type="checkbox"/> SITE	PUBLIC ACQUISITION	ACCESSIBLE	<input type="checkbox"/> ENTERTAINMENT	<input type="checkbox"/> RELIGIOUS
<input type="checkbox"/> OBJECT	<input type="checkbox"/> IN PROCESS	<input type="checkbox"/> YES: RESTRICTED	<input type="checkbox"/> GOVERNMENT	<input type="checkbox"/> SCIENTIFIC
	<input type="checkbox"/> BEING CONSIDERED	<input type="checkbox"/> YES: UNRESTRICTED	<input type="checkbox"/> INDUSTRIAL	<input type="checkbox"/> TRANSPORTATION
		<input checked="" type="checkbox"/> NO	<input type="checkbox"/> MILITARY	<input type="checkbox"/> OTHER:

4 OWNER OF PROPERTY

NAME

Ralph L. Workman

Telephone #: 609-429-4930

STREET & NUMBER

1889 E. Marlton Pike

CITY, TOWN

Cherry Hill

VICINITY OF

STATE, zip code

New Jersey 08034

5 LOCATION OF LEGAL DESCRIPTIONCOURTHOUSE,
REGISTRY OF DEEDS, ETC.

Kent County Court House

Liber #: EHP 37

Folio #: 756

STREET & NUMBER

CITY, TOWN

Chestertown, Maryland

STATE

6 REPRESENTATION IN EXISTING SURVEYS

TITLE

Maryland Historical Trust, Survey of Kent County

DATE

1968

 FEDERAL STATE COUNTY LOCALDEPOSITORY FOR
SURVEY RECORDS

Maryland Historical Trust, The Shaw House, 21 State Circle

CITY, TOWN

Annapolis, Maryland

STATE

7 DESCRIPTION

K-223

CONDITION		CHECK ONE	CHECK ONE
<input type="checkbox"/> EXCELLENT	<input type="checkbox"/> DETERIORATED	<input type="checkbox"/> UNALTERED	<input checked="" type="checkbox"/> ORIGINAL SITE
<input checked="" type="checkbox"/> GOOD	<input type="checkbox"/> RUINS	<input checked="" type="checkbox"/> ALTERED	<input type="checkbox"/> MOVED DATE _____
<input type="checkbox"/> FAIR	<input type="checkbox"/> UNEXPOSED		

DESCRIBE THE PRESENT AND ORIGINAL (IF KNOWN) PHYSICAL APPEARANCE

Now surrounded by open fields, the late Federal period building on the Workman Farm faces southwest. From the site are views to the Jewell Farm (K-225) and the 1770 House (K-222) as well as to the intersection of Route 298 and Route 292.

The house is composed of two sections, a three bay, two story frame section and a two bay two story gable roofed kitchen on the east gable.

The main house measures 32'4" by 18'6". The front wall of the wing is continuous with the southwest wall of the house; it measures 17'6" deep and 23'10" long.

The frame section is the earlier. It has central entry doors and a hall and parlour plan. There are chimney stacks enclosed in each gable; both are brick and both contain 2 flues.

The roof is a gable of moderate pitch; it has no dormers. Windows are regularly spaced and have 6 over 6 sash. They retain early louvered shutters hung on small strap hinges set on driven pintels. The rails and stiles of the shutters are quite wide and all finished on the inside edge with a bead. First floor shutters have a single panel of louvering; those on the second have double panels.

Recently the frame section was covered with vinyl siding. The cornice, verge board, trim, and the entire entry door on the southwest facade was covered with siding.

The brick section also has a shallow gable roof without dormers. Instead of a wooden cornice, three steps of corbelling is used at the cornice line. There is an entry in the northern bay of the front and a shed-roofed extension on the northeast wall. A door has been cut into the east gable. Windows have 6 over 6 sash but are shorter than those in the frame section. Frames and sills are plain.

The interior of the frame section retains almost all of its original woodwork. Window and door trim on the first floor is illustrated below; it is used with turned corner blocks. The double bead used in the backband portion of the trim is repeated

CONTINUE ON SEPARATE SHEET IF NECESSARY

8 SIGNIFICANCE

K-223

PERIOD	AREAS OF SIGNIFICANCE -- CHECK AND JUSTIFY BELOW			
<input type="checkbox"/> PREHISTORIC	<input type="checkbox"/> ARCHEOLOGY-PREHISTORIC	<input type="checkbox"/> COMMUNITY PLANNING	<input type="checkbox"/> LANDSCAPE ARCHITECTURE	<input type="checkbox"/> RELIGION
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> ARCHEOLOGY-HISTORIC	<input type="checkbox"/> CONSERVATION	<input type="checkbox"/> LAW	<input type="checkbox"/> SCIENCE
<input type="checkbox"/> 1500-1599	<input type="checkbox"/> AGRICULTURE	<input type="checkbox"/> ECONOMICS	<input type="checkbox"/> LITERATURE	<input type="checkbox"/> SCULPTURE
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> ARCHITECTURE	<input type="checkbox"/> EDUCATION	<input type="checkbox"/> MILITARY	<input type="checkbox"/> SOCIAL/HUMANITARIAN
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> ART	<input type="checkbox"/> ENGINEERING	<input type="checkbox"/> MUSIC	<input type="checkbox"/> THEATER
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> COMMERCE	<input type="checkbox"/> EXPLORATION/SETTLEMENT	<input type="checkbox"/> PHILOSOPHY	<input type="checkbox"/> TRANSPORTATION
<input type="checkbox"/> 1900-	<input type="checkbox"/> COMMUNICATIONS	<input type="checkbox"/> INDUSTRY	<input type="checkbox"/> POLITICS/GOVERNMENT	<input type="checkbox"/> OTHER (SPECIFY)
		<input type="checkbox"/> INVENTION		

SPECIFIC DATES ca 1825

BUILDER/ARCHITECT

STATEMENT OF SIGNIFICANCE

Although appearing to be a small simple farmhouse from the exterior, the Workman Farm contains some of the best late Federal woodwork in the county. The mantle in the hall is particularly beautiful, both in its overall proportions and in the execution of its details. Virtually all of the woodwork and doors in the frame section remain, as does some hardware and the exterior shutters and hardware. The kitchen wing, although its interior has been extensively remodeled, is an early and compatible addition to the frame section.

The smoke house is an example of a once-common construction system: squared logs or "planks" dovetailed together at the corners. It retains its original strap hinges, an early wrought iron hasp and portions of a wooden box lock.

Unfortunately the frame house has recently been covered with wood grained vinyl siding. Details of the cornice have been obscured and the front door hidden, but, of more concern is the possible damage to the original siding caused by retention of moisture behind the siding.

CONTINUE ON SEPARATE SHEET IF NECESSARY

K-223

9 MAJOR BIBLIOGRAPHICAL REFERENCES

CONTINUE ON SEPARATE SHEET IF NECESSARY

10 GEOGRAPHICAL DATA

ACREAGE OF NOMINATED PROPERTY _____

VERBAL BOUNDARY DESCRIPTION

LIST ALL STATES AND COUNTIES FOR PROPERTIES OVERLAPPING STATE OR COUNTY BOUNDARIES

STATE	COUNTY
STATE	COUNTY

11 FORM PREPARED BY

NAME / TITLE
Marsha L. Fritz, Survey Consultant

ORGANIZATION
Kent County Planning Commission

DATE
778-4600, ext.67

STREET & NUMBER
Court House

TELEPHONE

CITY OR TOWN
Chestertown, Maryland

STATE

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature, to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 Supplement.

The Survey and Inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

RETURN TO: Maryland Historical Trust
The Shaw House, 21 State Circle
Annapolis, Maryland 21401
(301) 267-1438

as the panel molding of the eight panel entry doors and on the upper molding and lower edge of the two part hall chairrail. This chairrail also has 3 3/4" wide bands of reeding spaced at intervals of about 3 1/2". The main entry on the southwest also has a four light transom. This feature is visible on the interior only.

The mantle in the parlour has a rectangular opening flanked by reeded pilasters. There is a curved mantle shelf which is supported by moldings with dentils and carved sunbursts above the pilasters. There is a closet with a beaded door to the left of the mantle and a six panel door on the stair.

In the parlour the mantle is similiar but simpler and has Greek ogee moldings. Trim and mantles on the second floor have Federal profiles. Some old latches and locks remain in the house.

Also on the property is a squared-log shed which measures 10' by 11'10" and has a steeply pitched gable roof. The corners of the building are dovetailed. The exterior of the building is covered with verticle boards and the roof with wooden shingles. The board and batten door is hung on wrought iron strap hinges and has a wooden box lock.

Well maintained except for the new siding, the house is occupied by tenants.

This house is a three bay long, two story frame structure with a two bay long, two story brick wing.

The house sits on a stone foundation and is covered with clapboard. The windows of the west facade have original trim, also louvered shutters and 6/6 sashes. The central entrance has an eight panel door with rectangular transom and a covered porch. There is a wood cornice with torus molding. In each gable is a brick chimney flanked by two casement windows.

The brick section is also built on a stone foundation. The door is covered with a small porch and is located next to the main house. There are flat brick arches above the windows and 6/6 sashes. There is a three brick stepped cornice. It also has a chimney in the south gable flanked by two casements. The entire wing is laid in common bond.

1. STATE <u>Maryland</u> COUNTY <u>Kent</u> TOWN <u>Worton</u> VICINITY STREET NO. <u>Rt 298</u>	HISTORIC AMERICAN BUILDINGS SURVEY INVENTORY <u>K-223</u>
ORIGINAL OWNER <u>Hebron & Dunlap</u> ORIGINAL USE <u>dwellin</u> PRESENT OWNER <u>Mrs Emma Workman</u> PRESENT USE <u>dwellin</u> WALL CONSTRUCTION <u>frame + brick</u> NO. OF STORIES <u>2</u>	2. NAME <u>Workman Farm House</u> DATE OR PERIOD <u>19th Century</u> STYLE <u>Colonial</u> ARCHITECT BUILDER
3. FOR LIBRARY OF CONGRESS USE	

SUPPLEMENTAL INFORMATION AND PHOTOGRAPHS MAY BE ADDED ON SHEET OF SAME SIZE
Worton Kent = Worton.

4. NOTABLE FEATURES, HISTORICAL SIGNIFICANCE AND DESCRIPTION OPEN TO PUBLIC No

This house is a 3 bay bay, 2 story frame structure with a 2 bay bay, ~~2~~ 2 story brick wing. The house sits on a stone foundation and is covered with clapboard. The windows of the west facade have original trim, also louver shutters + 6/8 oak. The central entrance has an 8 panel door with rectangular transom and a covered porch. There is a wood cornice with torus molding. The each gable is a brick chimney flanked by 2 casements.

The brick section is also built on a stone foundation. The door is covered with a small porch and is located next to the main house. There are flat brick orders above the windows and 6/8 oak. There is a 3 bilt stepped cornice. It also has a chimney in the center gable flanked by 2 casements. The entire wing is laid in common bond.

5. PHYSICAL CONDITION OF STRUCTURE Endangered No Interior Exterior fair

6. LOCATION MAP (Plan Optional) 7. PHOTOGRAPH

8. PUBLISHED SOURCES (Author, Title, Pages) INTERVIEWS, RECORDS, PHOTOS, ETC.

9. NAME, ADDRESS AND TITLE OF RECORDER
Michael Bourne

DATE OF RECORD Oct 1, 1968

HEPBRON PENNSYLVANIA

K-223

~~223~~

Stillpond Station

225

227

226

416

Bigwoods

Cem Fountain Church

283

293

107

108

291

292

201

195

294


202

196

300

MORGEN

Morgnac

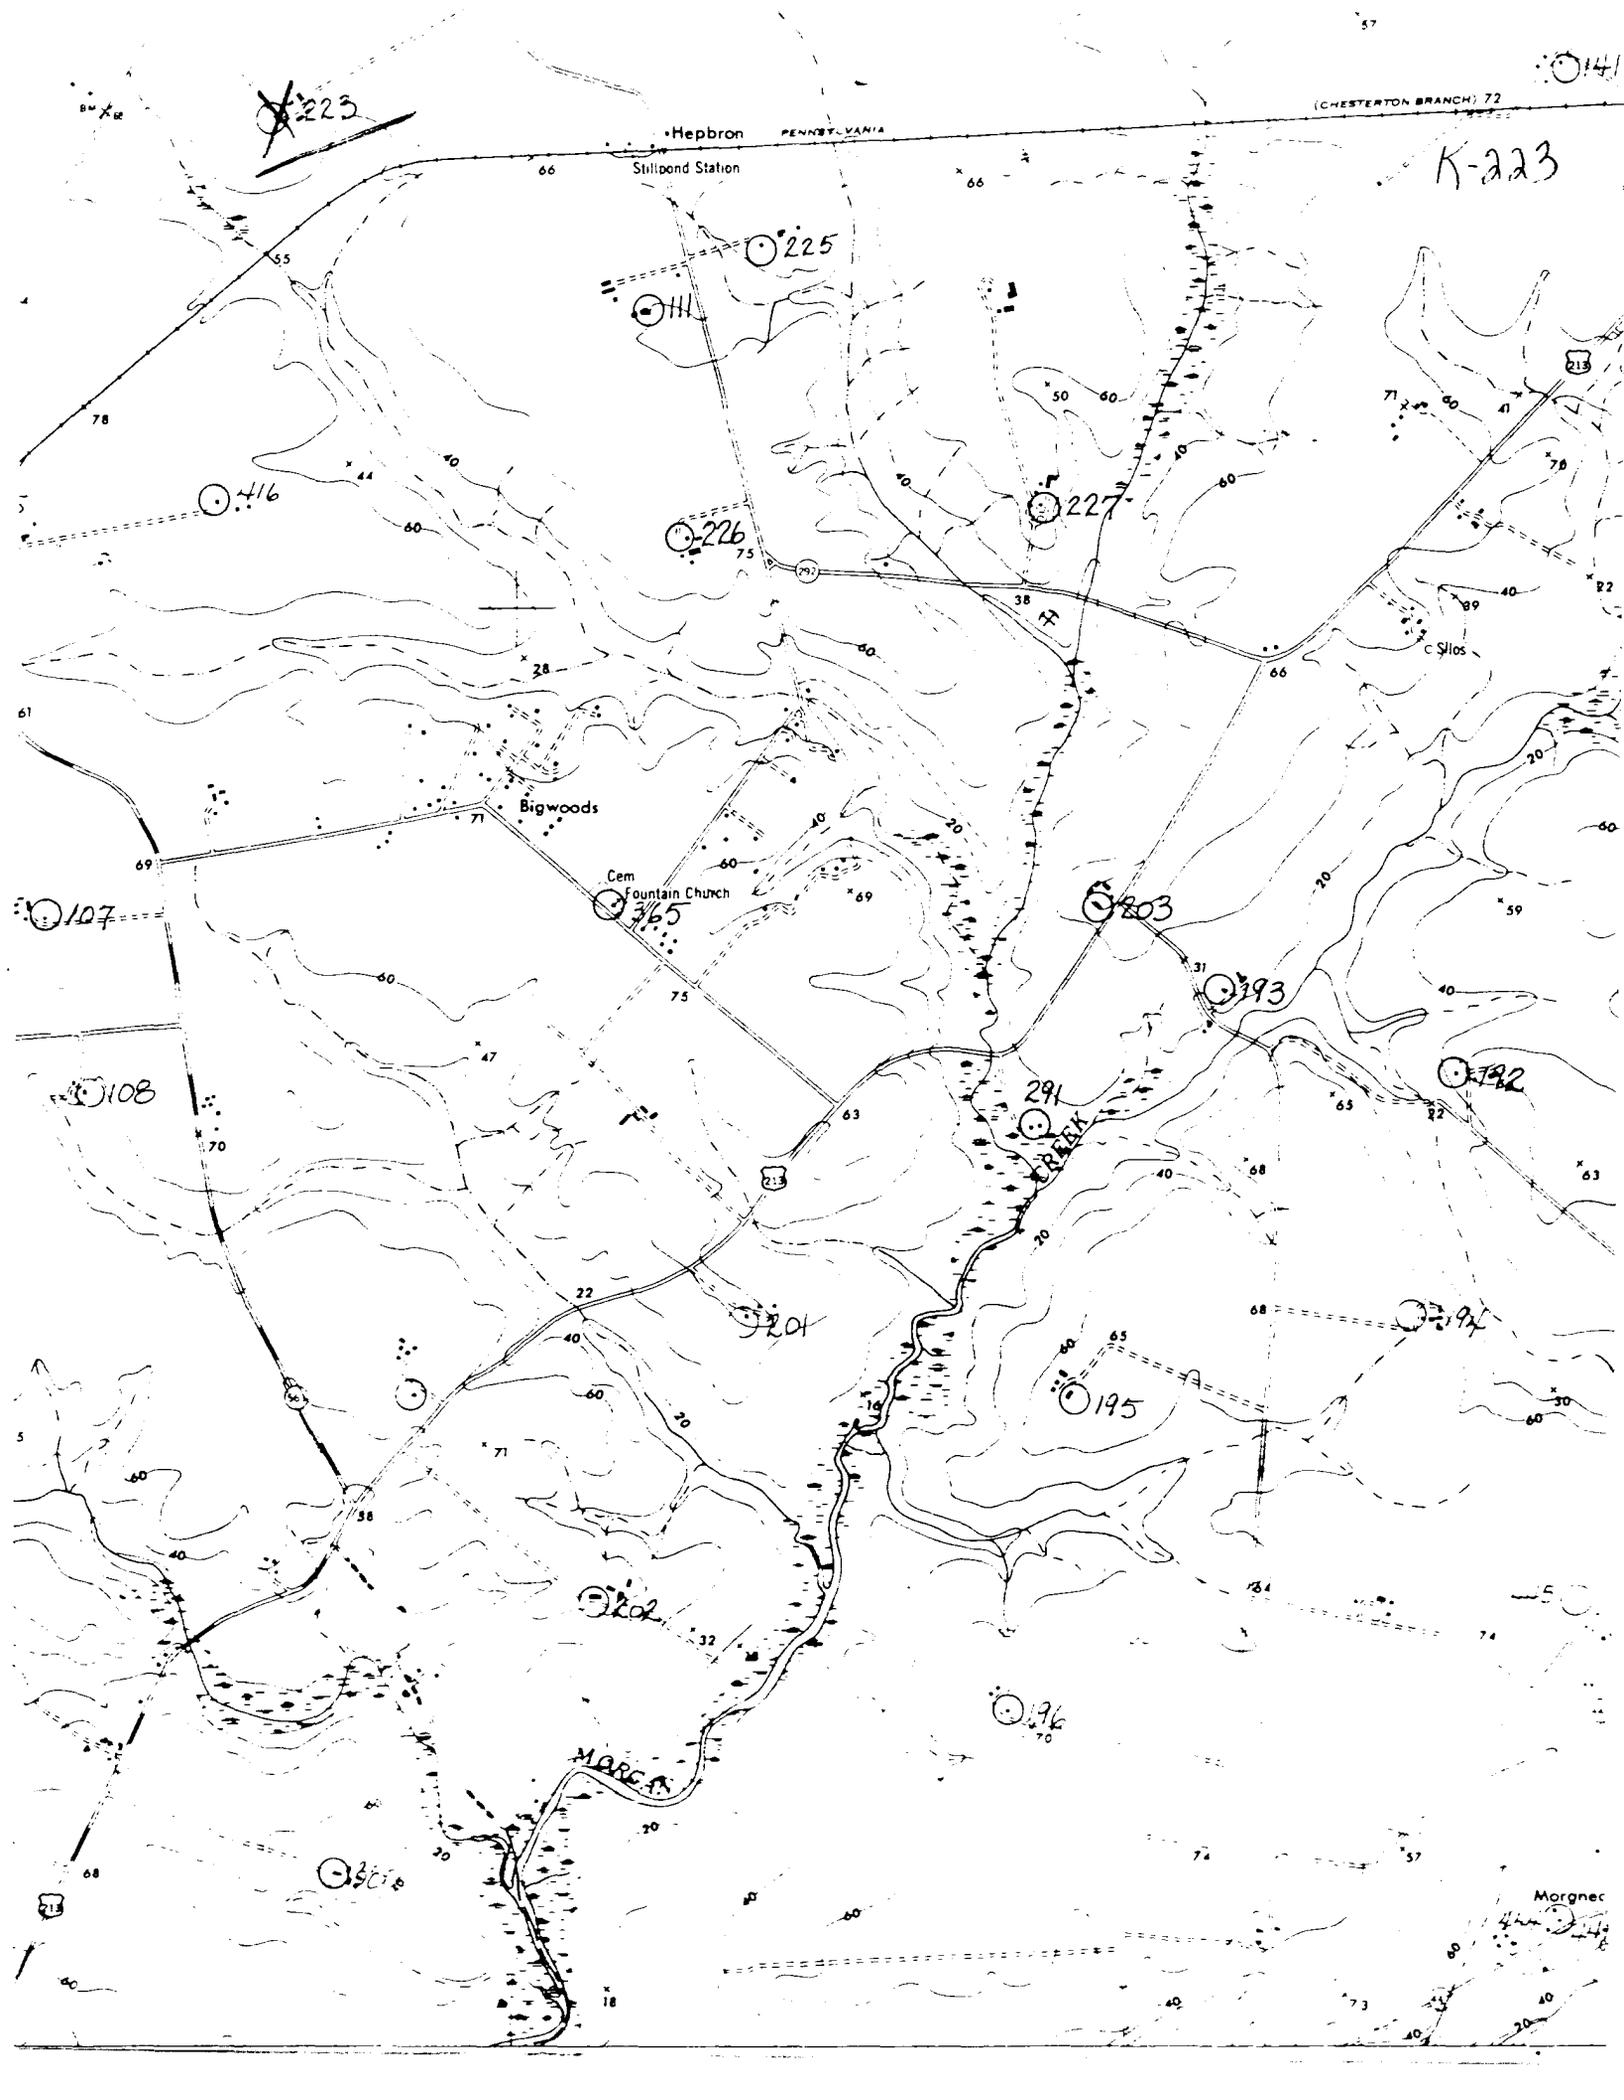



K-223

Workman Farm

View to North

M.L. Fritz

7/1980

PRINTED BY
J. Tyler Campbell
CHESTERTOWN, MARYLAND
JUN 11 1980



K-223

Workman Farm

Hall Mantel

M.L. Fritz

7/1980

PRINTED BY

J. Tyler Cochran

CHESTERTOWN, MARYLAND

JUN 11 1980