

SM-1D Mulberry Fields Carriage House Constructed
Fall-Winter, 1837

This small outbuilding has a mortised and tenoned, braced, box frame; tie beams that supported jettied flat false plates; and a roof of collar-coupled, common rafters. All original scantlings are pit-sawn from hewn baulks. Posts, studs, and braces are oak. Most upper members are poplar. The roof is lathed on 6 inch centers for shingles. The walls may have been enclosed with riven boards. One post displays a nail hole pattern of single nails on 8 to 5 inch centers. At first, the building measured 18 by 12 ft. Sometime after its shingle cover had been renewed at least once, the building was extended with a 9 foot wide shed. The original function of the building is unknown. The carriage doors intrude the diagonal wall bracing.

The construction of this building follows two years of excellent wheat prices, an important crop of this Potomac plantation.

References: Marks, "Economy and Society," pp.137, 185.

Stone, Field notes, SM-1, Architectural files,
St. Mary's City Commission.

THE KEY-YEAR DENDROCHRONOLOGICAL
PATTERN FOR THE OAKS OF
MARYLAND'S WESTERN SHORE 1570-1980

American Institute of
Dendrochronology

APPENDIX


Building Descriptions

Garry Wheeler Stone

Historic St. Mary's City

1987

SM-1D
Mulberry Fields Carriage House
19700 Mulberry Fields Road
Piney Point Quadrangle

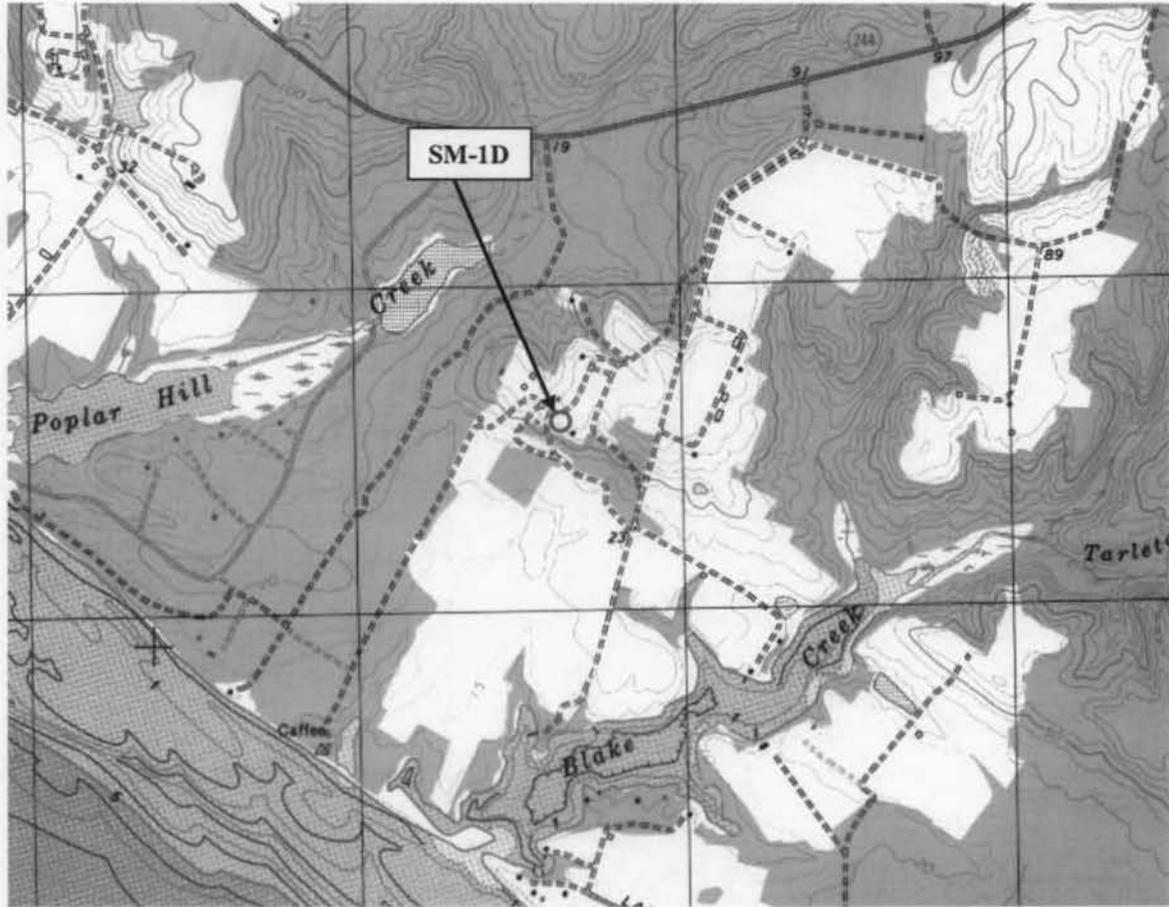

1993 Aerial Photo

Tax Map 56

